

Inhaltsverzeichnis

1A. Einleitung	11
Schritt 1 - Anleitung Infos	12
Schritt 2 - How to navigate through the manual	12
Schritt 3 - View high resolution images	13
Schritt 4 - Kompatibilität	13
Schritt 5 - Wichtig: Schutz der Elektronik	14
Schritt 6 - Abbildungen der Bauteile	15
Schritt 7 - Ersatzteilbeutel	15
Schritt 8 - We are here for you!	16
Schritt 9 - Pro tip: inserting the nuts	17
Schritt 10 - Lagerschmierung Applikator	18
Schritt 11 - Bereiten Sie Ihren Arbeitsplatz vor	18
1B. MK4S Inspektion	19
Schritt 1 - Einleitung	20
Schritt 2 - Firmware Update	21
Schritt 3 - Drucker Vorbereitung 2	21
Schritt 4 - Drucker Vorbereitung 2	22
Schritt 5 - Drucker Vorbereitung 3	22
Schritt 6 - Heizbett Inspektion	23
Schritt 7 - Y-Stangen Inspektion	23
Schritt 8 - Haribo Zeit!	24
Schritt 9 - Los geht's	24
1c. Demontage des Druckers	25
Schritt 1 - Erforderliche Werkzeuge	26
Schritt 2 - Elektronik Demontage	26
Schritt 3 - Wi-Fi Demontage	27
Schritt 4 - Kabelbündel Demontage	27
Schritt 5 - Lösen der Kabel 1	28
Schritt 6 - Lösen der Kabel 2	28
Schritt 7 - Kabelbündel lösen	29
Schritt 8 - xLCD entfernen	29
Schritt 9 - Y Idler entfernen	30
Schritt 10 - Idler-Riemenscheibe entfernen	30
Schritt 11 - Y Motor entfernen	31
Schritt 12 - Power Panic Cable Removal	31
Schritt 13 - Stromkabel entfernen	32
Schritt 14 - Netzteil entfernen 1	32
Schritt 15 - Netzteil entfernen 2	33
Schritt 16 - Heizbett entfernen	33
Schritt 17 - Y-Achse entfernen	34
Schritt 18 - Y-Achse demontieren	34
Schritt 19 - Lager entfernen	35
Schritt 20 - Expansion Joint entfernen	35
Schritt 21 - Extruderabdeckung entfernen	36
Schritt 22 - Hotendbaugruppe entfernen	36
Schritt 23 - Drucklüfter entfernen	37
Schritt 24 - Kühlkörperlüfter entfernen	37
Schritt 25 - Nextruder entfernen	38
Schritt 26 - LoveBoard entfernen	38
Schritt 27 - Z Motoren entfernen	39

Schritt 28 - Z Motors Removal 2	39
Schritt 29 - Z Motors Removal 3	40
Schritt 30 - Z Stangen entfernen	40
Schritt 31 - Trapezmutter entfernen	41
Schritt 32 - X Motor lösen	41
Schritt 33 - X Riemen lösen	42
Schritt 34 - X Motor entfernen	42
Schritt 35 - X Idler Shaft Removal	43
Schritt 36 - X Idler entfernen	43
Schritt 37 - xBuddy entfernen	44
1D. Komponenten Vorbereitung	45
Schritt 1 - xBuddy Vorbereitung	46
Schritt 2 - xLCD Demontage	46
Schritt 3 - xLCD Demontage 2	47
Schritt 4 - Drucklüfter Vorbereitung	47
Schritt 5 - Y Motor Vorbereitung	48
Schritt 6 - Y Motor Prep 2	48
Schritt 7 - X Motor Vorbereitung	49
Schritt 8 - Z Motor Vorbereitung	49
Schritt 9 - Heizbett Vorbereitung	50
Schritt 10 - Heizbett Vorbereitung 2	50
Schritt 11 - Thermistor Vorbereitung	51
Schritt 12 - Thermistor-Installation	51
Schritt 13 - Thermistor-Installation 2	52
Schritt 14 - Thermistor-Installation 3	52
Schritt 15 - Heizbett Überarbeitung	53
Schritt 16 - Getriebeabdeckung Vorbereitung	53
Schritt 17 - Nextruder Überarbeitung	54
Schritt 18 - Nextruder Überarbeitung 2	54
Schritt 19 - Lager prüfen	55
Schritt 20 - Teile prüfen	55
Schritt 21 - Teile Zusammenfassung 1	56
Schritt 22 - Teile Zusammenfassung 2	56
Schritt 23 - Teile Zusammenfassung 3	57
Schritt 24 - Teile Zusammenfassung 4	57
Schritt 25 - Teile Zusammenfassung 5	58
Schritt 26 - Teile Zusammenfassung 6	58
2. Zusammenbau der Basis	59
Schritt 1 - Tools necessary for this chapter	60
Schritt 2 - Base assembly: parts preparation	60
Schritt 3 - Inserting the zip ties	61
Schritt 4 - Base assembly: parts preparation (part 1)	61
Schritt 5 - Base assembly: parts preparation (part 2)	62
Schritt 6 - Installing the motor mounts	62
Schritt 7 - Installing the rear motor	63
Schritt 8 - Securing the rear motor	63
Schritt 9 - Installing the front motor right	64
Schritt 10 - Installing the front motor left	64
Schritt 11 - Bottom frame: parts preparation	65
Schritt 12 - Assembling the bottom profile: front + left	65
Schritt 13 - Assembling the bottom profile: left + rear	66
Schritt 14 - Assembling the bottom profile: right	66
Schritt 15 - Inserting the spacer pins	67
Schritt 16 - Anti-vibration feet: parts preparation	67

Schritt 17 - Installing the anti-vibration feet	68
Schritt 18 - Installing the bottom frame	69
Schritt 19 - Mounting the bottom frame: right side	69
Schritt 20 - Mounting the bottom frame: rear + left + front	70
Schritt 21 - Haribo Zeit!	70
Schritt 22 - Abgeschlossen	71
3. Rückseite Montage	72
Schritt 1 - Tools necessary for this chapter	73
Schritt 2 - PSU assembly: parts preparation	73
Schritt 3 - Vorbereiten des Netzteils	74
Schritt 4 - Stromkabel Info	75
Schritt 5 - Anschluss des Netzteils	76
Schritt 6 - xBuddy: parts preparation I.	76
Schritt 7 - xBuddy: parts preparation II.	77
Schritt 8 - Applying the thermal pads	77
Schritt 9 - Installieren des xBuddy	78
Schritt 10 - Installing the xBuddy extension	78
Schritt 11 - Installieren der Kabelbinder	79
Schritt 12 - Connecting the xBuddy extension board	79
Schritt 13 - Inserting grommets: xBuddy box	80
Schritt 14 - WiFi: Vorbereitung der Teile	80
Schritt 15 - Zusammenbau des Wi-Fi	81
Schritt 16 - Installing the Wi-Fi assembly	81
Schritt 17 - Back panel: parts preparation	82
Schritt 18 - Installing grommets: back panel top	82
Schritt 19 - Installing grommets: sides + bottom	83
Schritt 20 - Ausrichten des Netzteils	83
Schritt 21 - Montieren des Netzteils	84
Schritt 22 - Aligning the xBuddy box assembly	84
Schritt 23 - Mounting the xBuddy box	85
Schritt 24 - Power cables cover: parts preparation	85
Schritt 25 - Connecting the power cables	86
Schritt 26 - Vorbereiten der PSU-cable-cover	87
Schritt 27 - Covering the PSU cables	87
Schritt 28 - Chamber fans: parts preparation	88
Schritt 29 - Assembling the fan grid	88
Schritt 30 - Anbringen der Lüfter	89
Schritt 31 - Covering the cooling fans	89
Schritt 32 - Rear profiles: parts preparation	90
Schritt 33 - Installing the rear profiles	90
Schritt 34 - Mounting the back panel	91
Schritt 35 - Stepper splitter: parts preparation	91
Schritt 36 - Guiding the Stepper splitter cable	92
Schritt 37 - Connecting the Stepper splitter	92
Schritt 38 - Mounting the Stepper Splitter	93
Schritt 39 - LCD cable: parts preparation	93
Schritt 40 - Guiding the LCD cable	94
Schritt 41 - Main FE cable INFO	94
Schritt 42 - Connecting the FE cable (no 3.)	95
Schritt 43 - Guiding the FE cable (no. 2)	95
Schritt 44 - Guiding the FE cable (no. 1)	96
Schritt 45 - Guiding the FE cable (no. 4 and 5)	96
Schritt 46 - FE cable - xBuddy: parts preparation	97
Schritt 47 - Connecting the FE cable: xBuddy	97

Schritt 48 - Plugging the xLCD cable	98
Schritt 49 - PSU-cover: Vorbereitung der Teile	98
Schritt 50 - Connecting the FE cable: PSU	99
Schritt 51 - Haribo Zeit!	99
Schritt 52 - Abgeschlossen	100
4. Zusammenbau des Heizbetts	101
Schritt 1 - Tools necessary for this chapter	102
Schritt 2 - Heizbett: Teilevorbereitung	103
Schritt 3 - Heatbed cable assembly (part 1)	103
Schritt 4 - Heatbed cable assembly (part 2)	104
Schritt 5 - Bed-cable-cover-bottom: Vorbereitung der Teile	104
Schritt 6 - Attaching the cable cover	105
Schritt 7 - Heatbed carriage: parts preparation	105
Schritt 8 - Installing the expansion joint screws	106
Schritt 9 - Installing the expansion joints	106
Schritt 10 - RGB LED strip: parts preparation	107
Schritt 11 - Installing the LED strip	107
Schritt 12 - Attaching the LED strip diffuser	108
Schritt 13 - Covering the RGB LED strip	108
Schritt 14 - Guiding the RGB LED strip cable	109
Schritt 15 - Bed mounts: parts preparation	109
Schritt 16 - Assembling the bed mounts	110
Schritt 17 - Securing the bed mounts	110
Schritt 18 - Bed mounts: inserting the nuts	111
Schritt 19 - Zusammenbau der CORE-One-bed-spacer-rear	111
Schritt 20 - Installieren des Bed-mount-right	111
Schritt 21 - Installieren des Bed-mount-left	112
Schritt 22 - Mounting the heatbed: parts preparation	112
Schritt 23 - Sichern des Heizbettes	113
Schritt 24 - Expansion-joint-aligner	113
Schritt 25 - Aligning the front side expansion joint	114
Schritt 26 - Aligning the front left expansion joint	114
Schritt 27 - Aligning the left side expansion joint	115
Schritt 28 - Aligning the rear left expansion joint	115
Schritt 29 - Aligning the middle rear expansion joint	116
Schritt 30 - Aligning the rear right expansion joint	116
Schritt 31 - Aligning the right side expansion joint	117
Schritt 32 - Aligning the front right expansion joint	117
Schritt 33 - Befestigen des Heizbetts	118
Schritt 34 - Covering the cables: parts preparation	118
Schritt 35 - Guiding the heatbed cables	119
Schritt 36 - Covering the heatbed cables	119
Schritt 37 - Nozzle wiper assembly: parts preparation	120
Schritt 38 - Assembling the nozzle wiper	120
Schritt 39 - Mounting the nozzle wiper	121
Schritt 40 - Sticking the wiper pad	121
Schritt 41 - Mounting the heatbed: parts preparation	122
Schritt 42 - Attaching the heatbed assembly	122
Schritt 43 - Mounting the heatbed assembly: rear motor	123
Schritt 44 - Mounting the heatbed assembly: front motor left	123
Schritt 45 - Mounting the heatbed assembly: front motor right	124
Schritt 46 - Attaching the heatbed cables I.	124
Schritt 47 - Attaching the heatbed cables II.	125
Schritt 48 - Securing the heatbed cables: parts preparation	125

Schritt 49 - Securing the textile sleeve	126
Schritt 50 - Guiding the heatbed assembly cables	126
Schritt 51 - Connecting the heatbed power cables	127
Schritt 52 - Haribo Zeit!	127
Schritt 53 - Abgeschlossen	128
5. CoreXY Montage	129
Schritt 1 - Tools necessary for this chapter	130
Schritt 2 - Rod holders: parts preparation	130
Schritt 3 - Assembling the rod holders	131
Schritt 4 - Preparing the front rod holders	131
Schritt 5 - Installing the front rod holders	132
Schritt 6 - XY carriage: parts preparation	132
Schritt 7 - Zusammenbau der XY-carriages	133
Schritt 8 - Assembling the linear holder left	133
Schritt 9 - Assembling the linear holder right	134
Schritt 10 - Attaching the linear holder assemblies	134
Schritt 11 - Glatte Stangen INFO	135
Schritt 12 - Mounting the smooth rods	135
Schritt 13 - Securing the rear rod holders	136
Schritt 14 - Securing the front rod holders	136
Schritt 15 - Motor mounts: parts preparation	137
Schritt 16 - Motor mounts: part preparation	137
Schritt 17 - Assembling the XY-motor-mount-right I.	138
Schritt 18 - Assembling the XY-motor-mount-right II.	138
Schritt 19 - Assembling the XY-motor-mount-left I.	139
Schritt 20 - Assembling the XY-motor-mount-left II.	139
Schritt 21 - Belt tensioners: parts preparation I.	140
Schritt 22 - Belt tensioners: parts preparation II.	140
Schritt 23 - Preparing the tensioner pulleys	141
Schritt 24 - Assembling the belt tensioner left I.	141
Schritt 25 - Assembling the belt tensioner left II.	142
Schritt 26 - Assembling the belt tensioner right	142
Schritt 27 - Installing the belt tensioners: parts preparation	143
Schritt 28 - Installing the motor mount left	143
Schritt 29 - Installing the motor mount right	144
Schritt 30 - Installieren des Belt-tensioner-left	144
Schritt 31 - Installieren des Belt-tensioner-right	145
Schritt 32 - Linear rail: parts preparation	145
Schritt 33 - Attaching the linear rail	146
Schritt 34 - Securing the linear rail	146
Schritt 35 - Installing the linear rail: parts preparation	147
Schritt 36 - Installing the linear rail assembly	147
Schritt 37 - Linear rail: removing the safety pins	148
Schritt 38 - Bed-stop: Vorbereitung der Teile	148
Schritt 39 - Zusammenbau des Bed-stop	148
Schritt 40 - Anbringen des Bed-stop	149
Schritt 41 - X&Y motors: parts preparation	149
Schritt 42 - Installing the X-axis pulley	150
Schritt 43 - Installing the Y-axis pulley	151
Schritt 44 - XY belts: parts preparation	152
Schritt 45 - XY Riemen INFO	152
Schritt 46 - Y belt guiding: Y motor pulley	153
Schritt 47 - Securing the Y-axis motor	153
Schritt 48 - Y belt guiding: Y motor mount	154

Schritt 49 - Y belt guiding: belt tensioner	154
Schritt 50 - Y belt guiding: X motor mount	155
Schritt 51 - Y belt guiding: securing the belt	155
Schritt 52 - X belt guiding: X motor pulley	156
Schritt 53 - Securing the X-axis motor	156
Schritt 54 - Y belt guiding: X motor mount	157
Schritt 55 - X belt guiding: belt tensioner	157
Schritt 56 - X belt guiding: Y motor mount	158
Schritt 57 - X belt guiding: securing the belt	158
Schritt 58 - Checking the belt guidance	159
Schritt 59 - Bowden guide: parts preparation	159
Schritt 60 - Securing the Nextruder holder	160
Schritt 61 - Securing the Y motor cable	160
Schritt 62 - Securing the X motor cable	161
Schritt 63 - Installing the bowden guide	161
Schritt 64 - White LED strip: parts preparation	162
Schritt 65 - Sticking the White LED strip	162
Schritt 66 - Installing the white LED assembly	163
Schritt 67 - Door sensor & White LED strip: parts preparation	163
Schritt 68 - Inserting the zip ties	164
Schritt 69 - Installing the door sensor	164
Schritt 70 - Securing the door sensor cable	165
Schritt 71 - Guiding the cables: LED and door sensor	165
Schritt 72 - Buddy3D Kamera Hinweis	166
Schritt 73 - Smooth rods: parts preparation	166
Schritt 74 - Installing the CoreXY assembly	167
Schritt 75 - Securing the smooth rods	167
Schritt 76 - Aligning the linear rail	168
Schritt 77 - Guiding the corexy cables	168
Schritt 78 - Guiding the cooling fan cables	169
Schritt 79 - Befestigen des Bed-stop	169
Schritt 80 - Connecting the cooling fans cables	170
Schritt 81 - Connecting the corexy cables	170
Schritt 82 - Haribo Zeit!	171
Schritt 83 - Abgeschlossen	171
6. Zusammenbau des Nextruders	172
Schritt 1 - Tool necessary for this chapter	173
Schritt 2 - Nextruder idler assembly: parts preparation	174
Schritt 3 - Assembling the extruder idler	175
Schritt 4 - Assembling the extruder: parts preparation I.	175
Schritt 5 - Assembling the extruder: parts preparation II.	176
Schritt 6 - Zusammenbau des Extruders	176
Schritt 7 - Zusammenbau des Getriebes	177
Schritt 8 - Zusammenbau des PG-Rings	177
Schritt 9 - Zusammenbau der PG-Baugruppe	178
Schritt 10 - Prüfen der PG-Baugruppe	178
Schritt 11 - Assembling the Nextruder idler	179
Schritt 12 - Gear lubrication: parts preparation	179
Schritt 13 - Schmieren des Getriebes	180
Schritt 14 - Covering the planetary gear	180
Schritt 15 - Assembling the Idler-swivel: parts preparation	181
Schritt 16 - Montieren des Idler-swivels	181
Schritt 17 - Montieren der Idler-Mutter	182
Schritt 18 - Mounting the Idler-swivel assembly	182

Schritt 19 - NTC thermistor: parts preparation	183
Schritt 20 - Assembling the NTC thermistor	183
Schritt 21 - Mounting the Nextruder: parts preparation	184
Schritt 22 - Schutz des Heizbettes	184
Schritt 23 - Befestigen des Nextruders	185
Schritt 24 - Hotend fan: parts preparation	185
Schritt 25 - Installing the Hotend fan	186
Schritt 26 - Guiding the Hotend fan cables	186
Schritt 27 - LoveBoard: parts preparation I.	187
Schritt 28 - LoveBoard: parts preparation II.	187
Schritt 29 - Montage des Loveboard-Mounts	188
Schritt 30 - Zusammenbau der Druckkopfabdeckung	188
Schritt 31 - Montieren des LoveBoards	189
Schritt 32 - Guiding the main cable	189
Schritt 33 - Abdecken des LoveBoards	190
Schritt 34 - Swingarm: parts preparation I.	190
Schritt 35 - Swingarm: parts preparation II.	191
Schritt 36 - Guiding the main cable	191
Schritt 37 - Mounting the main cable	192
Schritt 38 - Attaching the LoveBoard assembly	192
Schritt 39 - Befestigung des Schwenkarms	193
Schritt 40 - Attaching the main cable	193
Schritt 41 - Inserting the PTFE tube	194
Schritt 42 - Securing the PTFE tube	194
Schritt 43 - Überprüfung der Bewegung	195
Schritt 44 - Print fan: parts preparation	195
Schritt 45 - Lüfterhaube montieren	196
Schritt 46 - Installing the print fan assembly	196
Schritt 47 - Hotend: Vorbereitung der Teile	197
Schritt 48 - Einsetzen des Hotends	197
Schritt 49 - Connecting the heatsink cables	198
Schritt 50 - Connecting the hotend cables	198
Schritt 51 - Connecting the print fan cable	198
Schritt 52 - E-Motor-Kabel anschließen	199
Schritt 53 - LoveBoard covers: parts preparation	199
Schritt 54 - LoveBoard: Verdrahtung prüfen	200
Schritt 55 - Abdecken des LoveBoards	200
Schritt 56 - Connecting the main cable	201
Schritt 57 - Haribo Zeit!	201
Schritt 58 - Abgeschlossen	202
7. Bodywork & Electronics	203
Schritt 1 - Tools necessary for this chapter	204
Schritt 2 - Front profiles: parts preparation	204
Schritt 3 - Installing the front right profile	205
Schritt 4 - Installing the front left profile	205
Schritt 5 - Top profiles: parts preparation	206
Schritt 6 - Assembling the top profiles I.	207
Schritt 7 - Assembling the top profiles II.	208
Schritt 8 - Aligning the top profiles	208
Schritt 9 - Installing the top profiles	209
Schritt 10 - CoreXY fixing screws: parts preparation	209
Schritt 11 - Fixing the CoreXY assembly	210
Schritt 12 - Side sensor base: parts preparation	210
Schritt 13 - Assembling the side sensor base	211

Schritt 14 - Testen des Hebels	211
Schritt 15 - Zusammenbauen des Schalters	212
Schritt 16 - IR Sensor: parts preparation	212
Schritt 17 - Connecting the IR sensor	213
Schritt 18 - Installing the IR sensor	213
Schritt 19 - Installing the side sensor cover	214
Schritt 20 - Side filament sensor: parts preparation	214
Schritt 21 - Installing the side filament sensor	215
Schritt 22 - Guide the filament sensor cable	215
Schritt 23 - Connecting the side filament sensor	216
Schritt 24 - NFC Antenna: parts preparation	216
Schritt 25 - Applying the adhesive film	217
Schritt 26 - Installing the NFC Coil	217
Schritt 27 - Connecting the NFC Coil	218
Schritt 28 - Verdrahtung prüfen	218
Schritt 29 - Preparing the electronics cover	219
Schritt 30 - Installing the electronics cover	219
Schritt 31 - Buddy3D Kamera Hinweis	220
Schritt 32 - xBuddy cover: parts preparation	220
Schritt 33 - Installing the xBuddy cover	221
Schritt 34 - Installing the rear cover	221
Schritt 35 - Right side: parts preparation	222
Schritt 36 - Installieren des Puck-universal	222
Schritt 37 - Right handle: parts preparation	223
Schritt 38 - Einbau der Spannzange	223
Schritt 39 - Montieren des Griiffs	224
Schritt 40 - Fixing the right side	224
Schritt 41 - Left side: parts preparation	225
Schritt 42 - Installing the left side	225
Schritt 43 - Haribo Zeit!	226
Schritt 44 - Abgeschlossen	226
8. Trim, Door & xLCD	227
Schritt 1 - Tools necessary for this chapter	228
Schritt 2 - Top cover: parts preparation I.	228
Schritt 3 - Top cover: parts preparation II.	229
Schritt 4 - Entfernen der Folie	229
Schritt 5 - Test-fitting the top cover	230
Schritt 6 - Assembling the top cover I.	230
Schritt 7 - Assembling the top cover II.	231
Schritt 8 - Montage der oberen Abdeckung III.	232
Schritt 9 - Installing the top cover	233
Schritt 10 - Side covers: parts preparation	233
Schritt 11 - Entfernen der Folie	234
Schritt 12 - Covering the left side	234
Schritt 13 - Covering the right side	235
Schritt 14 - xLCD: Teile Vorbereitung	235
Schritt 15 - Assembling the xLCD I.	235
Schritt 16 - Assembling the xLCD II.	236
Schritt 17 - Installing the FE Faston connector	236
Schritt 18 - Installing the LCD knob	237
Schritt 19 - xLCD bezel: parts preparation	237
Schritt 20 - Mounting the xLCD I.	238
Schritt 21 - Mounting the xLCD II.	238
Schritt 22 - Installing the xLCD assembly	239

Schritt 23 - Securing the xLCD assembly	239
Schritt 24 - Door seal: parts preparation	240
Schritt 25 - Attaching the top seal	240
Schritt 26 - Attaching the side seals	241
Schritt 27 - Magnet holders: parts preparation	241
Schritt 28 - Assembling the magnet holders	242
Schritt 29 - Installing the magnet holders	242
Schritt 30 - Scharniere: Vorbereitung der Teile	243
Schritt 31 - Installing the door-hinge-in parts	243
Schritt 32 - Installing the door-hinge-out I.	244
Schritt 33 - Installing the door-hinge-out II.	244
Schritt 34 - Door panel: parts preparation	245
Schritt 35 - Installing the door handle	245
Schritt 36 - Befestigen des Griffs	246
Schritt 37 - Installing the door panel	246
Schritt 38 - Attaching the sticker: Parts preparation	247
Schritt 39 - Anbringen des Aufklebers	247
Schritt 40 - Haribo Zeit!	248
Schritt 41 - Abgeschlossen	248
9. Calibration & First run	249
Schritt 1 - Riemen Spannen	250
Schritt 2 - Installing the spoolholder: Parts preparation	250
Schritt 3 - Attaching the print sheet and spoolholder	251
Schritt 4 - Firmware Update	251
Schritt 5 - Turning on the printer	252
Schritt 6 - Setting up the printer: Intro	252
Schritt 7 - Setting up the printer: Network setup	253
Schritt 8 - Assistent: Intro	253
Schritt 9 - Wizard: Door Sensor Calibration	254
Schritt 10 - Assistent: Wägezellentest	254
Schritt 11 - Assistent: Getriebeausrichtung	255
Schritt 12 - Wizard: Filament Sensor Calibration	255
Schritt 13 - Assistent abgeschlossen	256
Schritt 14 - Haribo Zeit!	256
Schritt 15 - Handbuch	257
Schritt 16 - Geben Sie uns Feedback	257
Schritt 17 - Prusa-Wissensbasis	258
Schritt 18 - Kommen Sie zu Printables!	258
Änderungsprotokoll der Anleitung	259
Schritt 1 - Versionsgeschichte	260

1A. Einleitung




SCHRITT 1 Anleitung Infos



- Willkommen bei der Original **Prusa MK4S zu CORE One+ (Gen 2) Umrüstung** Anleitung.
- Please prepare the upgrade kit received from Prusa Research.
- Im ersten Teil der Anleitung werden wir die wichtigsten Komponenten Ihres MK4S Druckers überprüfen, gefolgt von der Demontage des Druckers.


Danach werden wir ein paar Teile überarbeiten, und schließlich kann der CORE One+ (Gen 2) Bauprozess beginnen.

SCHRITT 2 How to navigate through the manual

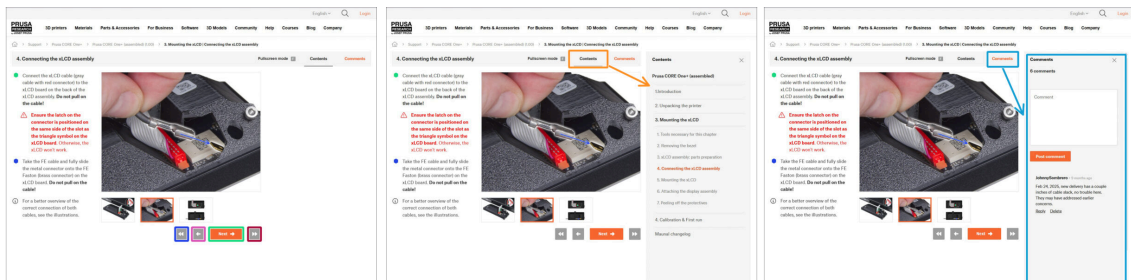

- Use the graphical navigation buttons in the bottom right corner or the arrow keys on your keyboard:
- Next button / Right arrow key** - Moves to the next image, or to the next step if it's the last image in the step.
- Left arrow button / Left arrow key** - Moves to the previous image, or to the previous step if it's the first image in the step.
- Play backward button / Up arrow key** - Moves to the previous step.
- Play forward (Next) button / Down arrow key** - Moves to the next step.
- Click on **Contents** to expand the full list of steps in this guide. This allows you to jump to any step regardless of the sequence.
- Click on **Comments** to open the discussion for a specific step and leave your feedback.

SCHRITT 3 View high resolution images

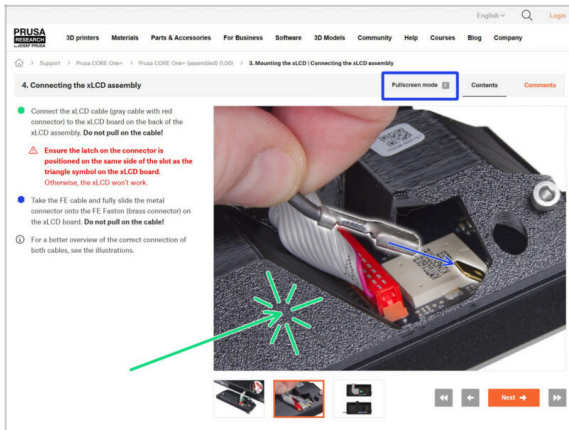

- When you browse the guide on help.prusa3d.com, you can view the original images in high resolution for clarity.
- Just click on the image to open it in high resolution for a detailed view.
- Click on **Fullscreen mode** or press the F key to maximize your screen space and focus entirely on the instructions.

SCHRITT 4 Kompatibilität



- ⚠ Die einzige Möglichkeit der Konvertierung zum CORE One+ (Gen 2) ist die vom **MK4S**.

Wenn Sie ein älteres Druckermodell haben, müssen Sie es zunächst auf MK4S aktualisieren und dann mit der Konvertierung zu CORE One+ (Gen 2) fortfahren.


- i There are two versions of the conversion package, depending on the xLCD version in your MK4S printer.

- ⚠ The silver PSU is not compatible with the conversion kit.

If you have this PSU version, you will need to purchase a compatible one.

- Weitere Informationen finden Sie in den Kompatibilitätshinweisen auf der E-Shop-Seite zum CORE One+ Umrüstsatz (Gen 2).

SCHRITT 5 Wichtig: Schutz der Elektronik

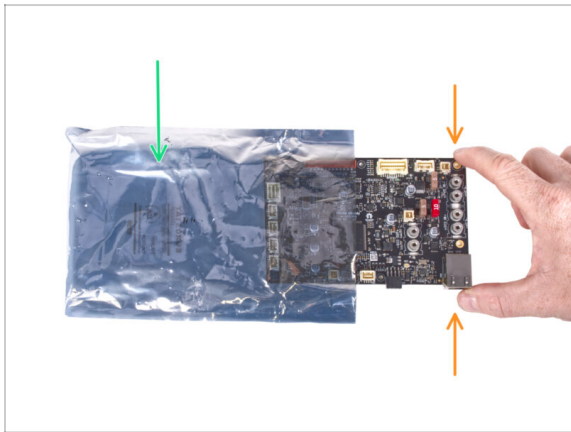


⚠ WARNING: Make sure to **protect the electronics against electrostatic discharge (ESD)**. When possible, always unpack the electronics right before you need them.

Here are some tips to prevent damage to the electronics:

- **Keep the electronics inside an ESD-safe bag** right until you are asked to install them.
- **Always touch the sides of the board only** while handling it. Avoid touching the components on the surface.
- **Before you touch the electronics** use any grounded conductive (metal) structure nearby to neutralize the possible static charge from your hands.
- Be extra cautious **in rooms with carpets**, which are often a source of electrostatic energy.
- Clothes made of wool or certain synthetic fabrics can easily gather static electricity too. It is safer to wear cotton clothing for the assembly.

SCHRITT 6 Abbildungen der Bauteile

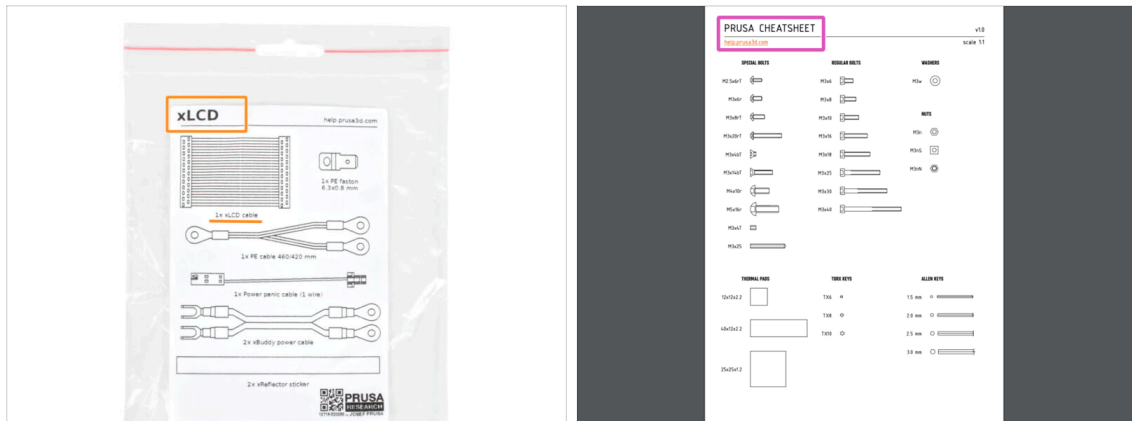

- All the boxes and bags including parts for the build are labeled.
- The labels include the list of contents and part count.
- You can download a **Cheatsheet** with 1:1 fastener drawings from our site prusa.io/cheatsheet-mk4. Print it at 100 %, don't rescale it, otherwise, it won't work.
- ❗ For PRUSA veterans: Fasteners are divided into individual bags according to its type. Not into packages for individual chapters, as it was with previous printers.

SCHRITT 7 Ersatzteilbeutel



- There is a bag with spare parts like thermal pads, springs, etc.
- Spare fasteners are included in each bag of fasteners. The numbers in parentheses below the fastener picture indicate the number of extra pieces added to the SPARE package.

SCHRITT 8 We are here for you!

The screenshot shows the Prusa 3MF viewer interface for step 4: Connecting the xLCD assembly. The main area displays a video player and a list of steps. The right sidebar shows a comments section with a 'SUBMIT' button. A pink arrow points from the 'Chat now' button in the bottom right corner to the 'SUBMIT' button in the comments section.

- Lost in the instructions, missing screw or cracked printed part? **Let us know!**
- You can contact us using the following channels:
 - Using comments under each step.
 - Using our 24/7 live chat here at help.prusa3d.com
 - Writing an email to info@prusa3d.com

SCHRITT 9 Pro tip: inserting the nuts



- 3D printed parts are very precise, however, there still might be a tolerance in the printed part and the same goes for the size of the nut.
- Therefore it might happen, that the nut won't fit easily in or might be falling out. Let's see, how to fix it:
 - **Nut won't fit in:** use a screw with a thread along its entire length (typically: M3x10, M3x18) and screw it from the opposite side of the opening. While tightening the screw, the nut will be pulled in. Remove the screw afterwards.
 - **Nut keeps falling out:** Use a piece of tape to fix the nut temporarily in place, as soon as you insert the screw in, you can remove the tape. *Using glue isn't recommended as it can partly reach into the thread and you won't be able to tighten the screw properly.*
- Every time we recommend using the "screw pulling technique", you will be reminded with Joe's avatar ;)
- ⓘ Parts in the pictures are used as an example.

SCHRITT 10 Lagerschmierung Applikator



- We will reuse two LM8UU bearings from your MK4S. It is a good practice to re-lubricate them before re-using.
- For this purpose, we suggest printing the Bearing Lubrication Pacifier from Printables, Before disassembling the printer
- ① It is a quick print, just under 20 minutes.
- The lube tube is included in the package.

SCHRITT 11 Bereiten Sie Ihren Arbeitsplatz vor



- Tidy up your desk! Tidying up decreases the probability of losing small parts.
- **Clear your workspace.** Make sure you have enough room. A nice clear flat workbench will get you the results you are aiming for.
- **Let there be light!** Make sure you are in a well-lit environment. Another lamp or even an extra flashlight will probably come in handy.
- Prepare something to contain the plastic bags and the removed packing materials so you can recycle them afterwards. Make sure there are no important parts being discarded.
- ⚠ **It's highly recommended to place a soft pad on your workbench. Some sheet metal parts have sharp edges that could scratch the surface.**
- OK, we are ready. Let's start! Go to the next chapter.

1B. MK4S Inspektion



SCHRITT 1 Einleitung



- Some parts of your printer can be reused for upgrading, so it's essential to check their condition before starting.


This chapter will guide you through a visual inspection of these parts. If you find any in poor condition, you'll have enough time to order replacements while still using the printer.

 **Do not disassemble or disconnect anything until prompted.**

- Any parts that are found to be in poor condition during the inspection can be replaced with new parts. Everything is available in our eshop.

 Please note that you have to be logged in to access all parts.

SCHRITT 2 Firmware Update

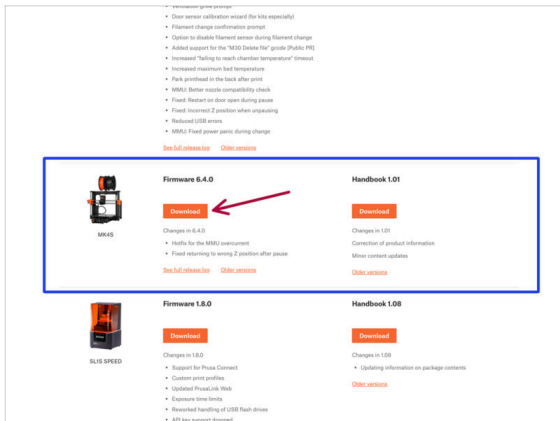

- 🟡 Rufen Sie auf dem Drucker das Menü **Info > Versionsinfo** auf, um die Firmware-Version zu überprüfen.

⚠️ **Vergewissern Sie sich, dass Ihr MK4S-Drucker über **Firmware 6.4.0 oder neuer** verfügt, bevor Sie fortfahren. Andernfalls wird Ihr neu konvertierter CORE One nicht funktionieren und sich der Aktualisierung widersetzen.**



- 🟡 The latest firmware can be downloaded at: [Help.Prusa3D.com/Downloads](https://help.prusa3d.com/downloads)
- ⬛ For more info, visit the [Firmware Update Article](#).

SCHRITT 3 Drucker Vorbereitung 2



- ⬛ **Before you start, do the following:**
- 🔴 Move the X-axis assembly approximately to the 2/3 height, so that:
 - 📄 Pro Tip: Long press the knob and use the "Z Axis Move" option.
 - 🟡 The rear of the extruder is accessible.
 - 🟡 The PSU screws are accessible.
 - 🟡 All the screws on the electronics box are accessible.

SCHRITT 4 Drucker Vorbereitung 2

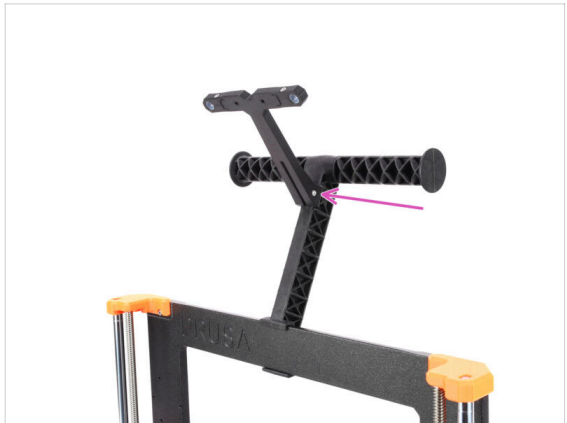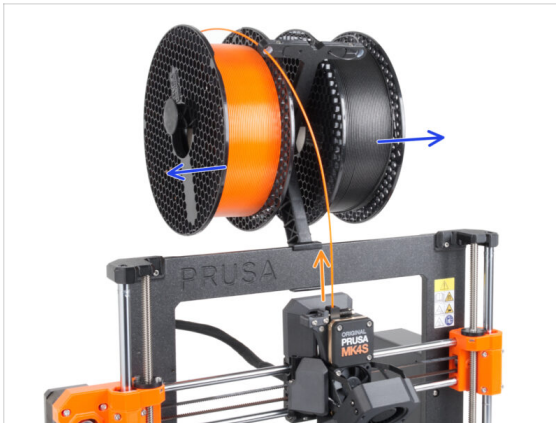

- 🟠 Unload a filament, if it is loaded.
- 📄 **i** Menu Filament > Unload filament
- 🔵 Remove the filament spools.
- 🟡 Remove the spool holder.

SCHRITT 5 Drucker Vorbereitung 3




- 🟢 Turn off your printer and disconnect it from the power.
- 🔵 Remove the print sheet and save it for later use.

SCHRITT 6 Heizbett Inspektion



- Carefully inspect the surface of the heated bed. If you find any major scratches (up to the copper layer) consider replacing it with a new piece.

SCHRITT 7 Y-Stangen Inspektion

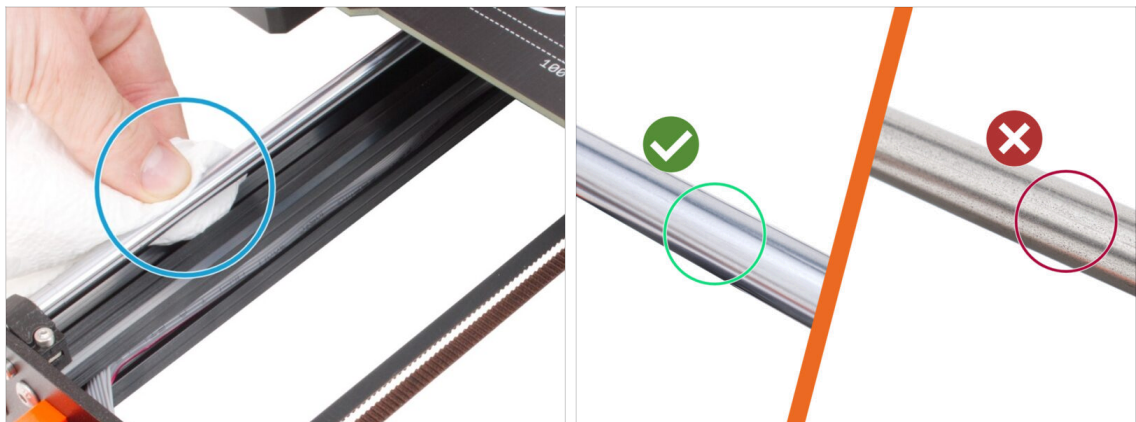

- Wipe the entire length of the Y-axis smooth rods with a paper towel to remove any dirt.
- ⓘ **Carefully inspect the surface of the smooth rods up close, as we are going to reuse them.**
 - The surface must be clean and smooth.
 - If you find very deep scratches, corrosion, or a rough surface, it is highly recommended to replace the rods.

You can purchase a new Smooth Rod Y-axis (8×330 mm) in our eshop

- Similarly, if the smooth rods are scratched or the bearings do not move smoothly (stuttering occurs), we recommend ordering new LM8UU bearings as well.

You can purchase new LM8UU bearings in our eshop.

SCHRITT 8 Haribo Zeit!



Keep the Haribo bag closed for now!



This dose of energy is primarily for the printer assembly. **Wait until you are prompted to open it.**


SCHRITT 9 Los geht's




Got everything checked? Great! Let's begin disassembling the printer.

Proceed to the next chapter.

1c. Demontage des Druckers

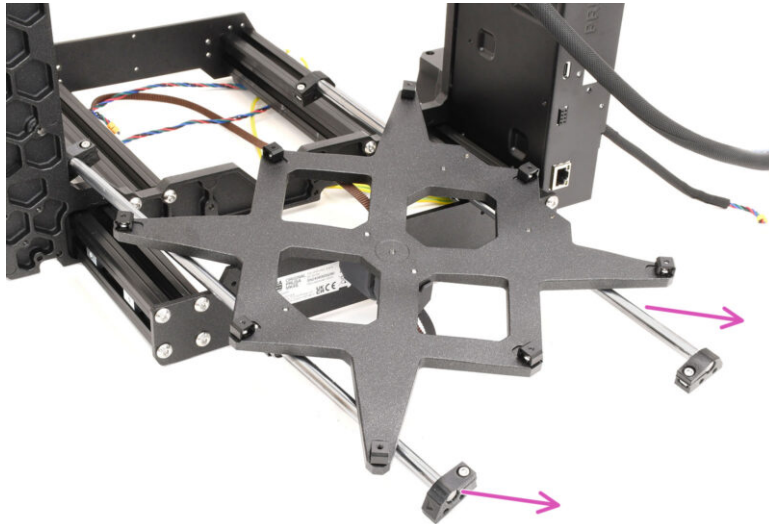


SCHRITT 1 Erforderliche Werkzeuge

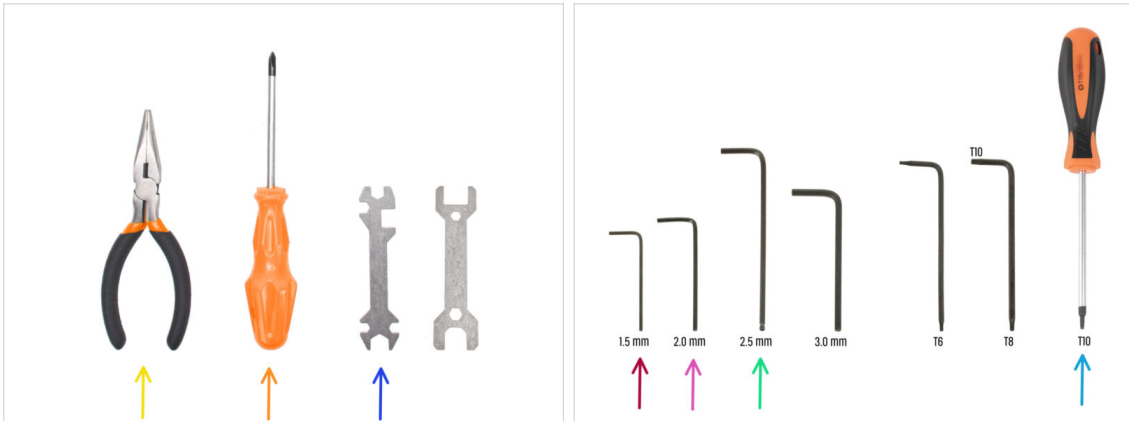

● For this chapter, please prepare:

- Spitzzange
- Phillips Schraubendreher
- Universal-Schlüssel
- 1,5mm Innensechskantschlüssel
- 2mm Innensechskant-Schlüssel
- 2,5mm Innensechskantschlüssel
- T10 Schraubendreher


SCHRITT 2 Elektronik Demontage

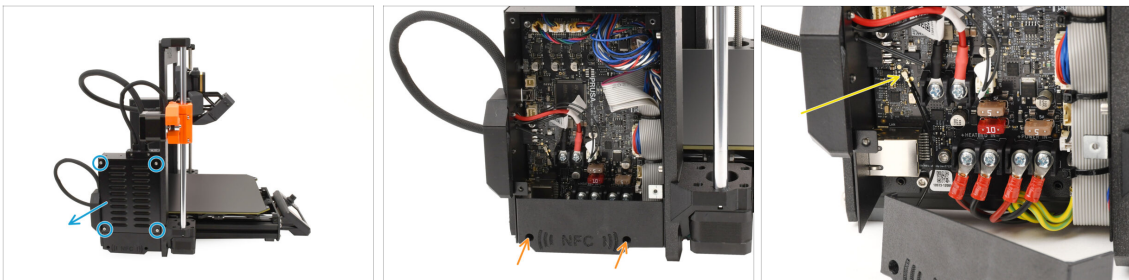

- Let's move onto the **left** side of the printer.
- Remove the four screws holding the xBuddy box cover and remove the cover.
- Using the 2.5mm Allen key, remove the two screws holding the NFC cover.
- Disconnect the NFC antenna from the xBuddy board by gently lifting the tiny connector.


Then, remove the antenna along with the cover.

SCHRITT 3 Wi-Fi Demontage

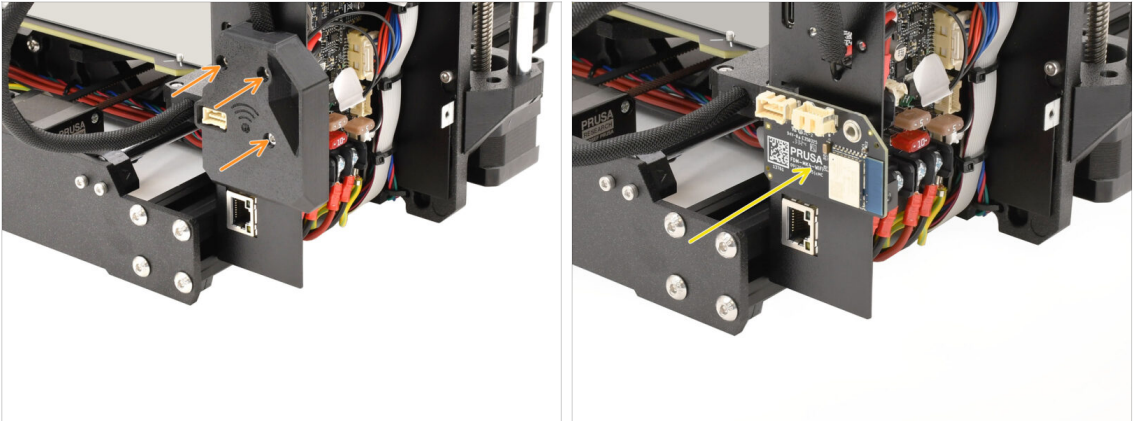


- 🟠 On the back of the electronics box, remove the three screws holding the Wi-Fi cover and remove the cover.
- 🟡 Remove the Wi-Fi module and **save it for later use**.
 - ⚠️ Ensure you store the module and all electronic components in an ESD-safe environment to prevent damage!

SCHRITT 4 Kabelbündel Demontage

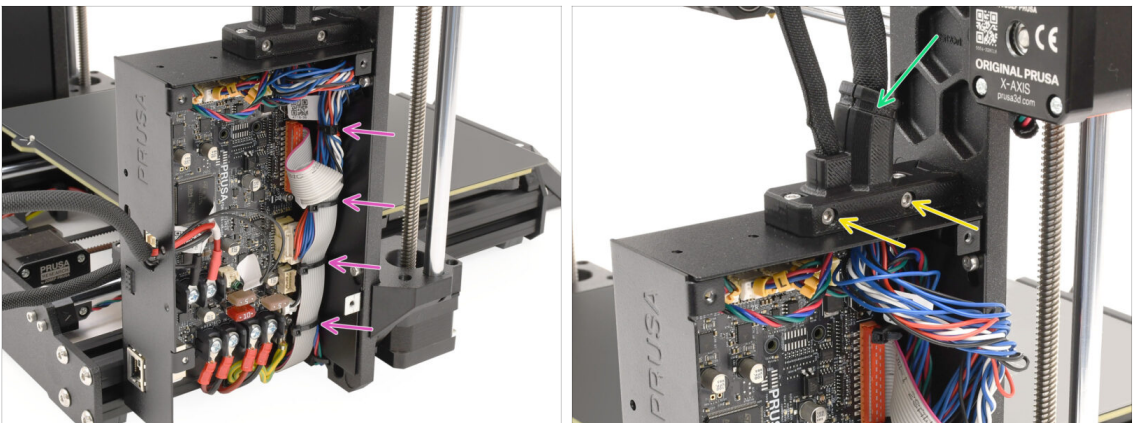


- 🟣 Remove all the zip-ties securing the cable bundle inside the xBuddy box.
 - ⚠️ When cutting the zip-ties, proceed carefully to prevent any damage to the cables or the electronics!
- 🟡 Remove the two screws on the main cable holder.
- 🟢 Cut the zip-tie holding the cover together, then remove the outer part of the holder.

SCHRITT 5 Lösen der Kabel 1

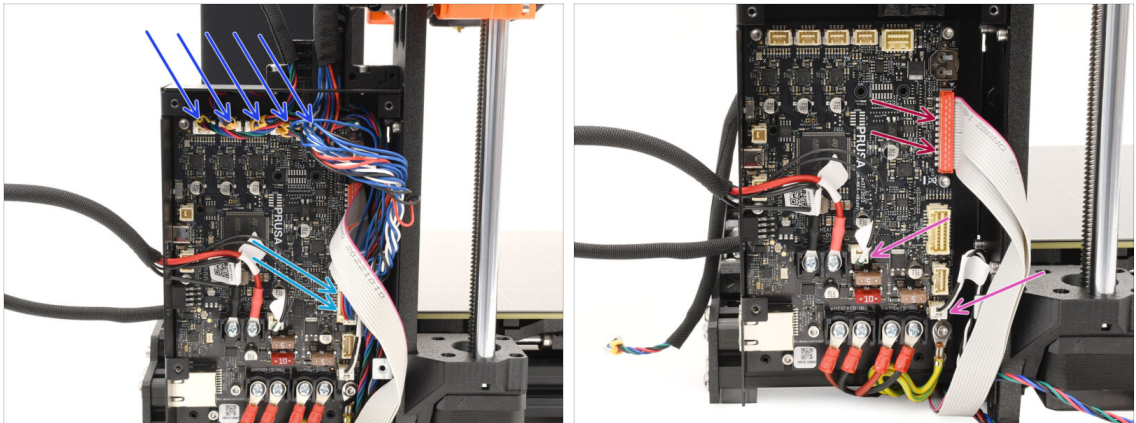


- ◆ Disconnect all the connectors on the top of the xBuddy board.
 - ⚠ There is a safety latch on each of these connectors, which must be pressed in order to disconnect it.
- ◆ Disconnect the extruder main cable connector.
- ◆ Disconnect the heatbed thermistor and power panic cables.
- ◆ Disconnect the xLCD connector by lifting it carefully up.

SCHRITT 6 Lösen der Kabel 2

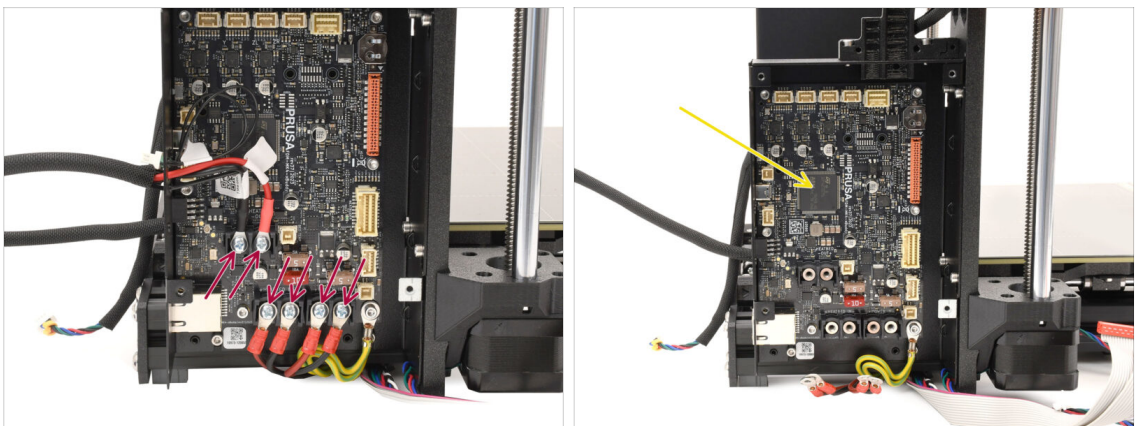


- ◆ Using the Phillips screwdriver, remove all the terminal screws holding the heatbed and power cable connectors.
- ◆ Leave the xBuddy board in the electronics box for now, as this way, it is well protected from damage.

SCHRITT 7 Kabelbündel lösen

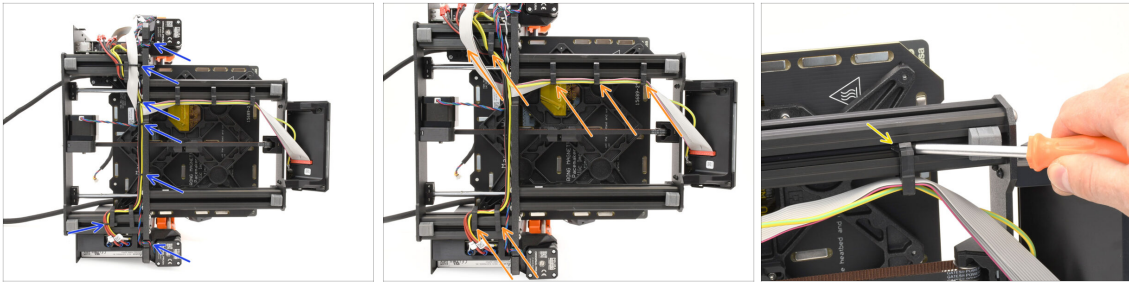


- Lay the printer onto the PSU side to access the bottom part.
- Carefully remove all the zip-ties holding the cable bundle
- Remove all the cable holders from the frame and detach them from the cables.
 - Pro tip: You can pry them off the metal profiles using the screwdriver.

SCHRITT 8 xLCD entfernen

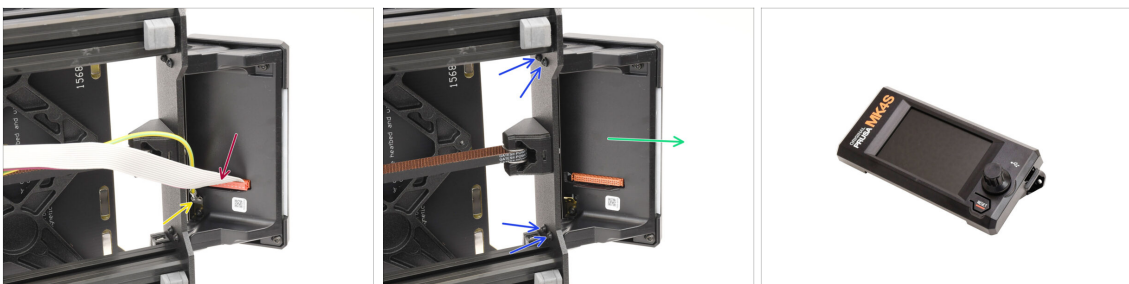


- Disconnect the main cable from the xLCD by gently lifting the connector up.
- Disconnect the grounding cable.
- Using the T10 screwdriver, remove the four screws holding the xLCD assembly.
- Remove the xLCD assembly and **save it for later use!**

SCHRITT 9 Y Idler entfernen

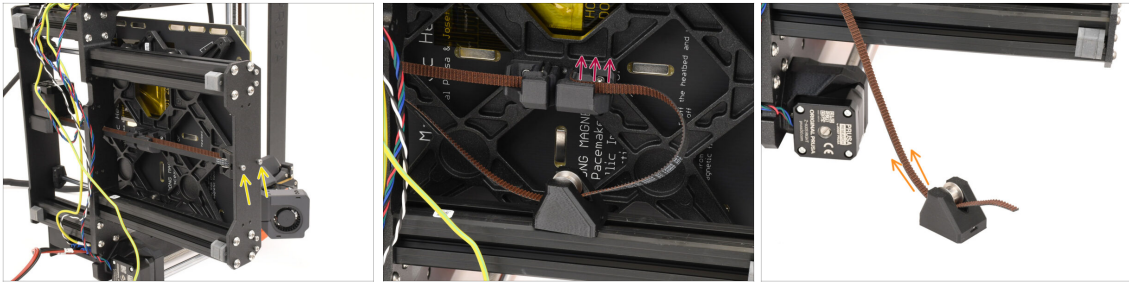


- ✦ Using the 2.5mm Allen key, remove the two screws holding the Y-Axis Idler on the front plate.
- ✦ Pull the end of the Y-axis belt out of the holder at the bottom of the heatbed to disengage it.
- ✦ Remove the belt from the idler by pulling it out.

SCHRITT 10 Idler-Riemenscheibe entfernen

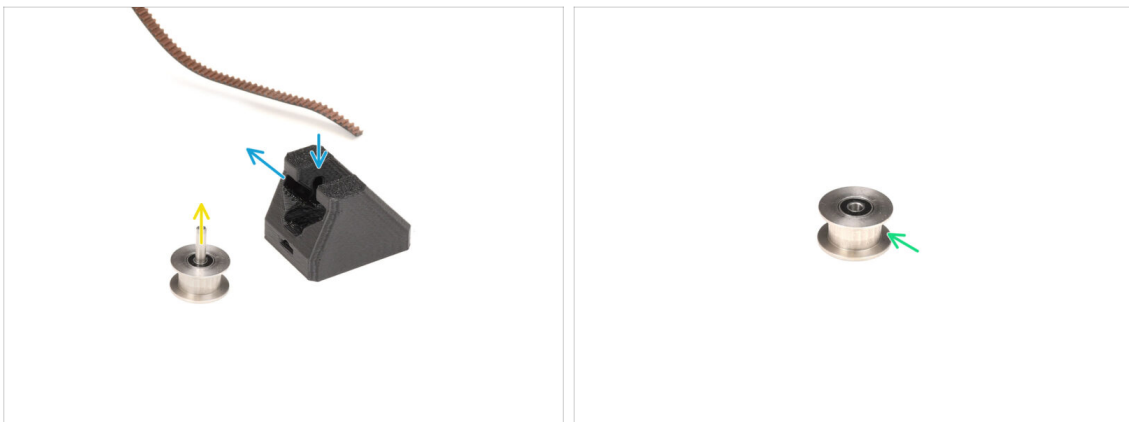


- ✦ Orient the Y-Idler as shown in the picture.
Remove the pulley by first moving it inward, then pulling it out to the side.
Refer to the groove pattern in the picture for the correct trajectory.
- ✦ Remove the center shaft from the pulley.
- ✦ **Save the pulley for later use.**

SCHRITT 11 Y Motor entfernen

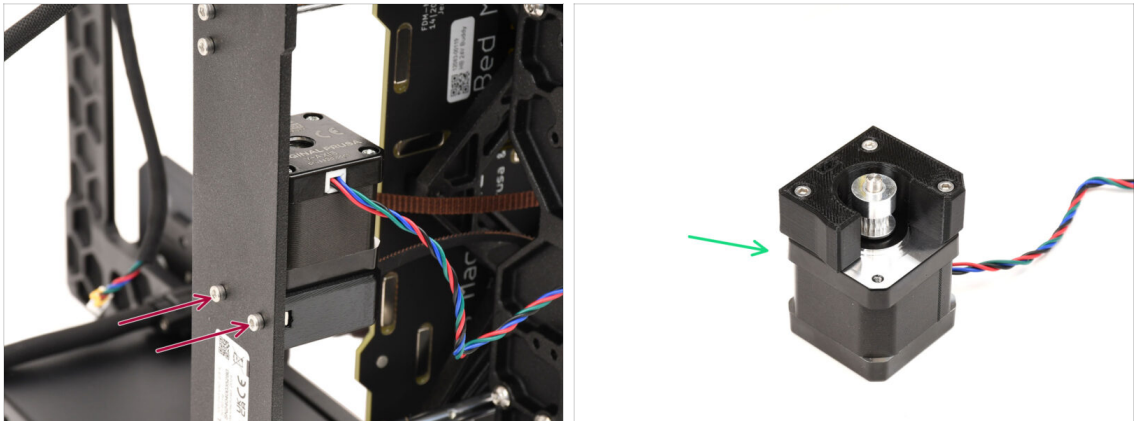


- Remove the two screws on the back of the printer, holding the Y-axis motor in place.
- Remove the Y-axis motor assembly and **save it for later use**.

SCHRITT 12 Power Panic Cable Removal

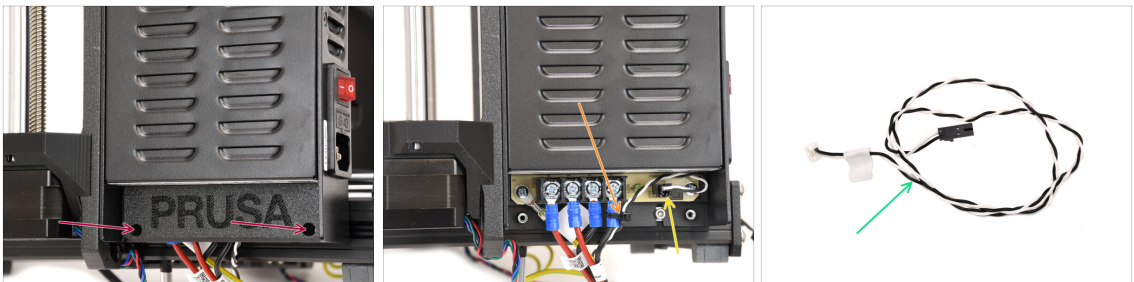


- Let's move onto the right side of the printer carcass, where the PSU lives.
- Remove the two screws securing the cover, then take off the cover.
- Carefully cut off the zip-tie holding the power panic cable.
- Save the power panic cable for later use.**
- i** The power panic cable may look different, depending on your xBuddy board version.

SCHRITT 13 Stromkabel entfernen

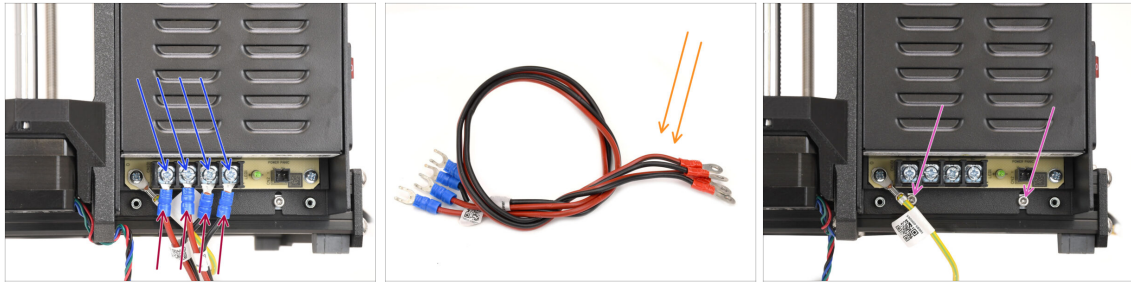

- Using the Phillips screwdriver, loosen the four power terminal screws. Do not remove them entirely.
- Remove the four power cable connectors by pulling them downward.
- Remove the power cables and **save them for later use**.
- Using the 2.5mm Allen key, remove the two screws holding the PSU to the printer's frame.

SCHRITT 14 Netzteil entfernen 1

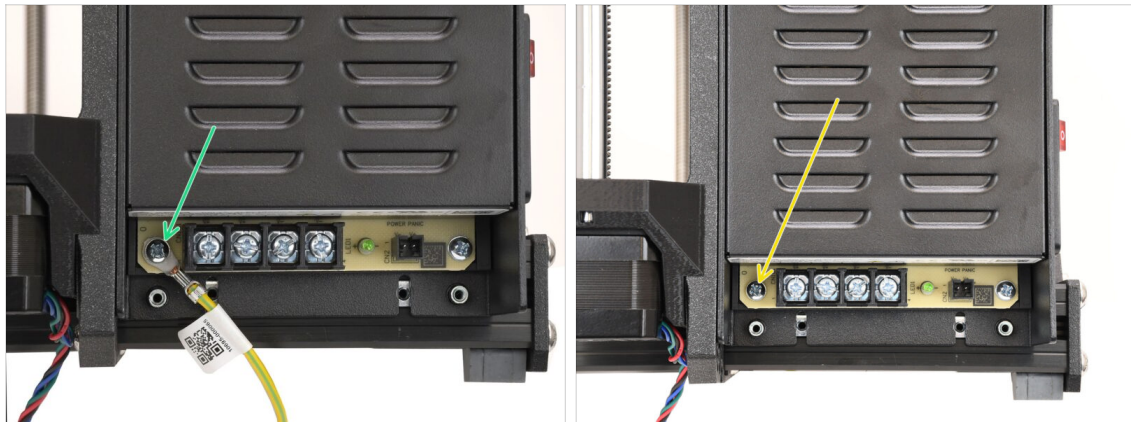

- Remove the screw holding the grounding cable to the PSU.
- Disconnect the grounding cable—it will no longer be needed.
- Re-install the screw you previously removed.

SCHRITT 15 Netzteil entfernen 2




- On the front of the frame, remove the two screws holding the PSU.

⚠ The PSU might fall off to the side!

- Remove the PSU and **save it for later use**.

SCHRITT 16 Heizbett entfernen

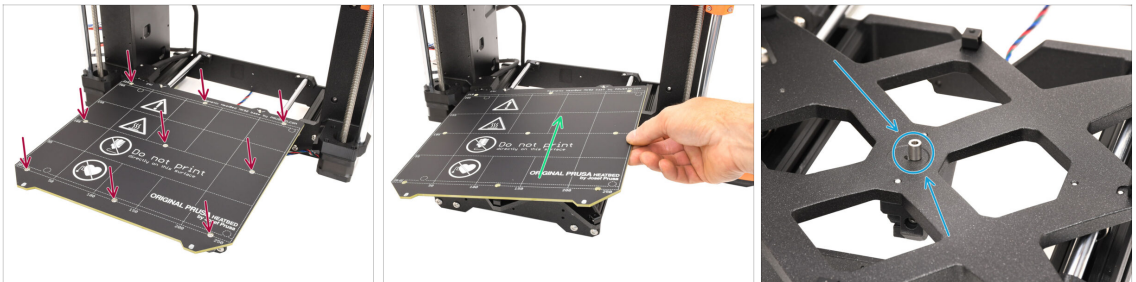

- Let's move onto the heatbed.

- Using the T10 Torx screwdriver, remove all 9 screws holding the heatbed.

- Remove the heatbed by lifting it up. **Save it for later use**.

- In der Mitte des Heizbetts befindet sich ein Abstandshalter.**

📌 Be careful and store the heatbed on a soft surface to prevent scratching it.

SCHRITT 17 Y-Achse entfernen




- Using the 2.5mm Allen key, remove the four screws holding the Y-axis rods to the front of the frame.
- Remove the four screws holding the Y-axis rods to the back of the frame.
- Remove the whole Y-axis assembly from the printer's frame.

SCHRITT 18 Y-Achse demontieren



- Remove the four screws fixing the rods to the Y-rod holders. Then, remove the plastic rod holders.
- Turn the assembly around.
- Pull out both the Y-axis rods. Clean them up and **save them for later use**.
- Remove all the screws holding the bearings to the carriage.

SCHRITT 19 Lager entfernen

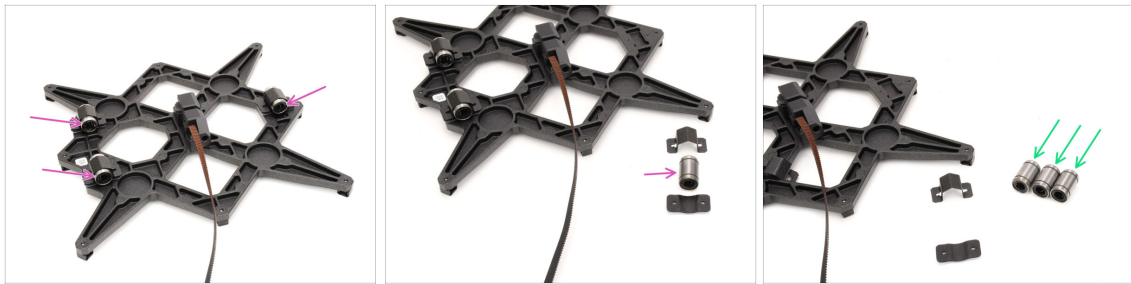


- ◆ Remove all three bearings from the bearing holders.
- ◆ Clean the bearings from any excess grease or dirt, and **save them for later use**.
- ① Two of this type of bearings will be used to build the CORE One+.

SCHRITT 20 Expansion Joint entfernen




- ◆ Using the 2mm Allen key, remove all 8 expansion joints from the Y-Carriage.
- ◆ **Save the expansion joints for later use.**
- ① Für den CORE One+ (Gen 2) **benötigen Sie nur einen Expansion-joint**. Die übrigen werden nicht benötigt.

SCHRITT 21 Extruderabdeckung entfernen

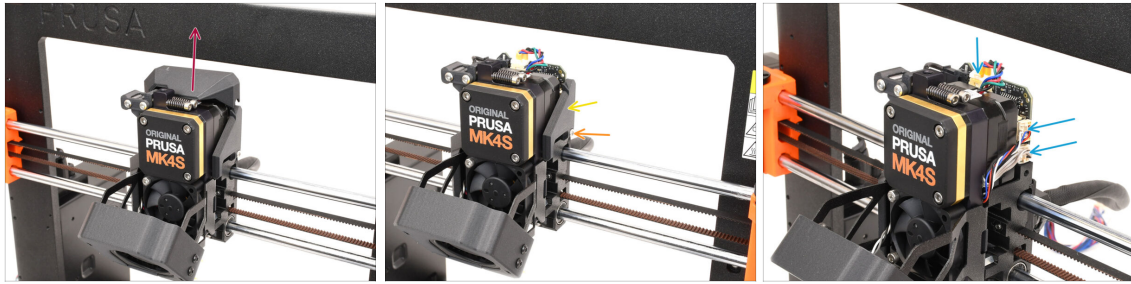


- Let's move onto the extruder.
- Remove the top cover on the extruder by lifting it up.
- Remove the screw holding the cover on the right side.
- Remove the side cover.
- Disconnect the motor, filament sensor and loadcell cables.

SCHRITT 22 Hotendbaugruppe entfernen

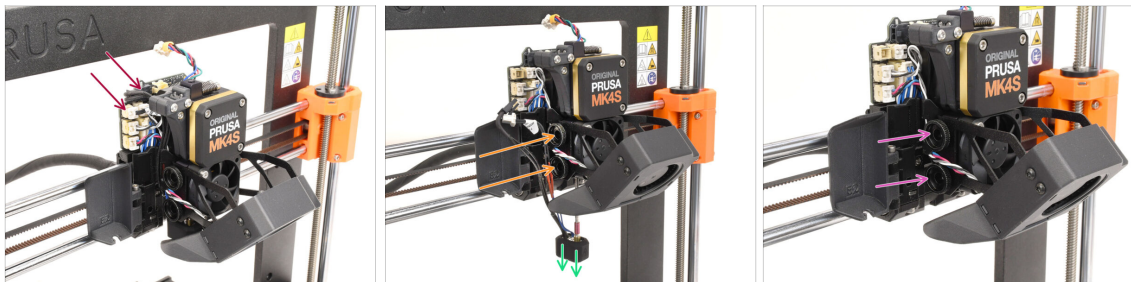


- On the opposite side, disconnect the nozzle thermistor and nozzle heater cables.
- Release the two thumb screws, until the hotend assembly drops.
- Remove the hotend assembly and **save it for later use**.
- Remove the two thumb screws and save them for later use.

SCHRITT 23 Drucklüfter entfernen

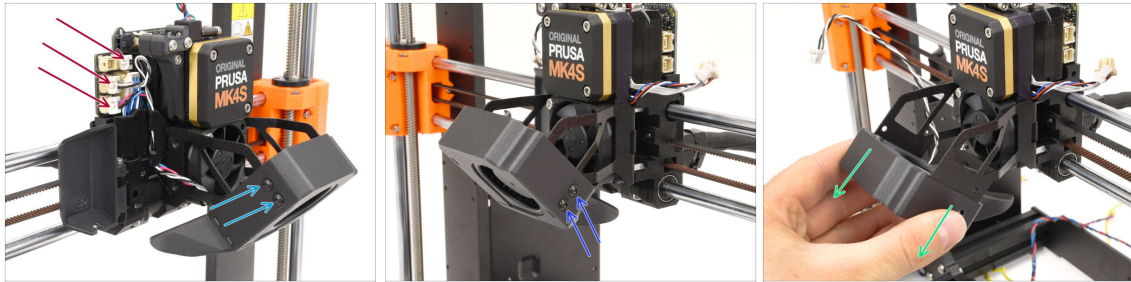

- 🔴 Disconnect the cables on the left side of the Nextruder.
- 🔵 Using the T10 screwdriver, remove the two screws holding the print fan on the left side.
- 🟡 Remove the two screws on the right.
- 🟢 Remove the print fan assembly by sliding it out. Proceed carefully to prevent damaging the cable going through the metal holder. **Save the fan assembly for later use!**

SCHRITT 24 Kühlkörperlüfter entfernen

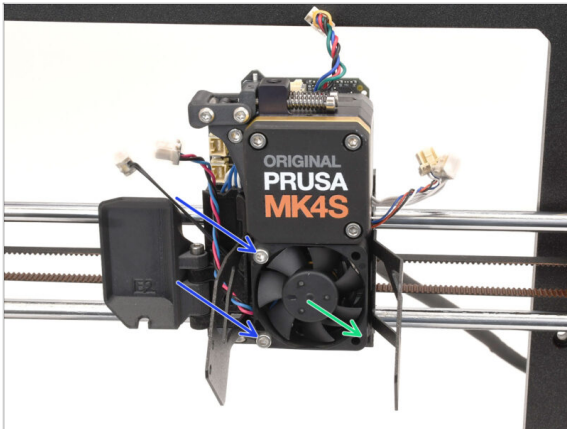


- 🟡 Remove the two screws holding the hotend fan to the heatsink.
- 🟢 Remove the fan and **save it for later use.**
- 📌 Proceed carefully to prevent damaging the cable.

SCHRITT 25 Nextruder entfernen




- ✦ Remove the three screws holding the Nextruder to the X-carriage.
⚠ Watch out! The Nextruder might fall out!
- ⬛ Remove the Nextruder from the printer.
- ✦ Remove the Print fan support and a plastic spacer (if present). Proceed carefully to prevent damaging the heatsink thermistor cable.
- ✦ Save the Nextruder for later use.

SCHRITT 26 LoveBoard entfernen

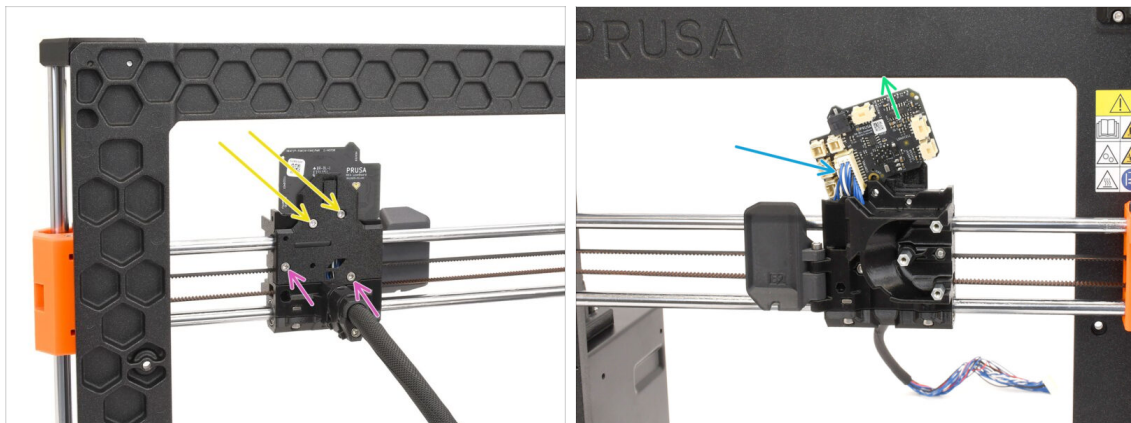

- ⬛ Move onto the back of the X-carriage.
- ✦ Remove the two marked screws on top of the backing plate.
- ✦ Loosen the two remaining screws, but do not remove them entirely yet.
- ✦ Lift the Loveboard slightly to disconnect it from the main cable. Proceed carefully to prevent any damage to the Loveboard.
- ✦ Remove the Loveboard and save it for later use.

SCHRITT 27 Z Motoren entfernen

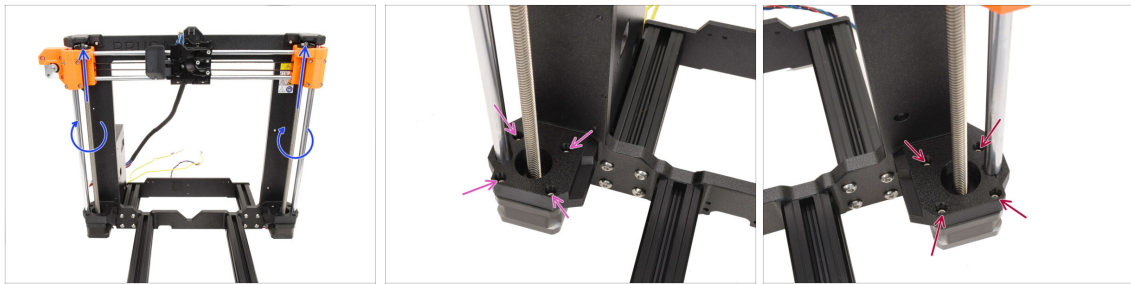


- Rotate both threaded rods by hand to move the X-axis assembly all the way to the top.
- Using a ball-end 2.5mm Allen key, remove all 4 screws securing the left Z motor.
- Remove the 4 screws holding the right Z motor as well.

SCHRITT 28 Z Motors Removal 2




- Rotate the threaded rods on both sides to disengage both the motors from the trapezoid nuts on the X-End parts.
- Disengage the motors on both sides from the holders. The X-axis will drop slightly.
- ① Der Motor kann aufgrund der aufgeklebten Gummidichtung an der Kunststoffhalterung festsitzen. Drehen Sie den Motor vorsichtig, um ihn zu lösen.

SCHRITT 29 Z Motors Removal 3

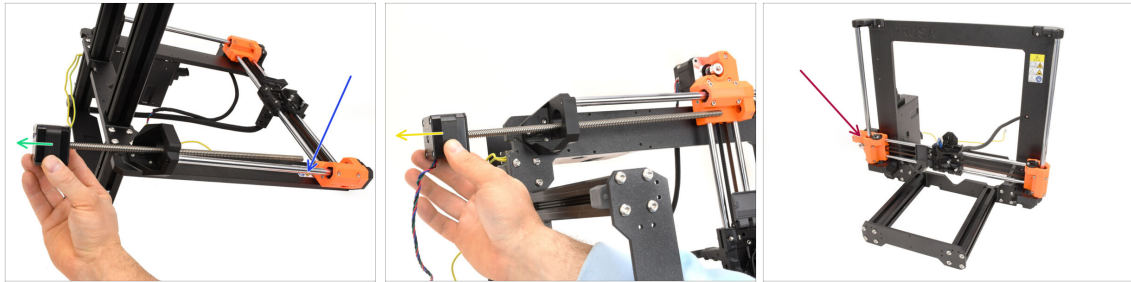


- ◆ Lay the frame onto its back part.
- ◆ Remove the right Z motor by sliding it out. **Save it for later use.**
- ◆ Remove the left Z motor. **Save it for later use.**
- ◆ Move the frame back to the original position. **Expect that the X-axis now moves freely and may fall rapidly.**

SCHRITT 30 Z Stangen entfernen

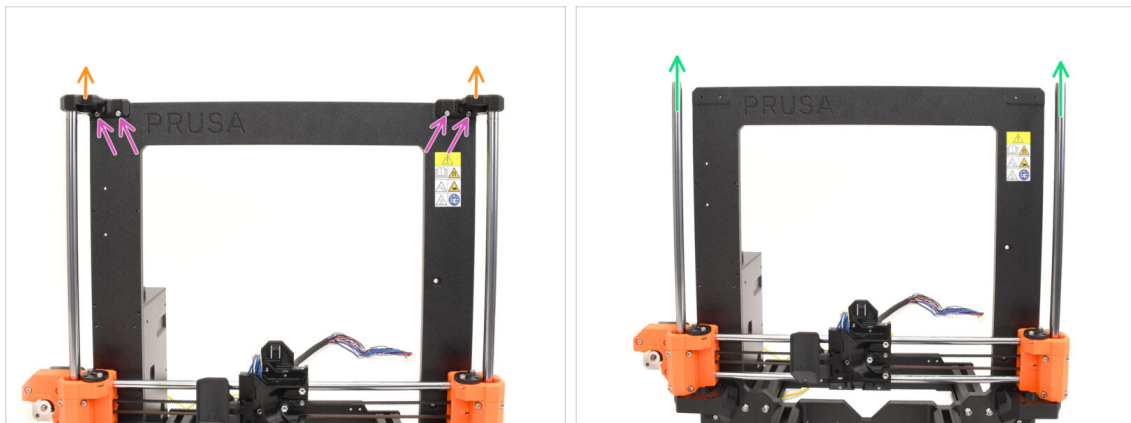


- ◆ Remove the four screws holding the Z-top parts on both sides.
- ◆ Remove both Z-tops by pulling them up and disengaging from the rods.
- ◆ Pull up both Z rods and remove them from the printer. **Save both rods for later use.**
- ① A slight wiggling motion may help to disengage them from the plastic part.

SCHRITT 31 Trapezmutter entfernen

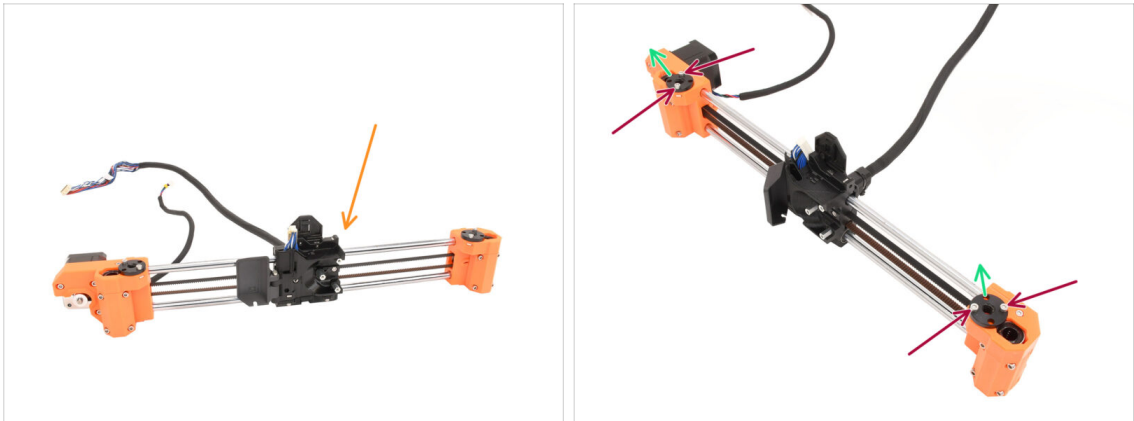


- Remove the X-axis assembly from the printer's frame.
- Remove the four screws holding the trapezoid nuts on top of both sides of the assembly.
- Remove both the trapezoid nuts and **save them for later use**.
- i** If the nuts are hard to remove, try rotating them, while pulling them up. If that doesn't help, carefully use the threaded rod on one of the Z-motors, to pry them out.

SCHRITT 32 X Motor lösen

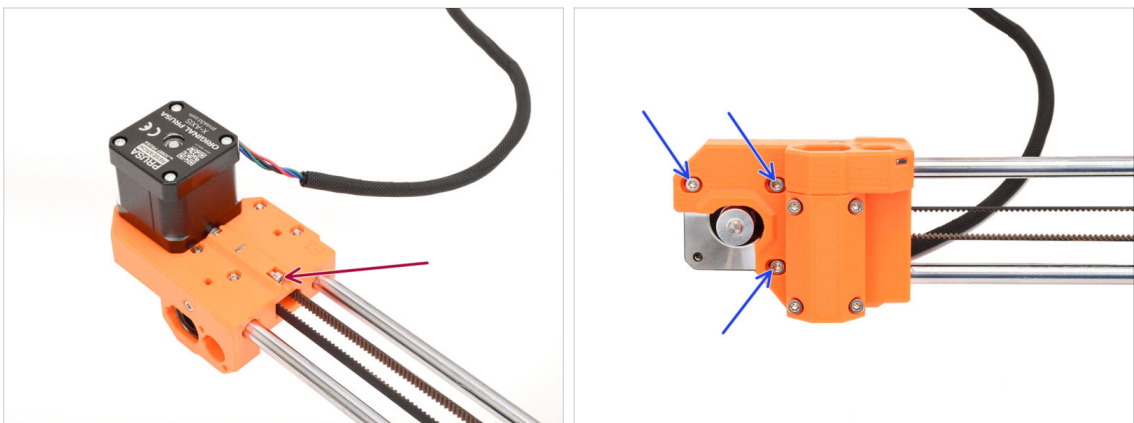

- On the back of the assembly, remove the belt tensioning screw
- Loosen the three screws holding the motor on the front.
- i** We need to release the belt tension, in order to release the belt in the upcoming step.

SCHRITT 33 X Riemen lösen

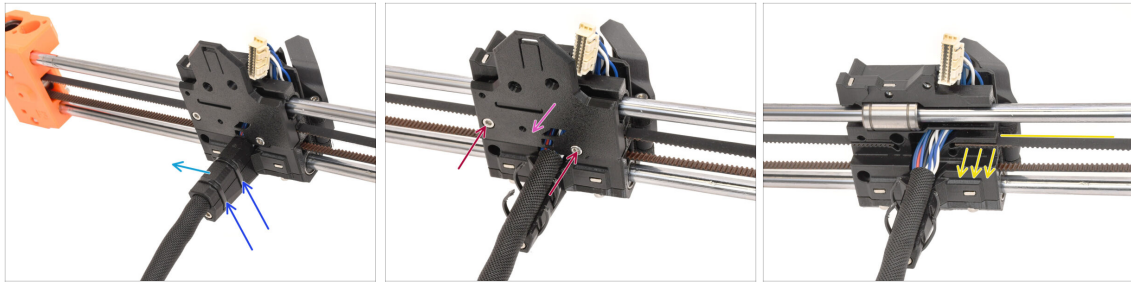


- On the back of the assembly, cut both the zip-ties holding the cable cover.
- Remove the cable cover.
- Remove both screws on the back of the X-carriage.
- Remove the cover on the back of the X-carriage.
- Pull out the end of the belt on the motor side, to disengage it.

SCHRITT 34 X Motor entfernen



- Remove the three screws holding the X-motor at the front of the assembly.
- Remove the X-Axis motor and **save it for later use**.

SCHRITT 35 X Idler Shaft Removal

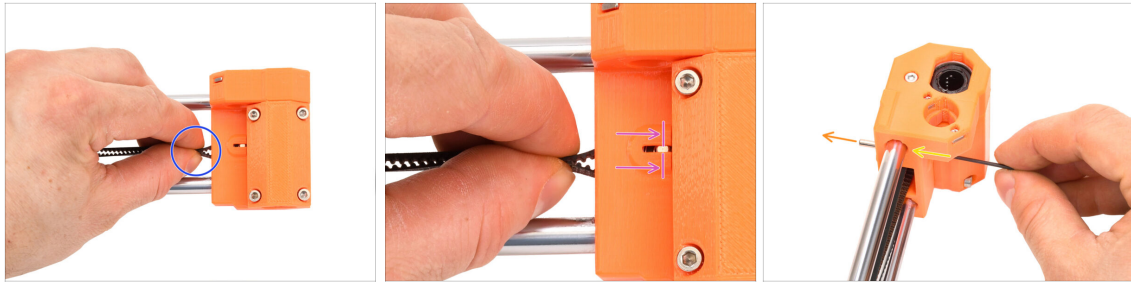

- Let's move onto the right X-end part.
- Use the belt as a handle for the Idler pulley inside the plastic part.
- Move the Idler **all the way inward**.

On the front, there is a small window where you can observe the idler shaft movement.


- While keeping the idler pushed all the way in, use the thinnest 1.5mm Allen key to push the shaft out of the part.
- The Idler shaft should exit the plastic part at the back. Remove it.

SCHRITT 36 X Idler entfernen



- Pull out the Idler pulley.
- **Save the pulley for later use.**

SCHRITT 37 xBuddy entfernen

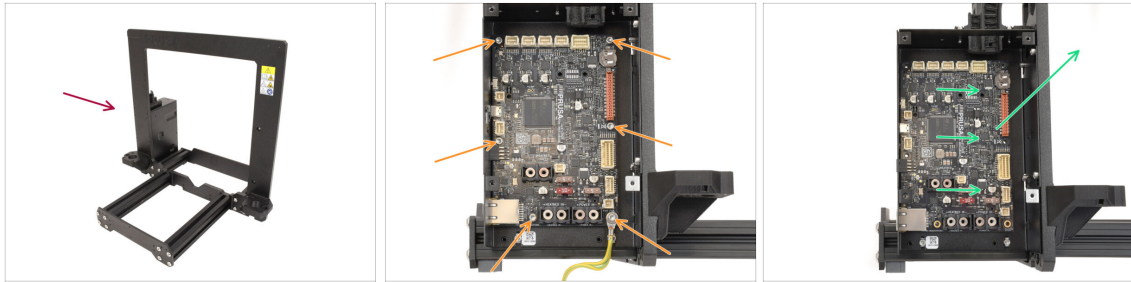


- Let's move back to the printer's frame.
- Remove the six screws holding the xBuddy board in place.
- Release the xBuddy by sliding it towards the frame, then lifting it. **Save it for later use.**

1D. Komponenten Vorbereitung




SCHRITT 1 xBuddy Vorbereitung

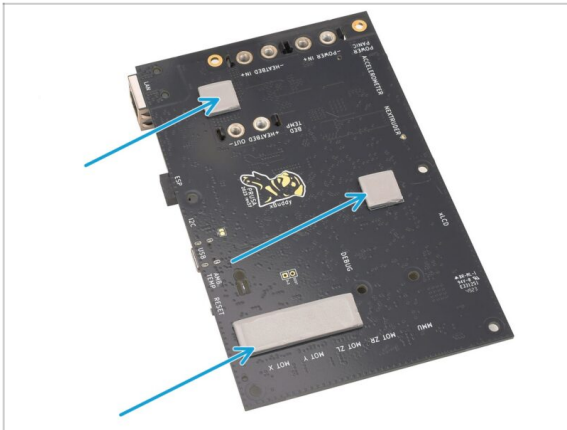

There might be thermal pads stuck to the rear of the xBuddy board. Remove the thermal pads and clean up any glue residue.

i Do not use sharp object to remove the pads.

SCHRITT 2 xLCD Demontage

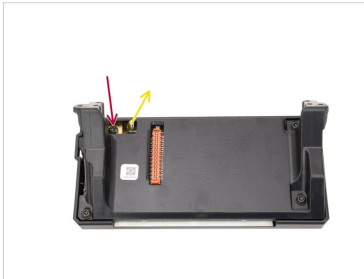

- Take the xLCD assembly.
- Remove the encoder knob and **save it for later use**.
- Flip the assembly around.
- Using the T10 Torx screwdriver, remove the screw holding the grounding faston connector.
- Remove the grounding faston connector and **save it for later use**.

SCHRITT 3 xLCD Demontage 2




- Remove the three screws holding the assembly together.
- Separate the assembly from the front part of the cover.
- Remove the xLCD from the back of the cover. **Save it for later use.**

SCHRITT 4 Drucklüfter Vorbereitung




- Take the print fan assembly.
- Using the T10 screwdriver, remove the screw holding the fan shroud.
- Remove the fan shroud.
- Remove the two screws holding the cover and open the cover.
- Remove the fan from the plastic part. **Save the fan alone for later use.**

SCHRITT 5 Y Motor Vorbereitung

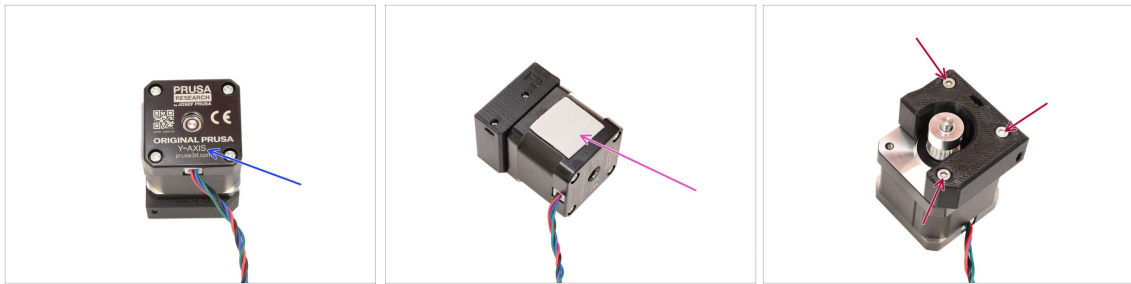


- Take the Y-Axis motor.
- Remove the thermal pad and any of its remaining pieces. Clean off any residue.
- Remove the three screws securing the motor to the plastic holder. Then, separate the motor from the holder.

SCHRITT 6 Y Motor Prep 2

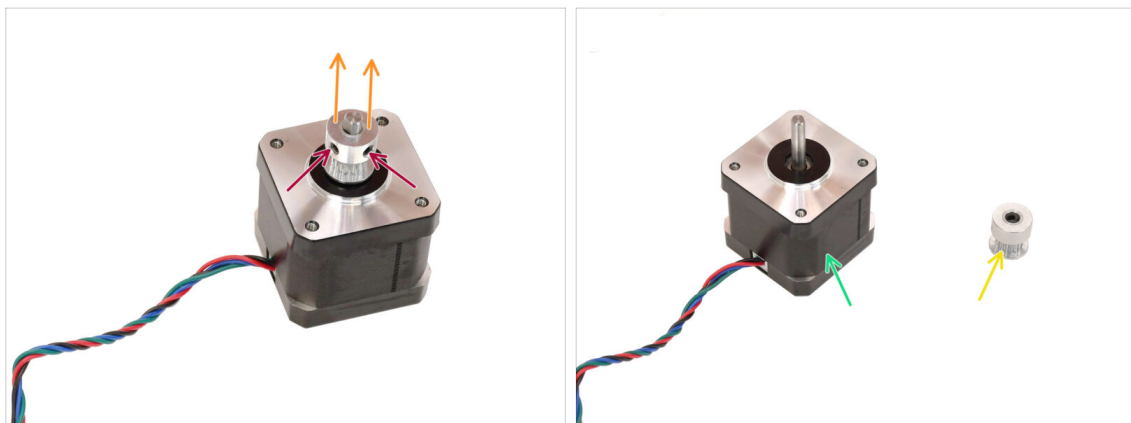


- Using the 2mm Allen key, loosen the two grub screws on the pulley. Do not remove them entirely.
- Trennen Sie die Riemenscheibe T16-2GT vom Motor.
- **Save the motor for later use.**
- Die Riemenscheibe T16-2GT wird für den CORE One+ (Gen 2) nicht mehr benötigt. Bewahren Sie sie separat auf , **um später Verwechslungen mit dem neuen Teil zu vermeiden.**

SCHRITT 7 X Motor Vorbereitung

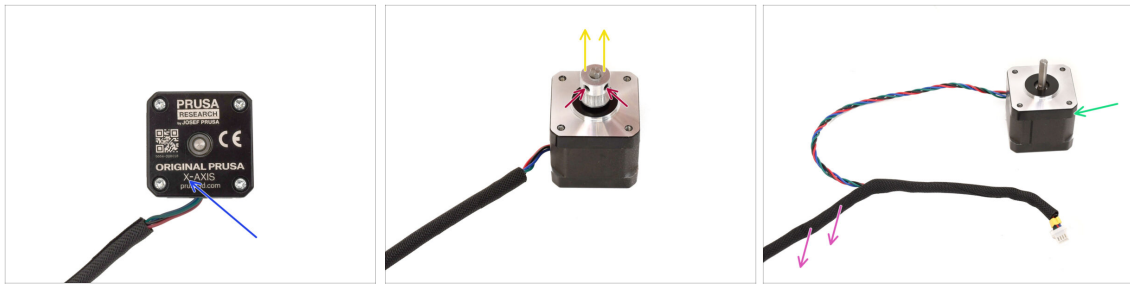


- Take the X-Axis motor.
- Loosen the two grub screws on the pulley but do not remove them entirely.
- Entfernen Sie die Riemenscheibe T16-2GT vom Motor.
 - ⓘ Dieses Teil wird für den CORE One+ (Gen 2) nicht mehr benötigt. Bewahren Sie es separat auf , um später eine **Verwechslung mit dem neuen Teil zu vermeiden**.
- Remove the textile wrap from the motor cable.
- Save the motor for later use.

SCHRITT 8 Z Motor Vorbereitung

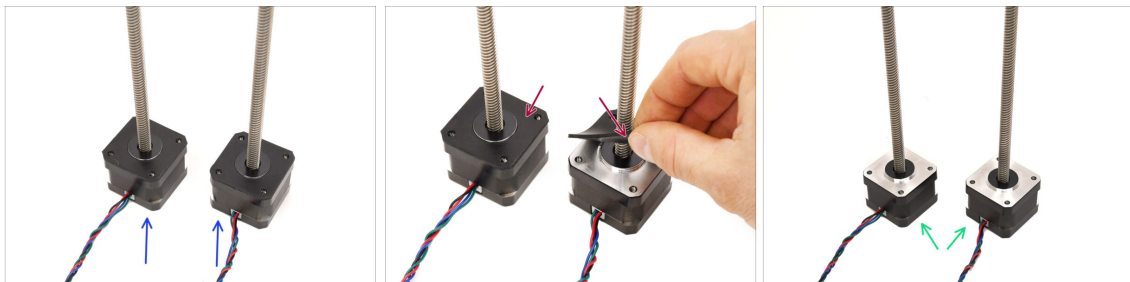


- Take the Z-Axis motors.
- Remove the rubber pads from both motors.
 - Clean off any residue from the pads.
- Save the motors for later use.

SCHRITT 9 Heizbett Vorbereitung

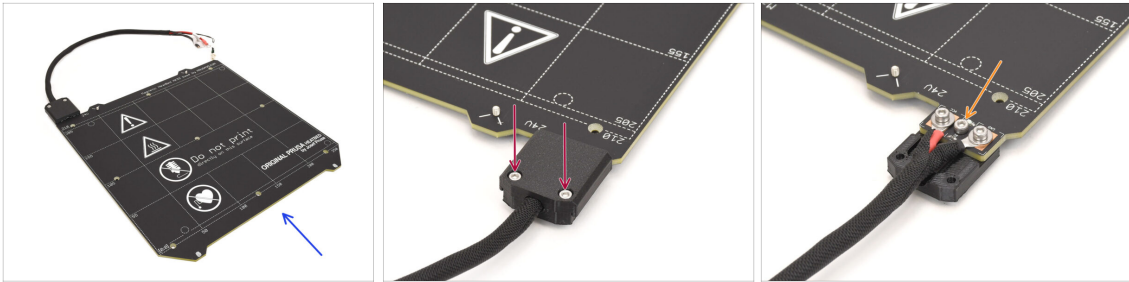


- Take the MK4S Heatbed assembly.
- Remove the two screws holding the cable cover and remove the top part of the cover.
- Remove the marked screw in the middle and detach the bottom part of the cover from the heatbed.

SCHRITT 10 Heizbett Vorbereitung 2

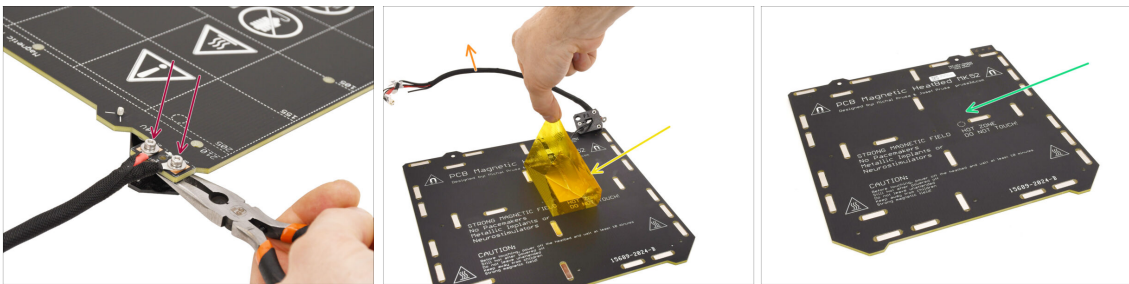

- Remove the two screws holding the power cables.
- i** Note that there are M3nN nuts underneath that must be held using either the Unikey or needle-nose pliers to remove the screws on top.
- Remove both the Kapton and aluminum stickers on the underneath to detach the thermistor.
- Remove the whole cable bundle together with the thermistor.
- Clean up any leftover adhesive and **save the heatbed alone for later use.**

SCHRITT 11 Thermistor Vorbereitung

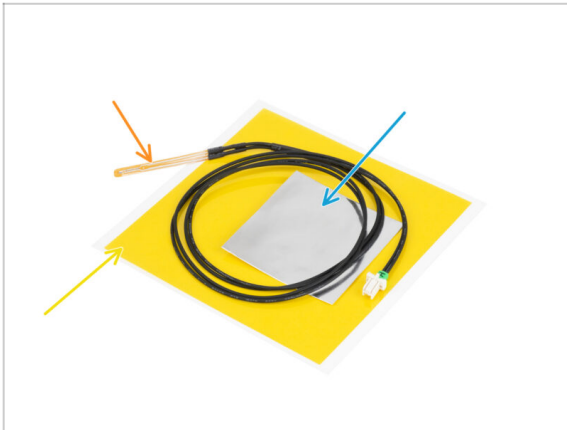

For the following steps, please prepare:

CORE One Heatbed thermistor (1x)



i This thermistor has a longer cable compared to the MK4/S version.

📌 The new thermistor comes in a separate bag within the main package.

Kaptonband (1x)

Aluminiumklebeband (1x)

SCHRITT 12 Thermistor-Installation

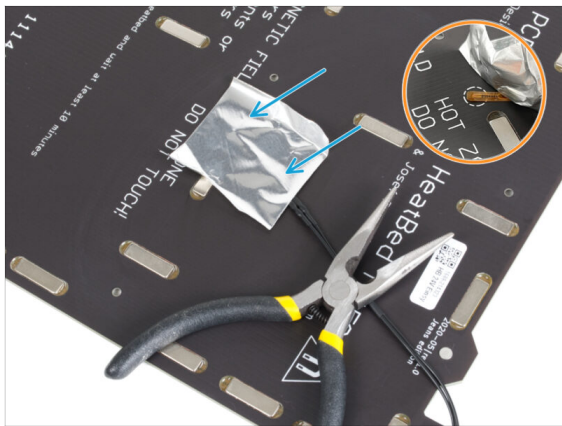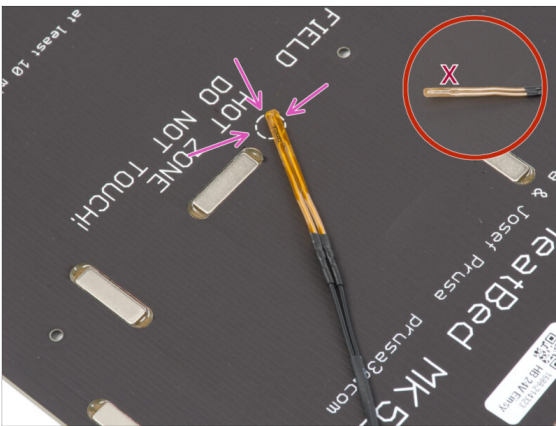

Place the thermistor onto the heatbed, ensuring the tip is positioned inside the circle.

⚠️ Important: If the thermistor is misaligned, the printer will read incorrect temperature values.

⚠️ Also, note which side the sensor is attached to on the heatbed.


i **TIP:** Use a piece of the removed tape to temporarily hold the thermistor cable. Just place it outside the area for the new aluminum tape!

Use the aluminum tape to fix the thermistor in place.

📌 The thermistor cable should be directed toward the power connector area.


Keep the tip of the thermistor in the circled area, while applying the tape.

SCHRITT 13 Thermistor-Installation 2

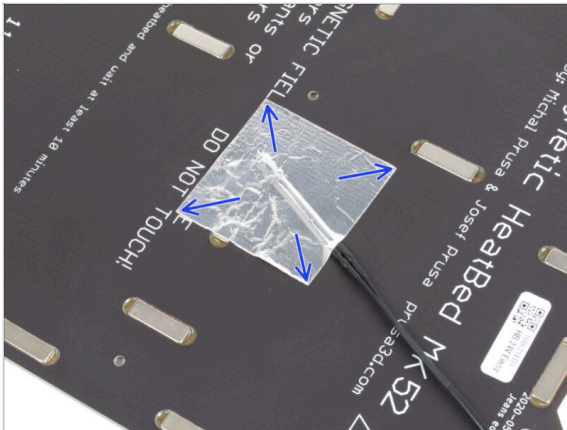

- Smooth out the aluminum tape around the thermistor using your fingers only, to ensure it is fully adhered.

SCHRITT 14 Thermistor-Installation 3

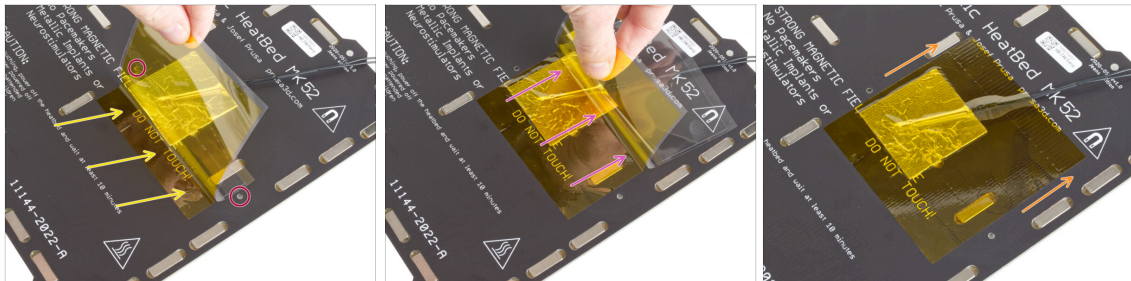


- ⚠ Now, it is time to apply the final yellow Kapton tape.

DO NOT peel off the entire tape at once—it will curl up!

- Peel off about 1 cm (1/2 inch) strip of the Kapton tape and stick it to the heatbed.
- ⚠ Start applying the tape so that it overlaps the aluminum foil entirely, while making sure it **does not obstruct any screw holes in the heatbed.**
- Continue applying the tape gradually, ensuring it does not curl too much.
- Finally, Check that the entire surface has adhered properly.

SCHRITT 15 Heizbett Überarbeitung

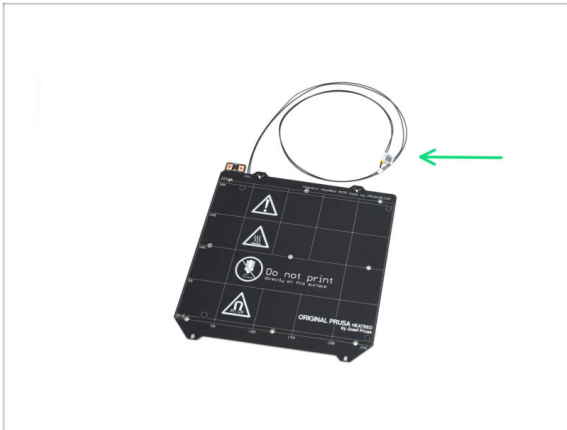

- ◆ You have successfully reworked the heated bed into the CORE One version. **Save it for later use.**

SCHRITT 16 Getriebeabdeckung Vorbereitung



- ◆ **For the following steps, prepare:**
- ◆ Gearbox Cover CORE One (1x)
- ⓘ From the Printed Parts box.

SCHRITT 17 Nextruder Überarbeitung




- Take the Nextruder assembly.
- Öffnen Sie den Idler.
- Loosen the three screws on the gearbox but do not remove them yet.
- Carefully remove the screws while holding the assembly together to prevent it from coming apart.
- Remove the cover, while keeping the rest of the gearbox together.

SCHRITT 18 Nextruder Überarbeitung 2




- Apply more grease between the gears if your gearbox lacks lubrication.
If there is already sufficient lubricant, you can leave it as is.
- Install the CORE One gearbox cover.
- Fix the assembly together using the three M3x25 screws you have removed earlier.
- Save the reworked Nextruder for later use.**

SCHRITT 19 Lager prüfen

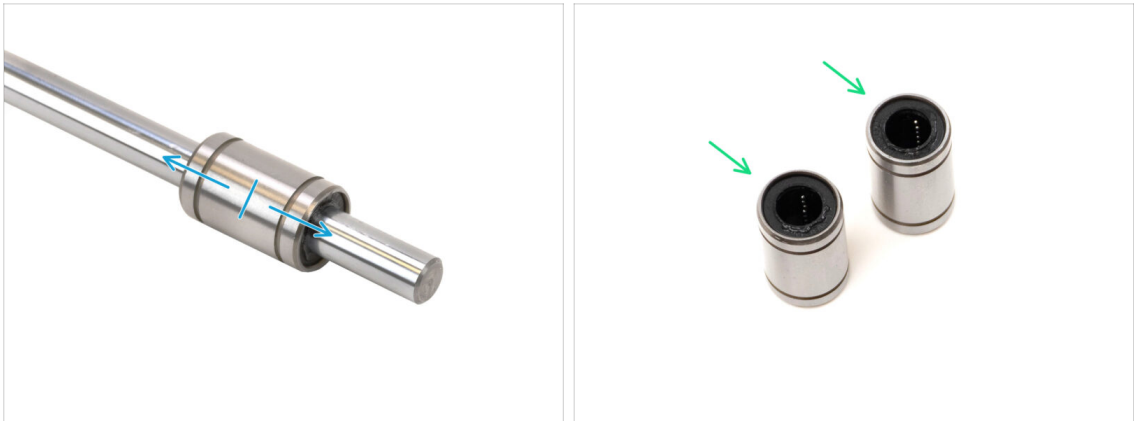

- Earlier, you have removed at least three LM8UU bearings from your printer.
- Only two of this type of bearings will be used to build the CORE One.
- Check each bearing for seamless movement by attaching it to a smooth rod and sliding it back and forth.
- Select two of the best-performing bearings for later use.
- Set aside the remaining bearing(s).

SCHRITT 20 Teile prüfen

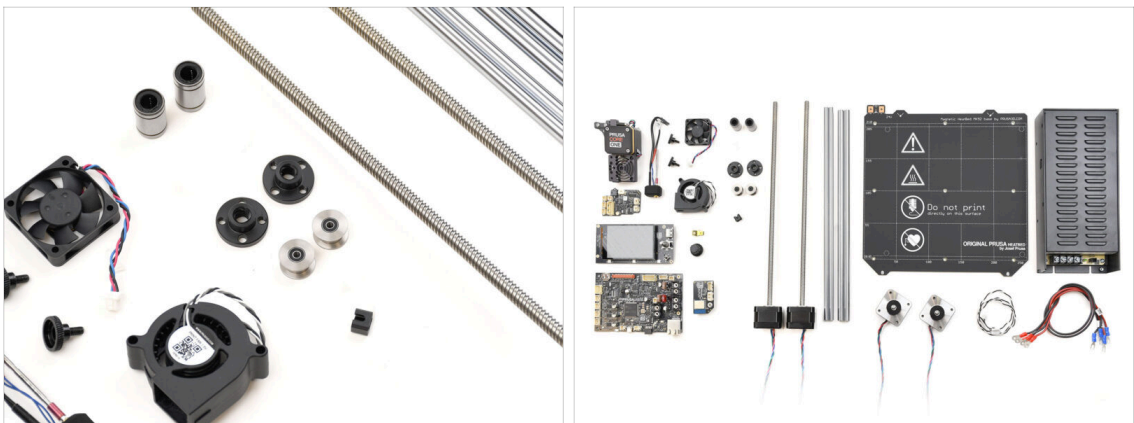


- The disassembly and preparation part is over.
- In the following steps, **we will list the required parts one by one**. Check that you have everything listed.

SCHRITT 21 Teile Zusammenfassung 1




- Linearlager LM8UU (2x)
 - Trapezgewindemutter (2x)
 - Idler Riemenscheibe (2x)
 - Ausgleichsverbindung (1x)
- i** Für den CORE One+ (Gen 2) benötigen Sie nur einen Expansion-joint. Die übrigen werden nicht benötigt.

SCHRITT 22 Teile Zusammenfassung 2

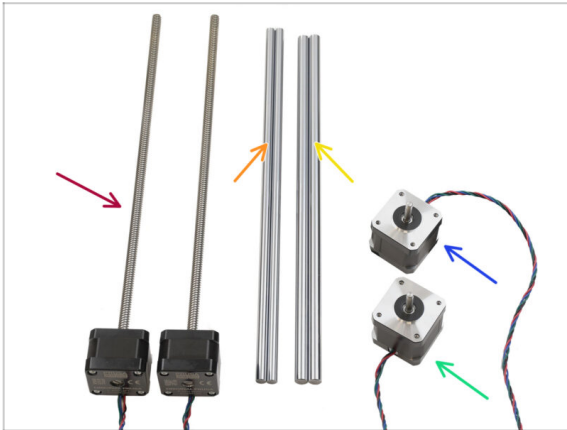


- Z-Motor (2x)
- Stange 8x330 (2x)
- Stange 10x325 (2x)
- Y-Motor
- X-Motor

SCHRITT 23 Teile Zusammenfassung 3

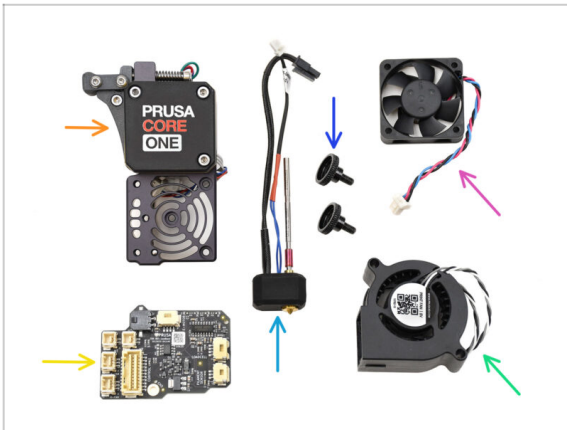


- Nexttruder Baugruppe
- Düsen-Baugruppe
- Rändelschraube (2x)
- Hotend Lüfter
- LoveBoard
- Drucklüfter

SCHRITT 24 Teile Zusammenfassung 4

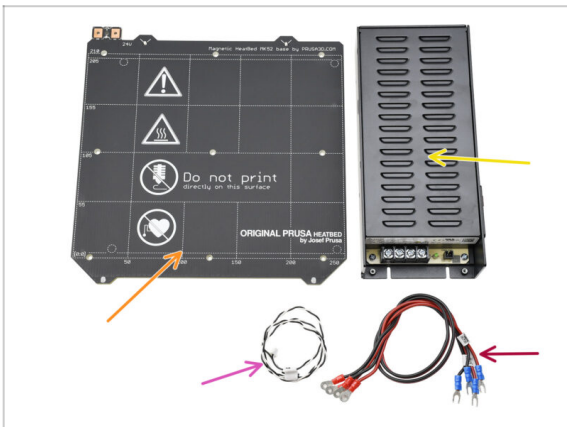


- Heizbett
- Netzteil
- Power Panic Kabel
- PSU Power Cable (2x)

SCHRITT 25 Teile Zusammenfassung 5

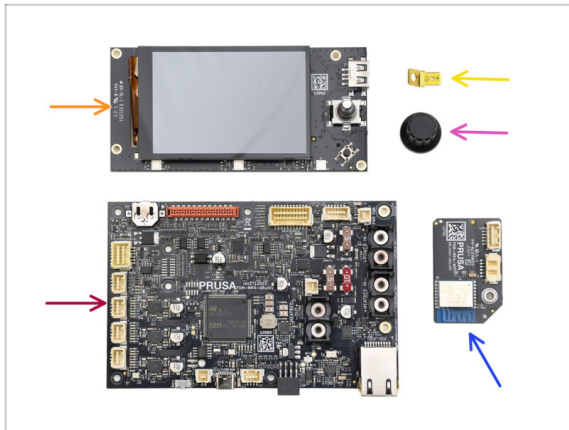

- xLCD
- Erdungs-Faston-Stecker
- Drehknopf
- xBuddy Platine
- Wi-Fi Modul

SCHRITT 26 Teile Zusammenfassung 6

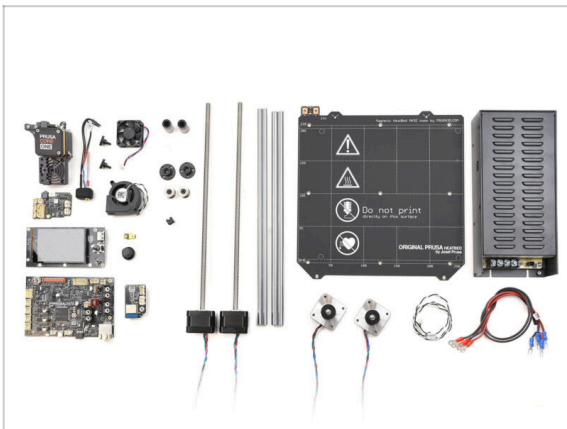


- Congratulations! All the necessary parts from your old printer are prepared.

⚠ Set aside any remaining, unused parts to avoid mixing them with the required components.

2. Zusammenbau der Basis



SCHRITT 1 Tools necessary for this chapter

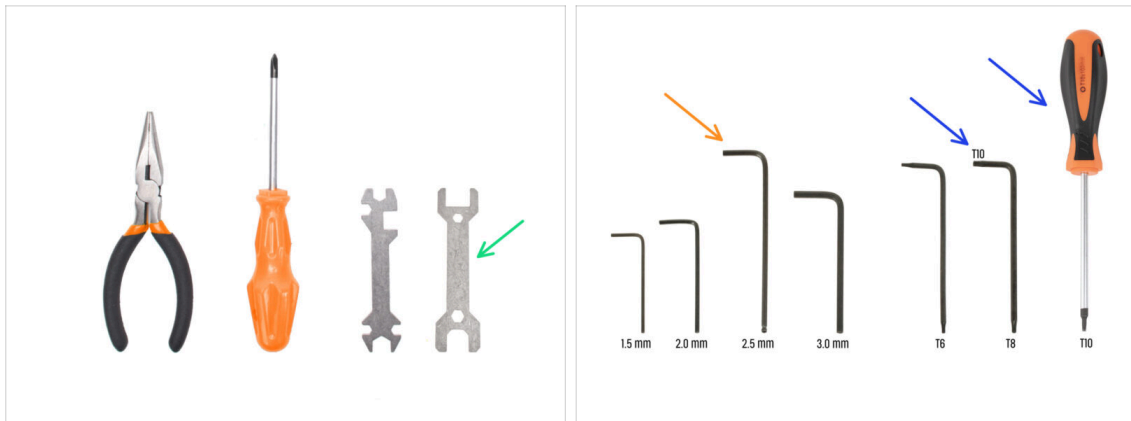


● **For this chapter, please prepare:**

- Schraubenschlüssel 13-16
- 2,5mm Innensechskantschlüssel
- T10 torx key / T10 torx screwdriver

① You can find the tools in the box labeled: 2. Electronics & Fasteners.


SCHRITT 2 Base assembly: parts preparation

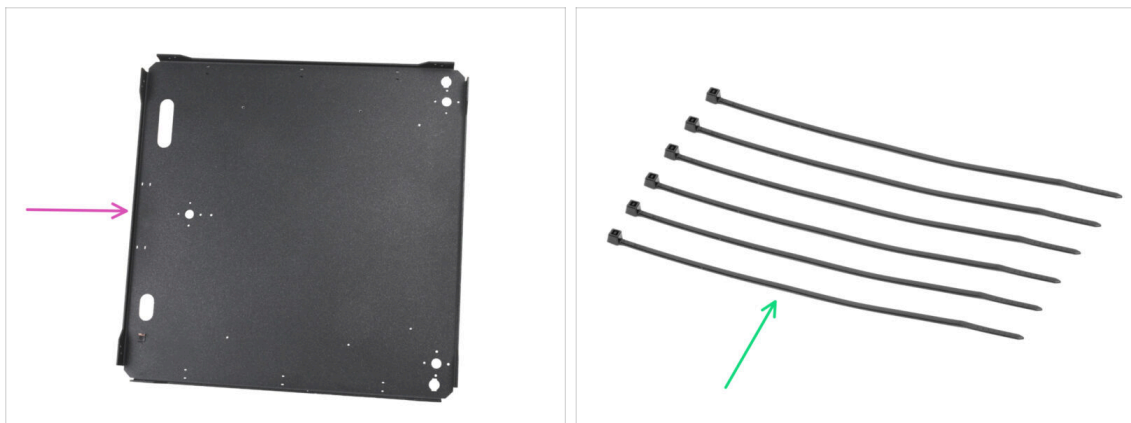

● **For the following steps, please prepare:**


- Bottom panel (1x) *found in the Metal parts 1/3 package*
- Zip tie (6x) *found in the Electronics & Fasteners package*

SCHRITT 3 Inserting the zip ties

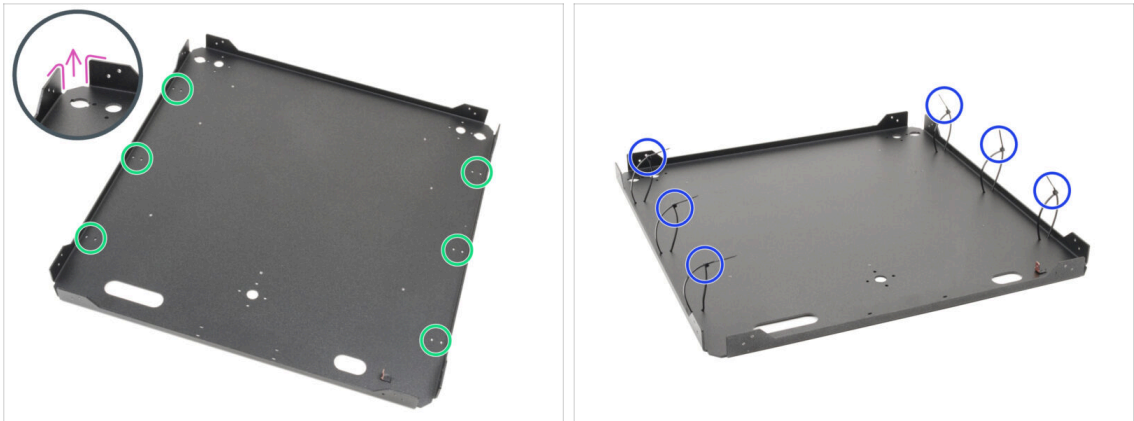


- ✿ Turn the bottom panel so that the bends of the plate are facing upwards.
- ✿ Note the twin holes for the zip ties around the perimeter of the panel.
- ✿ Insert six zip ties through the holes, placing them along both sides and partially tightening them, engaging only the first few teeth.
 - ⚠ **Do not fully tighten them yet, as we will route cables through them later.**
 - ⓘ Note: The orientation of the zip tie heads (inside or outside the metal sheet) doesn't matter.

SCHRITT 4 Base assembly: parts preparation (part 1)

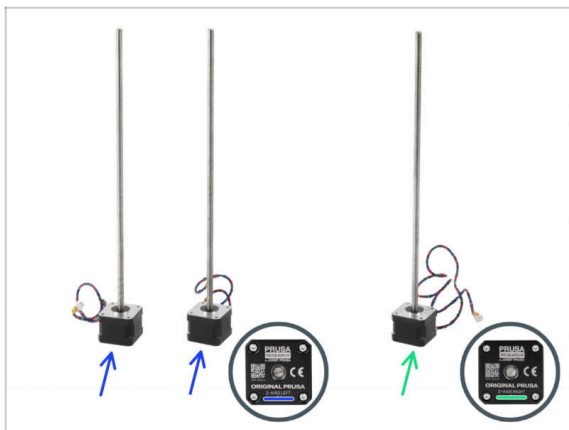


- ✿ **For the following steps, please prepare:**
- ✿ Z-Achse linker Motor (2x) im Motorenpaket
 - ⚠ One Z-axis left motor is packed separately in the *Electronics & chamber parts* package.
 - ⓘ For now, keep the trapezoidal nuts in the motor package.
- ✿ Z-axis right motor (1x) found in the Motor kit package.

SCHRITT 5 Base assembly: parts preparation (part 2)

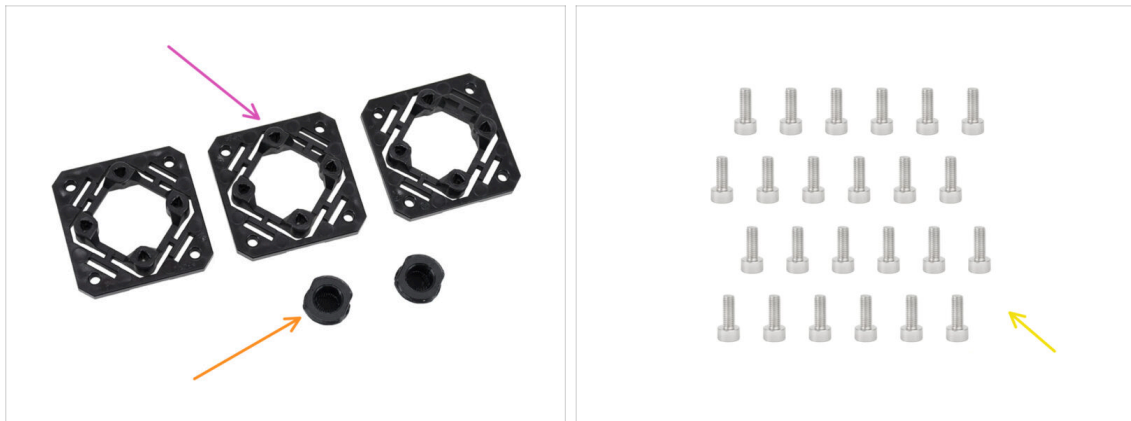

- ◆ Z-motor-mount (3x) found in the Printed parts package.
- ◆ Z-rod-mount (2x) found in the Printed parts package.
- ◆ M3x8 screw (24x) found in the Fasteners (3/3) package.

SCHRITT 6 Installing the motor mounts

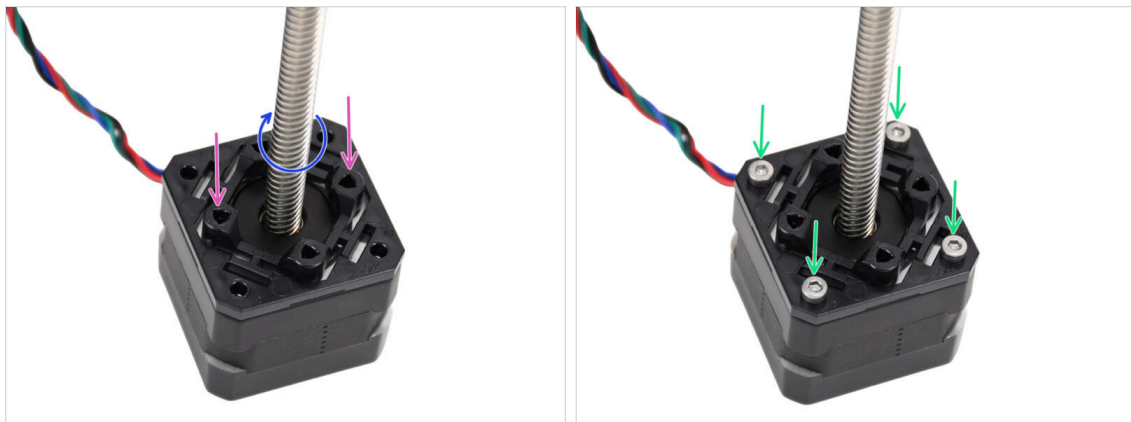


- ◆ Try to rotate the threaded rods on each Z motor to make sure they are not completely blocked in rotation.
- ◆ Setzen Sie je eine Z-motor-mount auf jeden Motor. **Die Vorsprünge an dem Teil müssen nach oben zeigen.**
- ◆ Align holes with all the parts.
- ◆ Join all parts together with four M3x8 screws.
- ◆ Follow the same procedure for all motors.

SCHRITT 7 Installing the rear motor



- ✦ Turn the bottom panel upside down.
- ✦ Locate the circle hole in the middle of the panel back side.
- ✦ Take the **Z motor right** - the motor with the longest cable. Labeled ZR on the cable.
- ✦ Push the motor threaded rod through the panel and align the holes in the panel with the holes in the motor assembly.
- ⚠ **The motor cable must point outwards (towards you).**
- ✦ Push both Z-axis motor left through the bottom panel.
- ✦ **The motor cables must point to the rear motor side.**
- ⓘ In the following instructions, we will refer to the **front** and **rear** sides of the assembly. The **front side has TWO motors**, while the **rear side has ONE motor**. We will remind you along the way, but it's good to keep this in mind :).

SCHRITT 8 Securing the rear motor

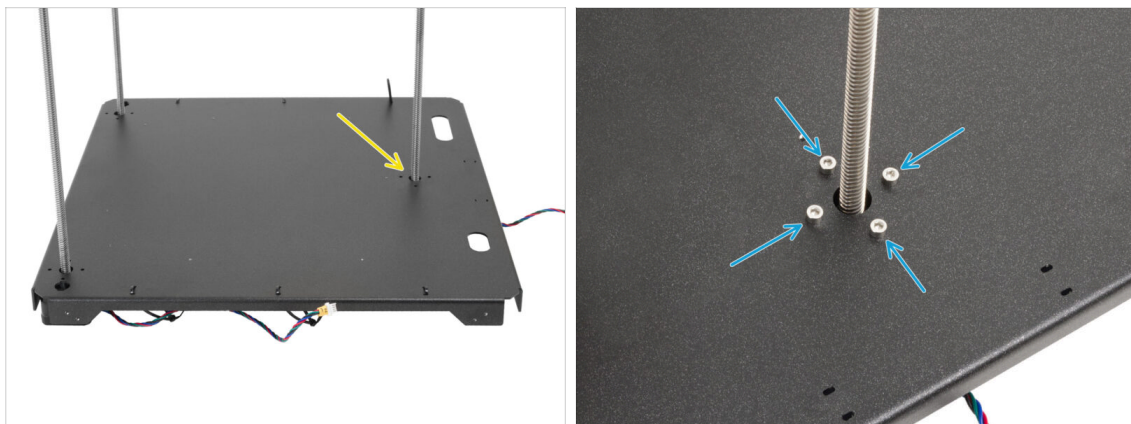

- ✦ Begin securing the motors, starting from the rear motor.
- ✦ Insert and fully tighten four M3x8 screws into the **rear motor**.
- ⚠ **Make sure the screws stay straight and do not tilt as you tighten them.**
- ⚠ **Do not overtighten the screws, as they thread directly into the plastic part. For a final tightening, use the shorter part of the key as a handle to apply the correct amount of torque.**

SCHRITT 9 Installing the front motor right



Check the Z-rod-mount printed parts for any imperfections. It has to be completely clean inside for the smooth rod to be inserted later on.

i We have to ensure that the smooth rods will fit in perfectly later on. Check this by inserting the thinner smooth rods (found in the *Rods* box) into the Z-rod-mount now.


- Insert the Z-rod-mount into the opening next to the front right Z motor.
- Use the 13-16 wrench to rotate the rod mount 90 degrees, locking it into place.
- Secure the motor using four M3x8 screws. Tighten them completely.
- ⚠ **Make sure the screws stay straight and do not tilt as you tighten them.**

SCHRITT 10 Installing the front motor left



- Let's move to the front left motor (from the front view).
- ⚠ **Ensure, the motor cable still points to the rear side.**
- Insert the rod-mount into the opening next to the front right Z motor.
- Use the 13-16 wrench to rotate the rod mount 90 degrees, locking it into place.
- Secure the motor using four M3x8 screws. Tighten them completely.
- ⚠ **Make sure the screws stay straight and do not tilt as you tighten them.**
- Place the whole assembly aside for a while.


SCHRITT 11 Bottom frame: parts preparation

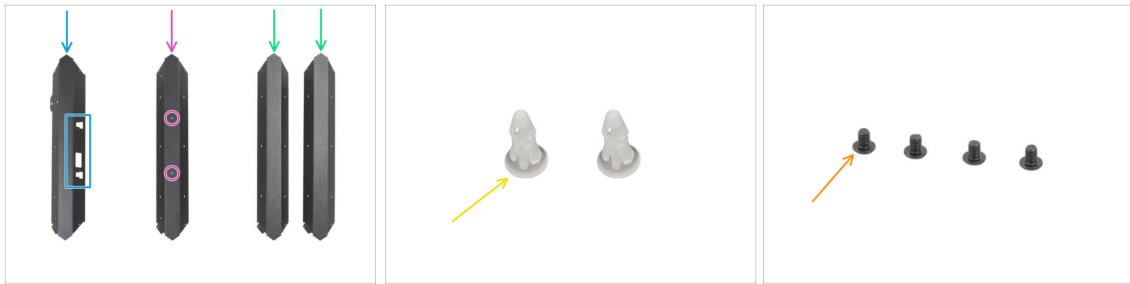

For the following steps, please prepare:


- ⚠ Be very careful when handling sharp sheet metal parts to avoid injury or damage.
- ⚠ Metal sheet profiles may look identical at first glance, but there are some differences. **DOUBLE-CHECK** to pick the correct ones.
- 🔵 Front profile (1x) **notice the cutouts** - found in the Metal parts 1/3 package
- 🟣 Rear profile (1x) **with two holes on the flat side** - found in the Metal parts 1/3 package
- 🟢 Universal profile (2x) **no holes on the flat side** - found in the Metal parts 1/3 package
- 🟡 Spacer pin (2x) found in the Electronics & Fasteners package
- 🟠 Schraube M3x4rT (4x)

SCHRITT 12 Assembling the bottom profile: front + left

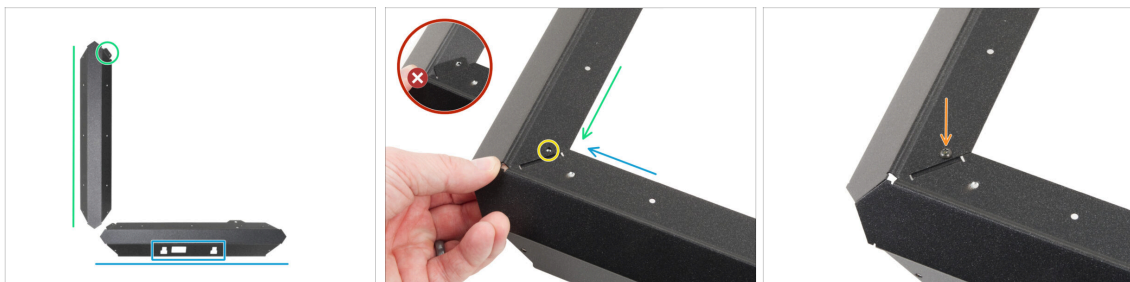

- ⚠ Be very careful when handling sharp sheet metal parts to avoid injury or damage.
- 🔵 Place the front profile according to the picture. The cutouts must be facing you.
- 🟢 Place one of the universal profiles on the left side. Orient the part according to the picture. **Use the flange as a guide.**
- ⬛ Attach the two profiles together.
 - ⚠ The flange of the front plate (blue arrow) must be inserted **under** the left universal profile (green arrow), not on top of it.
- 🟡 Align the holes in both parts.
- 🟠 Join both parts together with the M3x4rT screw.

SCHRITT 13 Assembling the bottom profile: left + rear

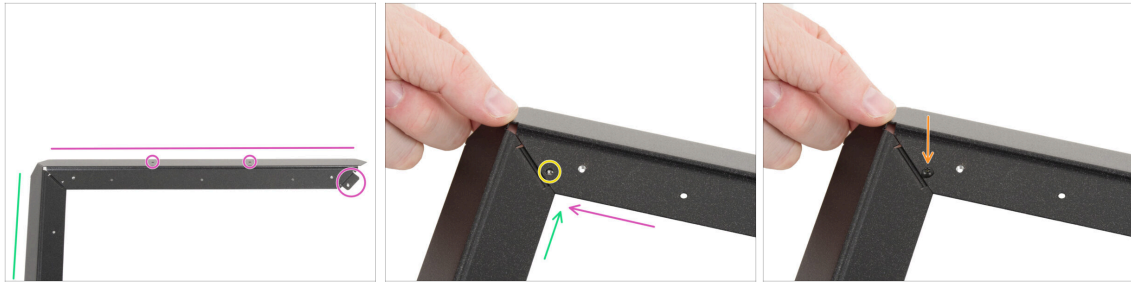

- According to the picture, place the rear profile (with two holes on the flat side) to the universal left profile. Orient the part according to the picture. **Use the flange as a guide.**
- Join the rear profile with the universal left profile together.
 - ⚠ **Make sure the flange is under the rear profile, not on top.**
- Align the holes in both parts.
- Join both parts together with the M3x4rT screw.

SCHRITT 14 Assembling the bottom profile: right



- Attach the universal right profile between the rear and front profile. **Ensure that:**
 - The **rear** end is **above** the rear profile flange.
 - The **front** flange is inserted **under** the front profile.
- Secure the left profile with M3x4rT on both ends.

SCHRITT 15 Inserting the spacer pins



- Insert the spacer pin into the hole in the front profile protrusion.
- Push firmly on the spacer pin so that it fits perfectly into the hole.
- Use the same procedure for the second spacer pin.

SCHRITT 16 Anti-vibration feet: parts preparation



- For the following steps, please prepare:
- Anti-vibration foot (4x) found in the *Electronics & Chamber parts package*
- Schraube M3x4rT (8x)

SCHRITT 17 Installing the anti-vibration feet



- Place the bottom frame according to the picture. The front profile must be facing you.



Before applying the anti-vibration feet, **wipe the metal profiles with isopropyl alcohol** and let them dry. This ensures proper adhesion.



Peel off the protective layer from all anti-vibration feet.



Carefully peel off **only the protective film** from each anti-vibration foot. If the adhesive layer starts to come off with the film, stop and peel from a different corner.



In case the adhesive is not sufficient, we recommend installing the feet as one of the last steps. Alternatively, you can use a 3M VHB tape to ensure that the feet will stick.



Stick one anti-vibration foot in each corner of the frame. Align it with the outer edge of the flat side of the profile.

SCHRITT 18 Installing the bottom frame




- 🔵 Turn the bottom frame upside down. **The front profile must be facing you.**
- 🟡 Attach the rear side of the bottom panel assembly to the rear side of the bottom frame.
- 🟠 Ensure that the front side of the bottom panel assembly (with two motors) aligns with the front profile of the bottom frame (with cutouts).
- 🟣 Place all the motor cables inside the center area of the bottom frame to prevent pinching.
- 🟢 Slowly and carefully lower the bottom panel assembly into the bottom profile.
 - ⬛ Ensure the assembly fits completely **inside the bottom profile.**
 - ⬛ Make sure no part of the bottom panel assembly extends outside the bottom frame
- ⚠️ **Double-check that no cables are pinched.**

SCHRITT 19 Mounting the bottom frame: right side




- ⬛ Focus on the front right corner and right side.
- 🟡 Slightly lift one of the corners of the bottom panel assembly.
- 🟢 Align the threaded hole in the bottom panel with the hole in the profile.
 - 📖 To make it easier to assemble the base, turn the assembly on each side to view hole alignment without fighting gravity. Insert an Allen key in the next hole to maintain alignment.
- 🟢 Join both parts together with the M3x4rT screw.
- ⬛ Move to the rear corner of the right side.
- 🟣 Align the holes in the base and the profile and secure it with the M3x4rT screw.

SCHRITT 20 Mounting the bottom frame: rear + left + front

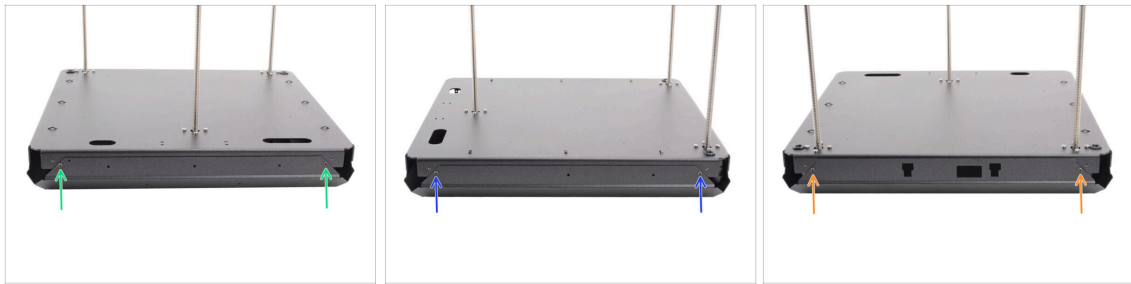

- Move to the rear side of the assembly (side with one Z motor).
- Align holes in the base assembly and the profile and secure it with two M3x4rT screws.
- Focus on the left side of the assembly.
- Align holes in the base assembly and the profile and secure it with two M3x4rT screws.
- Turn the assembly with the front profile facing you (profile with cutouts).
- Align holes in the base assembly with the profile and secure them using two M3x4rT screws.

SCHRITT 21 Haribo Zeit!

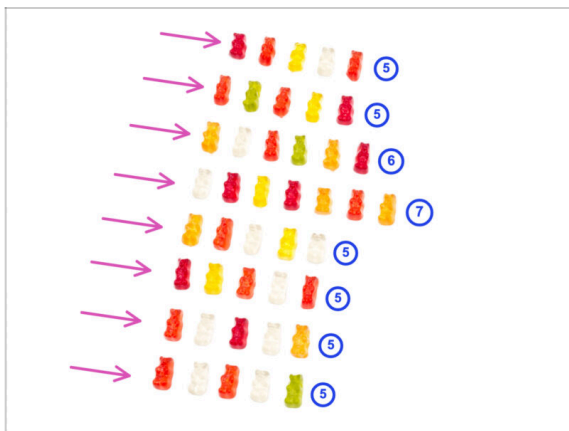

- It's time to reward yourself!
- Stack your gummy bears in eight rows.
- Arrange the number of gummy bears in each row as shown in the picture.
- ① If you don't get the exact number in the last row, we recommend finding the nearest candy store and buying the missing ones.
- Eat the first row.

SCHRITT 22 Abgeschlossen




- ◆ **Congratulations!** You just assembled the **base assembly**.
- ◆ Set the assembly aside for now and let's move to the next chapter.

3. Rückseite Montage




SCHRITT 1 Tools necessary for this chapter

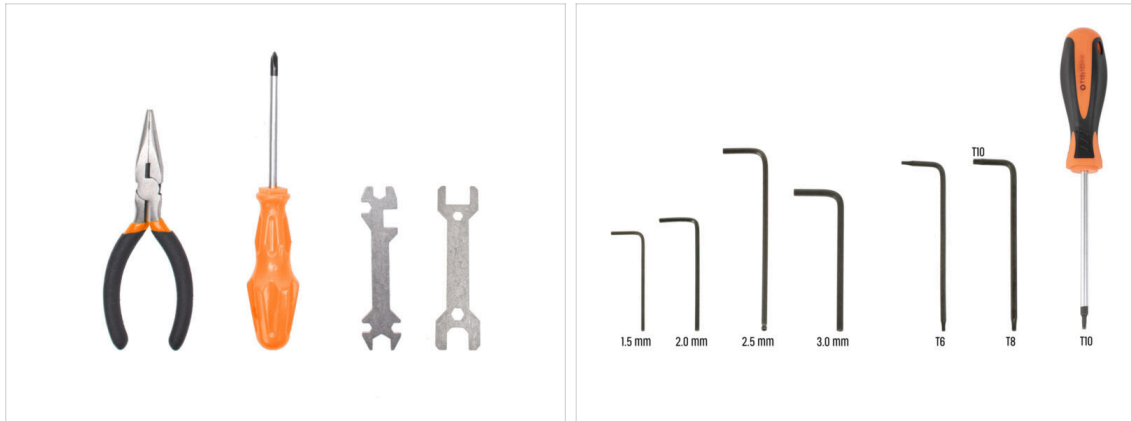

- **For this chapter, please prepare:**
- Phillips Schraubendreher PH2
- Spitzzange
- 2,5mm Innensechskantschlüssel
- T10 torx key / T10 torx screwdriver

SCHRITT 2 PSU assembly: parts preparation

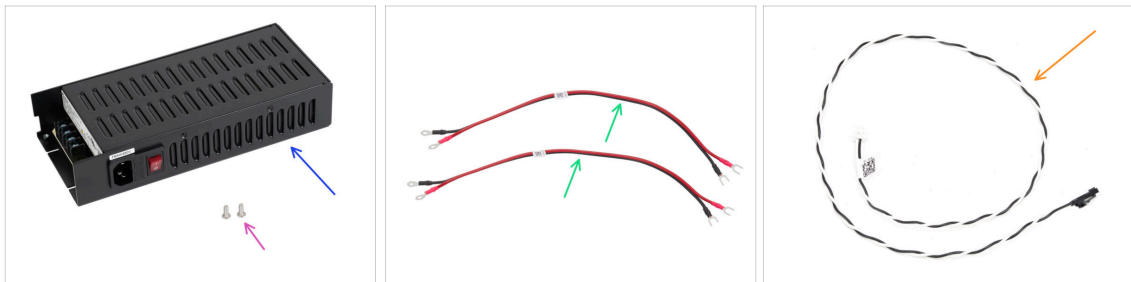


- **For the following steps, please prepare:**
- Delta Netzteil 240 W 24 V (1x) *finden Sie im Electronics Paket*
- M4x6r screw (2x) *from the Fasteners 3/3 package*
- xBuddy power cables (2x) *found in the Electronics package*
- Power panic cable (1x) *found in the Electronics package*

SCHRITT 3 Vorbereiten des Netzteils



- Insert two M4x6r screws into the left side of the PSU. **Do not tighten them completely.** Leave at least a 4 mm (0.16 in) gap between the screw head and the PSU.
- Slightly loosen all four power terminal screws on the PSU. **Do not remove them.** 3-4 turns are enough.

SCHRITT 4 Stromkabel Info

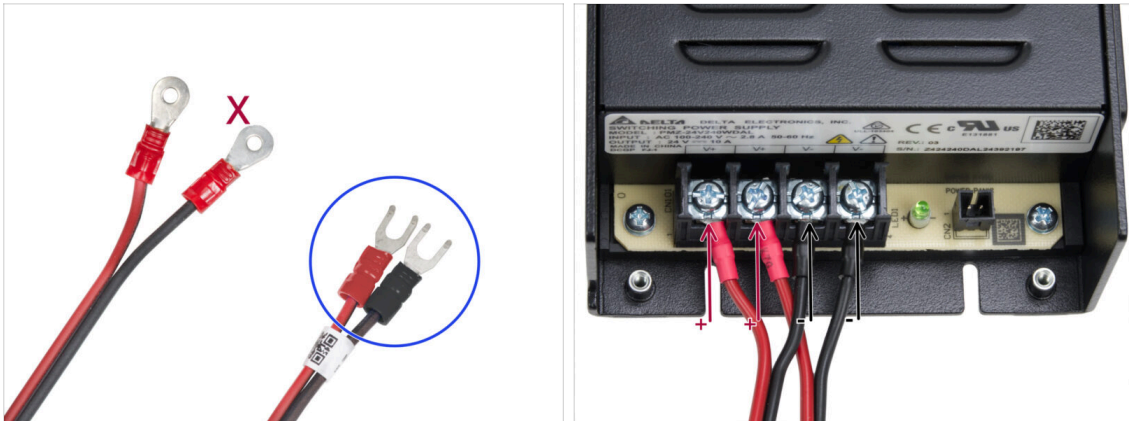

- i** In the following steps, we will be connecting the power cables one by one. The terminal screws are installed on the PSU already. Loosen them but **don't remove them completely** so they don't get mixed up with the other type of screws used on the xBuddy board side of the cable. Each of the two power cables has two leads. One has a prevailing **red color = positive / +**
 One has a prevailing **black color = negative / -**
- Note that the power cables have different connectors on each end. For now, prepare the U-shaped connectors (crimping tube color may vary).
- **Note that the polarity of the terminals on the PSU is:**


 - Positiv (V+)
 - Positiv (V+)
 - Negativ (V-)
 - Negativ (V-)
- i** The red cable (positive) may have a black stripe on it. Similarly, the black cable (negative) can have a red stripe on it.
- ⚠** **Do not connect any cables yet, wait until you have been prompted.**

SCHRITT 5 Anschluss des Netzteils




- Take the RED wire and slide the fork connector all the way into the first (positive) terminal from the left on the bottom of the PSU. Make sure the steel washer is above the "fork" connector.
- Tighten the terminal screw firmly.
- Use the same procedure to connect the second red wire to the second terminal slot from the left.
- Connect two black wires to the third and fourth terminal slots using the same procedure.
- Plug the power panic cable to the right most connector.
- Put the assembly aside for a while.

SCHRITT 6 xBuddy: parts preparation I.

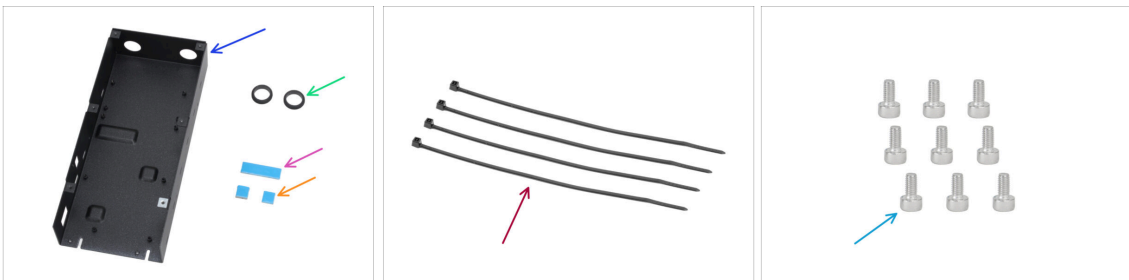


- For the following steps, please prepare:**
- CORE One xBuddy box (1x) *found in the Metal parts 3/3 package*
- Grommet 19/16 mm (2x) *found in the Electronics & Fasteners package*
- Thermal pad 40x12x2.2 mm (1x) *found in the Electronics & Fasteners package*
- Thermal pad 12x12x2.2 mm (2x) *found in the Electronics & Fasteners package*
- Kabelbinder (4x)
- Schraube M3x6 (9x)
-  The list continues in the next step...

SCHRITT 7 xBuddy: parts preparation II.

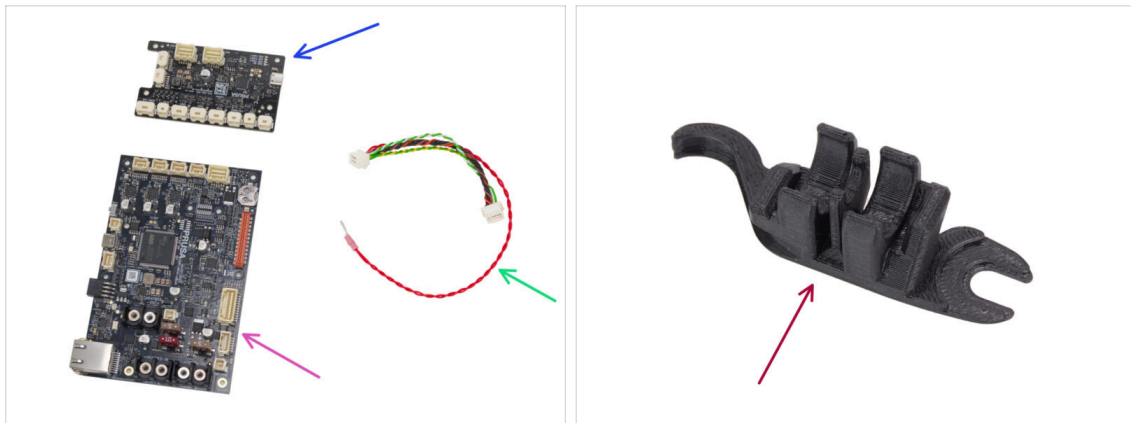


- xBuddy extension board (1x) found in the *Electronics & chamber package*
- xBuddy board (1x) found in the *Electronics package*
- xBuddy extension cable (1x) found in the *Electronics & Fasteners package*
- Assembly-multi-tool (1x) found in the *Printed parts package*

SCHRITT 8 Applying the thermal pads

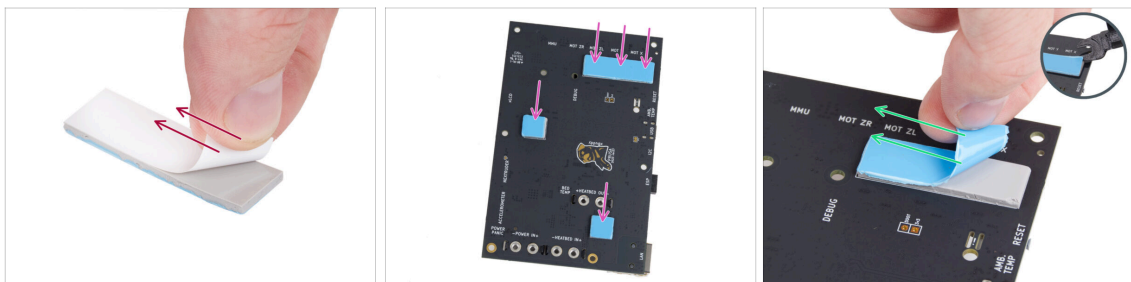


- Peel off the white protective layer from all thermal pads.
- ⚠ **Always touch the sides of the electronics board while manipulating it. Avoid touching the chips, capacitors and other parts of the electronics.**
- Attach the pads onto the back of the xBuddy board. There are markings that indicate the correct size and positions.
- ⓘ The surface to which the pads are stuck must be cleaned of grease. This will ensure better adhesion.
- ⚠ **For the protection of the board's electronic components, we strongly recommend placing the xBuddy board on the soft pad. You can use the original xBuddy bubble wrap package.**
- Peel off the blue protective layer from all thermal pads.
- ⓘ Pro tip: If the edge of the layer is difficult to lift, you can use the thin side of the Assembly-multi-tool to help separate the protective layer.

SCHRITT 9 Installieren des xBuddy

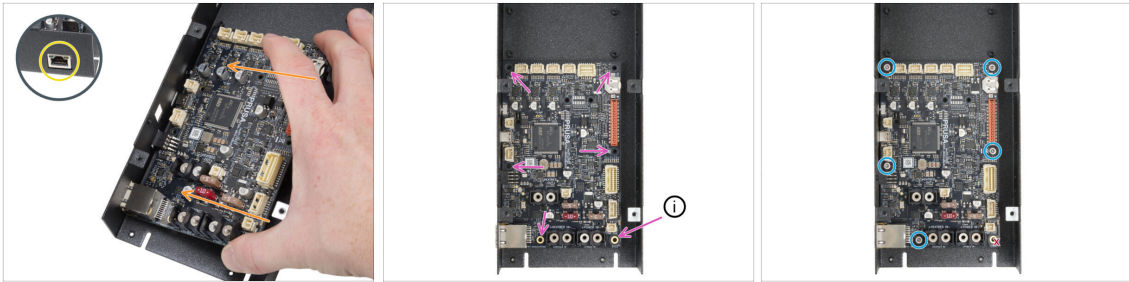


- ⚠ **Always touch the sides of the electronics board while manipulating it. Avoid touching the chips, capacitors and other parts of the electronics.**
- 🟠 Insert the xBuddy board to the xBuddy box.
- 🟡 Make sure the Ethernet connector is properly inserted into the hole in the xBuddy box.
- 🟣 **Before fully securing it, center the holes in the board with the holes (columns) in the xBuddy box**
- 📄 **This opening will remain empty; it is only highlighted for the alignment of the board.**
- 🔵 Fix the position of the xBuddy board by inserting five M3x6 screws. Do not fully tighten the screws. A few turns are enough for now.
- ⚠ **Put aside your instinct and leave the hole on the bottom right empty.**
- ⬛ **Fully tighten all five screws.** But very carefully, otherwise you can damage the electronics board.

SCHRITT 10 Installing the xBuddy extension

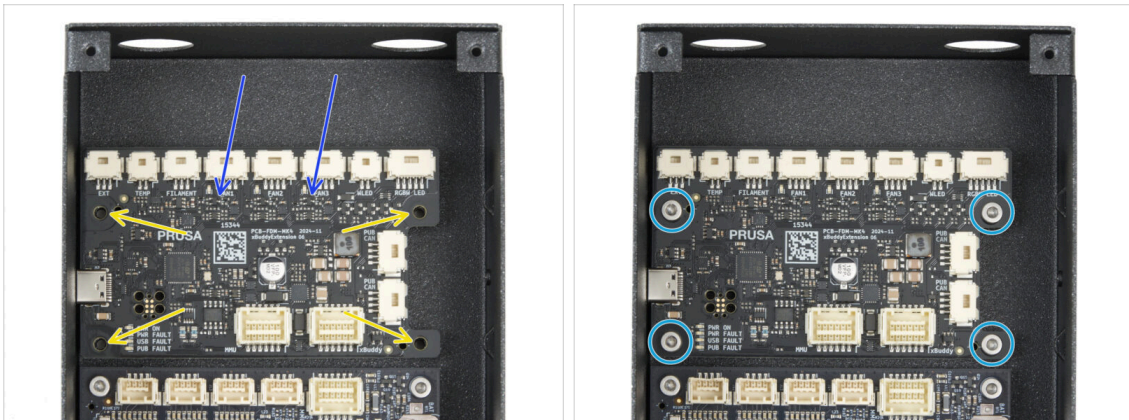


- 🔵 Insert the xBuddy extension board to the xBuddy box above the xBuddy board. Notice the part orientation.
- 🟡 Before fully attaching it completely, center the holes in the board with the holes (columns) in the xBuddy box.
- 🔵 Fix the position of the xBuddy extension board by inserting four M3x6 screws. Tighten them completely.

SCHRITT 11 Installieren der Kabelbinder

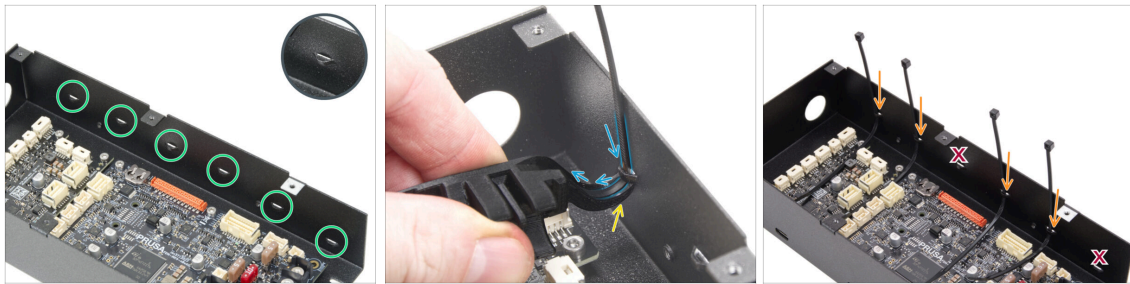

- Take a closer look at to the xBuddy box. There are six perforations on the metal case.
- ⚠ Proceed very carefully. Be careful not to damage the connectors or capacitors on the xBuddy board.**
- Attach the hook on the Assembly-multi-tool below the first perforation on the left.
 - i** Bend the tip of the zip tie slightly, approx. 30 degrees. It will be easier to insert correctly even without the Assembly-multi-tool.
- Push the zip tie through the perforation and into the Assembly-multi-tool. It will guide the zip tie into the electronics box.
- ⚠ Note the correct orientation of the zip tie. The teeth on the zip tie must be on the visible side.**
- Repeat the process at the indicated perforations.
- Skip the third and sixth perforations.

SCHRITT 12 Connecting the xBuddy extension board

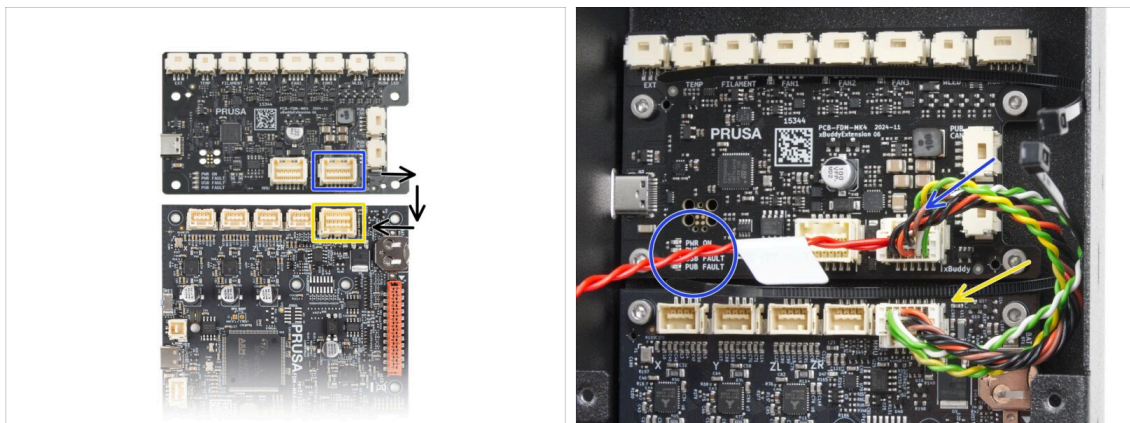

- Plug the xBuddy extension connector with the free red cable to the xBuddy extension board.
- Leave the red cable free for now.
- Plug the other end of the xBuddy extension cable to the xBuddy board.

SCHRITT 13 Inserting grommets: xBuddy box




- Insert both grommets into both circle holes in the xBuddy box.
- Gently compress the grommet and fit it into the metal sheet, ensuring the groove locks into place

SCHRITT 14 WiFi: Vorbereitung der Teile




- For the following steps, please prepare:**
- ESP-WiFi (1x) *found in the Electronics package*
- CORE-One-Wifi-cover (1x) *found in the Printed parts package*
- Schraube M3x12 (1x)
- Schraube M3x6 (2x)

SCHRITT 15 Zusammenbau des Wi-Fi

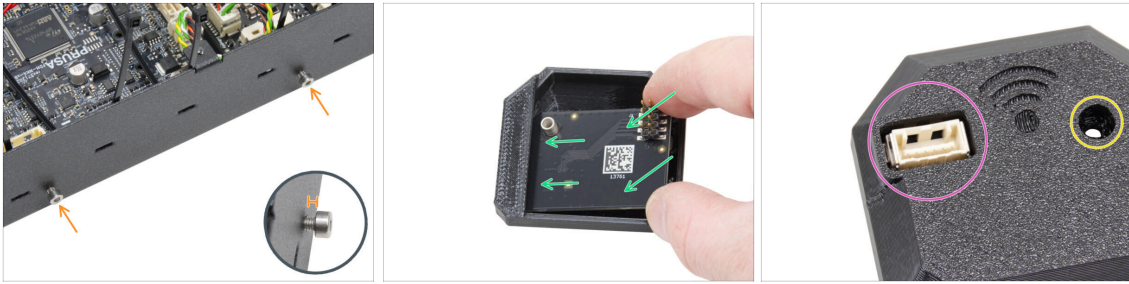


- ✚ Insert two M3x6 screw to the xBuddy box assembly from the right side. **Do not tighten them completely.** Leave at least a 4 mm (0.16 in) gap.
- ✚ Insert the ESP-WiFi module into the WiFi-cover, positioning it just below the bridge on the left side.
- ✚ On the other side, ensure the connector fits correctly into the hole in the cover.
- ✚ Insert the M3x12 screw into this opening in the xBuddy box assembly. If it is too tight, use an Allen key/screwdriver to carefully widen it so the screw fits snugly in the next step.

SCHRITT 16 Installing the Wi-Fi assembly

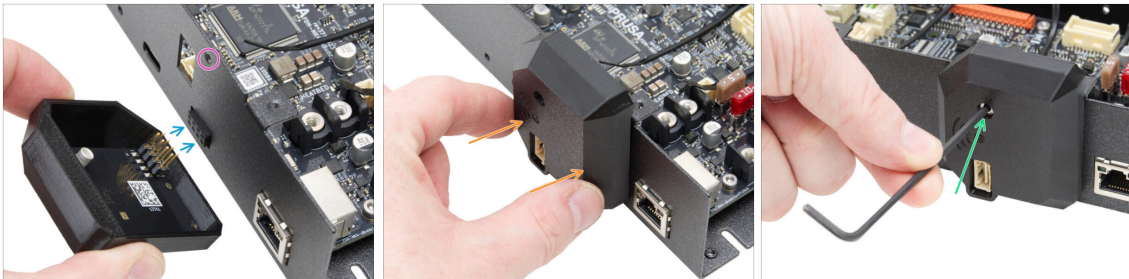

- ⚠ **Be very careful when handling and connecting the ESP module to avoid bending and damaging the pins.**
- ✚ First, insert the M3x12 screw into the opening in the xBuddy box and screw it in to ensure that there will be no issues later on in this step. Then remove the screw.
- ✚ Then, take the WiFi cover assembly and connect the ESP module pins to the connector in the xBuddy.
- ✚ Attach the WiFi cover carefully, ensuring the pins of the ESP module are properly engaged in the connector on the xBuddy.
- ✚ Secure the cover with the M3x12 screw.
- ⬛ Put the assembly aside for a while.

SCHRITT 17 Back panel: parts preparation

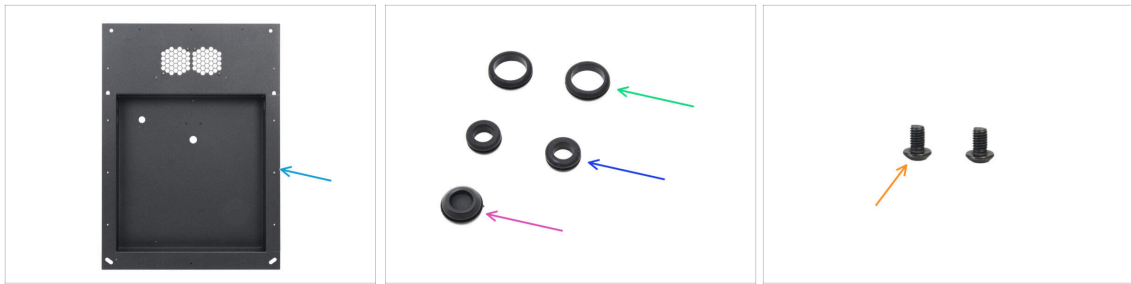

● **For the following steps, please prepare:**


- Back panel (1x) *found in the Metal parts 1/3 package*
- Grommet 19/16 mm (2x) *large one - found in the Electronics & Fasteners package*
- Grommet 13.5/10 mm (2x) *small one - found in the Electronics & Fasteners package*
- Sealing plug 15.5 mm (1x) *found in the Electronics & Fasteners package*
- Schraube M3x4rT (2x)

SCHRITT 18 Installing grommets: back panel top




- Position the back panel as shown in the first image. Use the two oval holes as a reference.
- Insert the sealing plug into the center hole.
 - **The sealing plug is not symmetrical.** Insert the side with the smaller diameter facing downward.
- Insert one small grommet to the left circle hole.
- Insert one small grommet into the oval hole.

SCHRITT 19 Installing grommets: sides + bottom

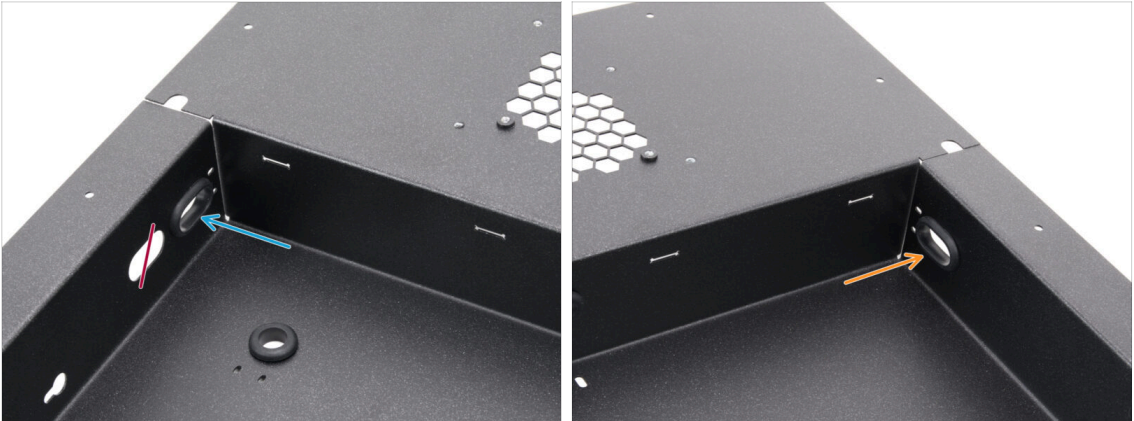


- Focus on the left top side of the back panel and locate two oval holes.
- Insert one large grommet into the oval hole closest to the corner.
- Move to the right top side of the back panel and insert one large grommet to the oval hole.

SCHRITT 20 Ausrichten des Netzteils

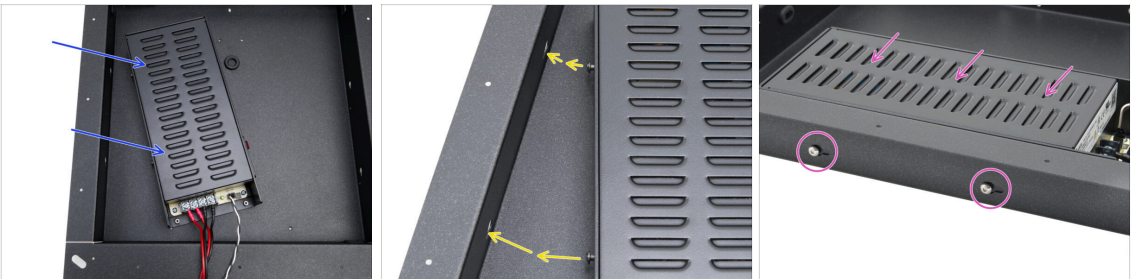


- Carefully insert the PSU into the rear panel pocket.
- Align the screws on the PSU to the holes on the left side of the back panel.
- Slide the PSU so that the screws go through the holes.
- ❗ Do not insert the PSU cables into any opening in the rear panel. Leave them hanging over the rear panel until you are instructed to connect them to the Buddy board later on.

SCHRITT 21 Montieren des Netzteils

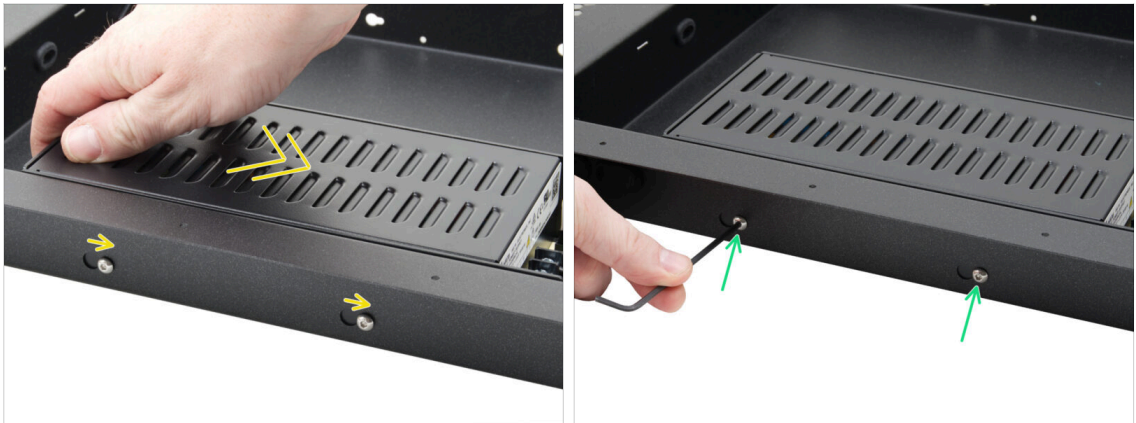


- Gently slide the PSU so that the position of the screws moves to the end position of the keyhole-shaped holes.
- Maintain the PSU position and fully tighten both screws.

SCHRITT 22 Aligning the xBuddy box assembly

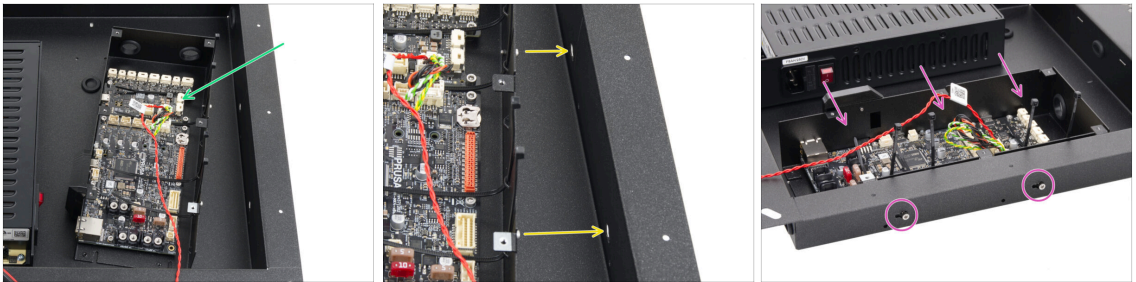


- Carefully insert the xBuddy box assembly into the rear panel pocket.
- Align the screws on the xBuddy box to the holes on the right side of the back panel.
- Slide the xBuddy box so that the screws go through the holes.

SCHRITT 23 Mounting the xBuddy box

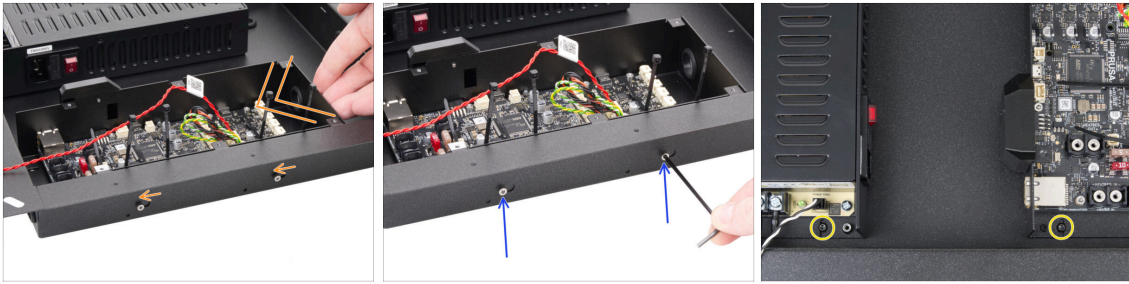


- 🟠 Gently slide the xBuddy box assembly so that the position of the screws moves to the end position of the keyhole-shaped holes.
- 🔵 Maintain the xBuddy box position and fully tighten both screws.
- 🟡 Fix the PSU and xBuddy box assembly to the back panel by tightening two M3x4rT screws.

SCHRITT 24 Power cables cover: parts preparation

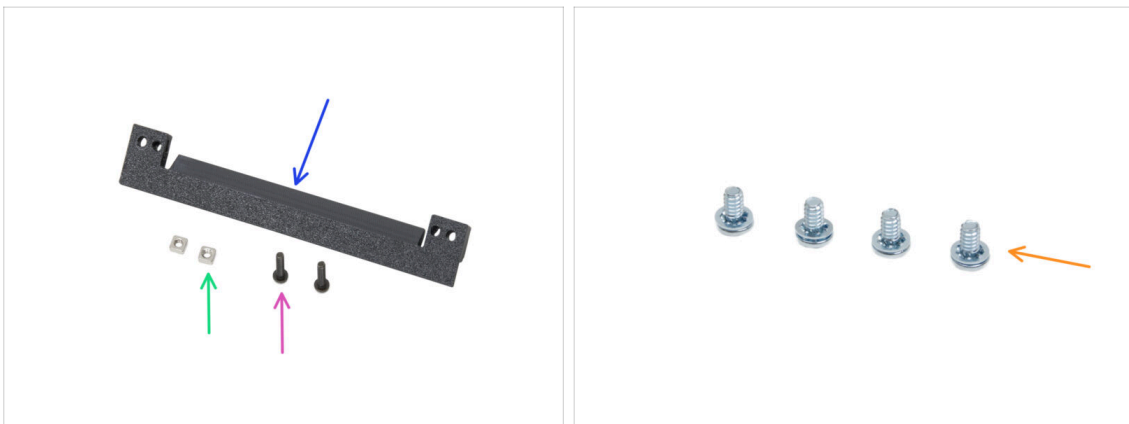


- ⬛ **For the following steps, please prepare:**
- 🔵 PSU-cable-cover (1x) *found in the Printed parts package*
- 🟢 M3nS Mutter (2x)
- 🟡 Schraube M3x10rT (2x)
- 🟠 6-32 Power Terminal Screw (4x)

SCHRITT 25 Connecting the power cables

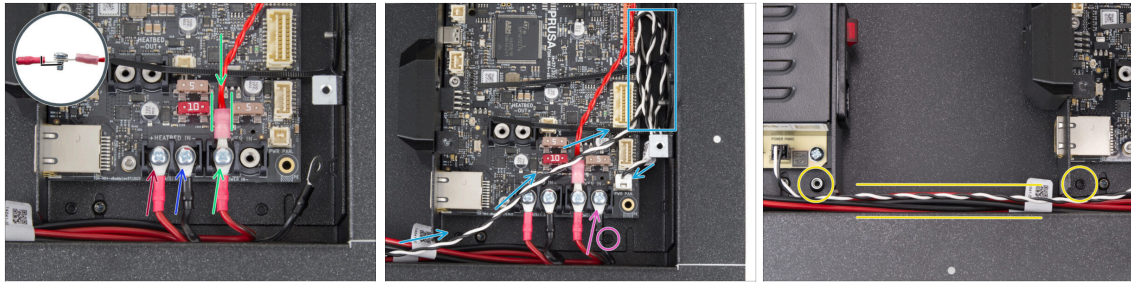


- ◆ Take one red cable leading from the PSU and connect it to the first left terminal slot on the xBuddy board using the 6/32" terminal screw. Tighten it firmly but gently.
 - ⚠ **Note that the "L" shape of the cable connector must always "undercut" the head of the terminal screw.**
- ◆ Connect the black PSU cable from the same pair as the red one to the second terminal using the 6/32" terminal screw. Tighten the screws firmly.
- ◆ Take the second red cable from the PSU and attach it to the red cable leading from the extension board. **Note the detail.** Secure these two cables with the terminal screw in the third terminal slot.
 - ◆ Guide the xBuddy extension cable carefully between the fuses, ensuring it is positioned securely without pressing against them.
- (i) **Note that from early 2025, the fuses are different.** Significantly smaller, white, and embedded in the fuse slot in the xBuddy board, so as not to obstruct the cables.
- ◆ Connect the second black PSU cable to the xBuddy, **ensuring it does not obstruct the threaded hole.**
- ◆ Route the power panic cable to the xBuddy box and connect it to the bottom right slot on the xBuddy board. Make several loops from the excess cable above the slot.
- ◆ Arrange the PSU cables as shown, ensuring that no obstructions are around the threaded holes in the PSU and xBuddy box.

SCHRITT 26 Vorbereiten der PSU-cable-cover

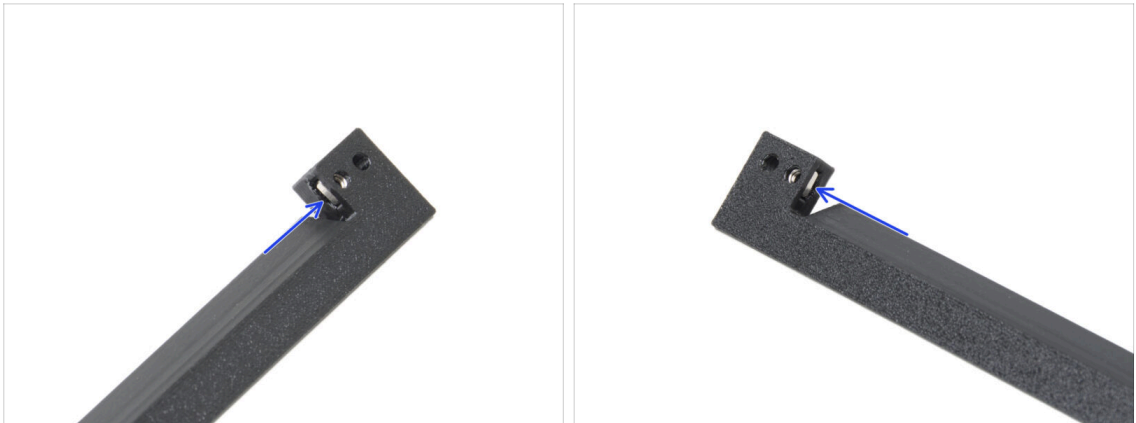


- Insert one M3nS nut into the hole on each end of the PSU-cable-cover.
- Ensure the holes are aligned.

SCHRITT 27 Covering the PSU cables

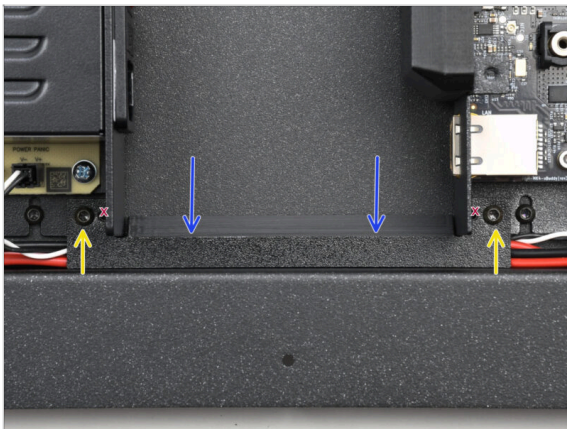

- Attach the PSU-cable-cover on the PSU cables.
- Secure the cover with two M3x10rT screws in the outermost holes of the part.

SCHRITT 28 Chamber fans: parts preparation

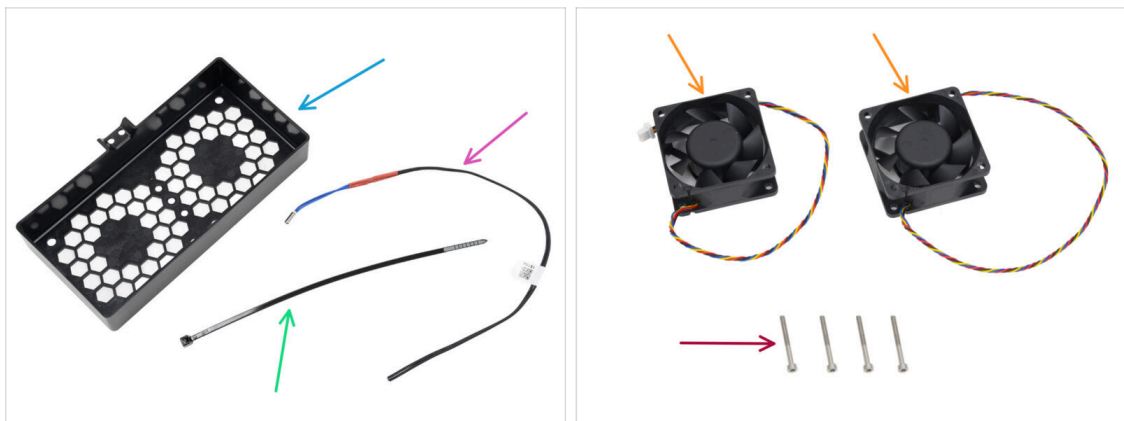

For the following steps, please prepare:

- Lüfterabdeckung (1x) *findet sich im Electronics & Chamber parts Paket*
- Chamber thermistor 260 mm (1x) *found in the Electronics & Chamber parts package*
- Kabelbinder (1x)
- Cooling fan (2x) *found in the Electronics & Chamber parts package*
- Schraube M3x30 (4x)

SCHRITT 29 Assembling the fan grid





- Führen Sie das Thermistorkabel durch die Öffnungen in der Mitte der Lüfterabdeckung. Führen Sie es in der auf dem Bild gezeigten Richtung ein.

i Achten Sie beim Zusammenbau besonders auf die Ausrichtung. Die Lüfterabdeckung hat eine bestimmte Innen- und Außenseite.

- Leave the whole thermistor part sticking out.
- Führen Sie den Kabelbinder durch die beiden Löcher am Hals der Lüfterabdeckung.
- Route the thermistor cable in between the zip tie parts.
- Carefully secure the thermistor cable by tightening the zip tie. **Do not use excessive force and do not overtighten the zip tie!** It may damage the cable.



⚠ Stellen Sie sicher, dass sich die Sperrklinke des Kabelbinders auf der Innenseite des Halses des Lüftergehäuses befindet.

SCHRITT 30 Anbringen der Lüfter

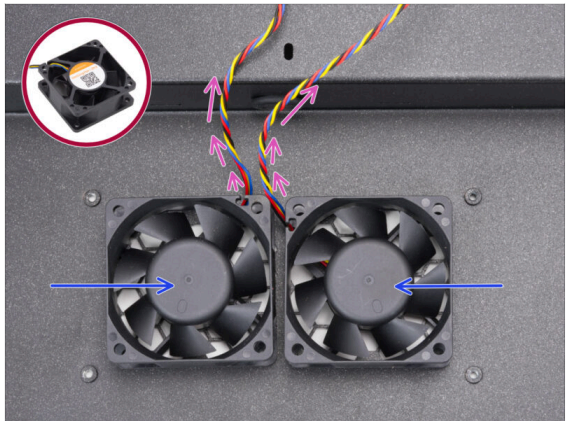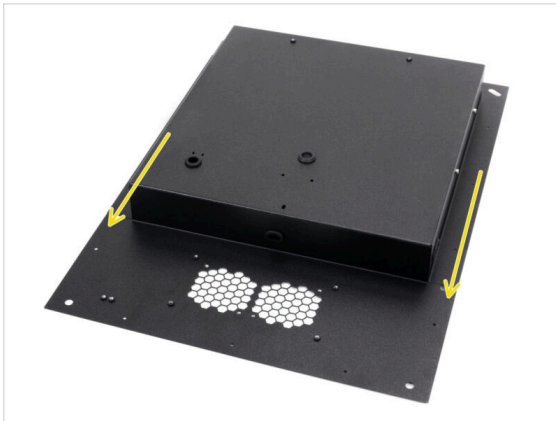

- ✦ Place and orient the back panel according to the picture. The grid cutouts must be facing you.
- ✦ Place both fans to the grid in the back panel.
 - ⚠ **The side of the fan without the sticker must be facing up.**
 - ✦ Orient the fans so that the cables run from the corners in the centre.
 - ⬛ Let the cables hang freely for now, ensuring they are not pinched during handling.

SCHRITT 31 Covering the cooling fans

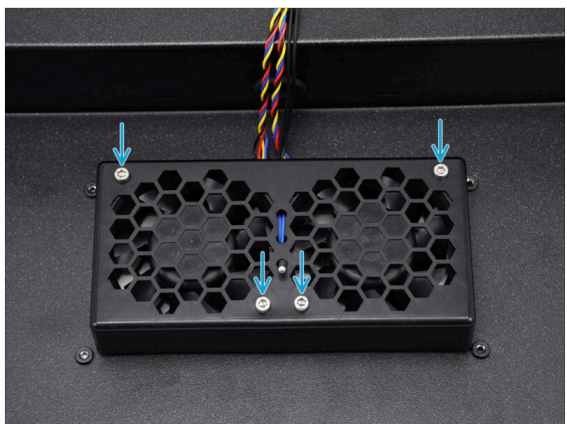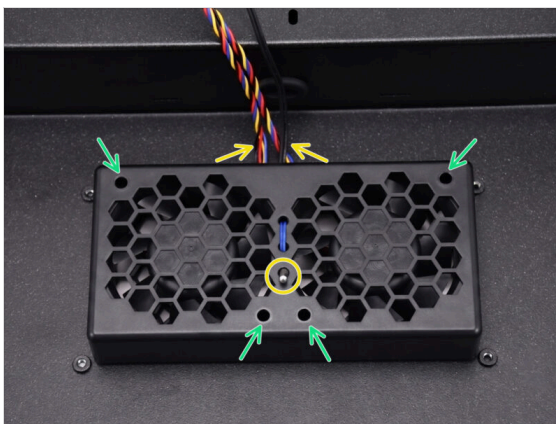

- ✦ Setzen Sie die Lüfterabdeckung auf die Lüfter auf.
 - ⚠ **Stellen Sie sicher, dass die Lüfterabdeckung die Lüfter vollständig umschließt und der Thermistor nach oben zeigt und dass dessen Kabel unter dem Hals der Lüfterabdeckung verläuft.**
- ✦ Richten Sie die Löcher in den Lüftern, der Lüfterabdeckung und der Rückwand aus.
- ✦ Secure the fan assembly to the back panel with four M3x30 screws.
 - ⚠ **Do not overtighten the screws to avoid damaging the grid.**

SCHRITT 32 Rear profiles: parts preparation



For the following steps, please prepare:

Rear profile (2x) found in the Metal parts 1/3 package

i Take two of the longer ones.

Note that the other two longer ones differ by having cutouts.

Nylon-Niete (11x)

Schraube M3x4rT (4x)

2.9x6.5sT self-tapping screw (1x) from the Electronics and Fasteners Package

SCHRITT 33 Installing the rear profiles



Take the bottom assembly and turn it so the rear side (with one motor in the center) faces you.



Focus on the right rear corner—the side with the longest oval opening in the bottom panel.


Attach the rear profile to the right corner, using the **end without flanges**.

Align the hole on the rear side and secure it with the M3x4rT screw.

Secure the corner on the other side with a second M3x4rT screw - each corner will be secured with two M3x4rT screws.

Proceed the same with the second rear profile on the rear left corner.


SCHRITT 34 Mounting the back panel

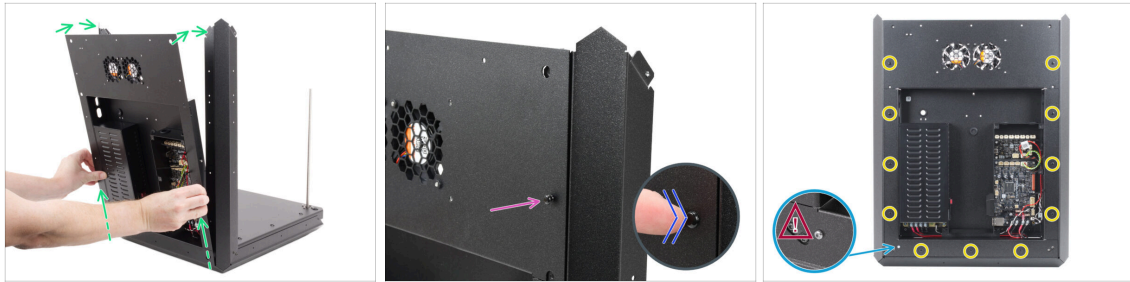

- ◆ Slightly lift the back assembly and gently place it on the base assembly and rear profiles.
- ◆ Insert one nylon rivet through the rear panel and rear profile on the top right side.
- ◆ Push the rivet head with your finger until it is fully seated.
- ◆ Use this procedure for all eleven nylon rivets around the back panel assembly to secure it in place.
- ◆ Insert and tighten the 2.9x6.5 self-tapping screw into the back panel.

⚠ **Do not use excessive force when tightening this screw!** If you encounter resistance, use a 2mm drill to pre-drill the hole. Or leave the screw not completely tightened.

SCHRITT 35 Stepper splitter: parts preparation

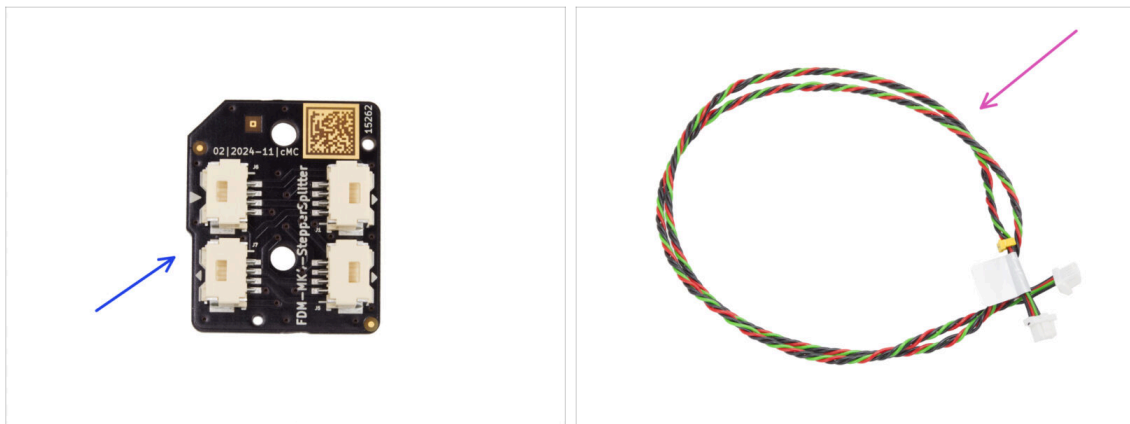


- ◆ **For the following steps, please prepare:**
- ◆ Stepper splitter (1x) *found in the Electronics & Chamber parts package*
- ◆ Stepper splitter cable (1x) *found in the Electronics & Fasteners package*

SCHRITT 36 Guiding the Stepper splitter cable



- ✿ Very carefully turn the assembly on its back (back panel).
- ⬛ **It is recommended to support the rear of the assembly** with a soft, raised pad to prevent it from resting on the protruding Wi-Fi module.
- ⓘ Tip: Use the foam padding from the sheet metal parts package or an empty cardboard box.
- ✿ Guide the Stepper splitter cable through the three zip ties on the left side.
- ⬛ For now, leave the side with the label hanging freely outside.
- ⬛ Guide the Z-axis motor R cable through the three zip ties on the left side.
- ⚠ **Do not tighten the zip ties at this moment.**


SCHRITT 37 Connecting the Stepper splitter

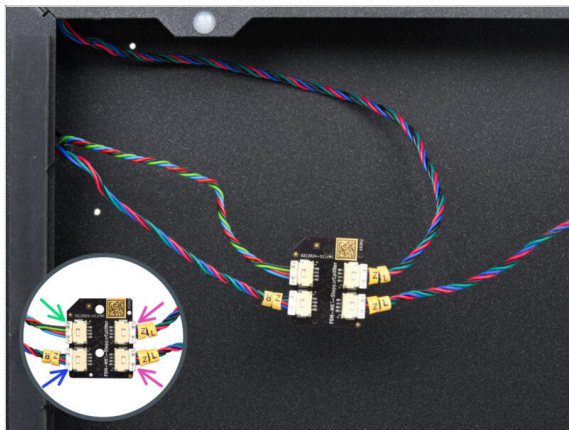

- ⬛ **Connect the Z motor cables to the stepper splitter:**


- ✿ Stepper-Splitterkabel
- ⬛ Z-Achse Motor R
- ✿ Z-Achse Motor L
- ✿ Z-Achse Motor L

SCHRITT 38 Mounting the Stepper Splitter

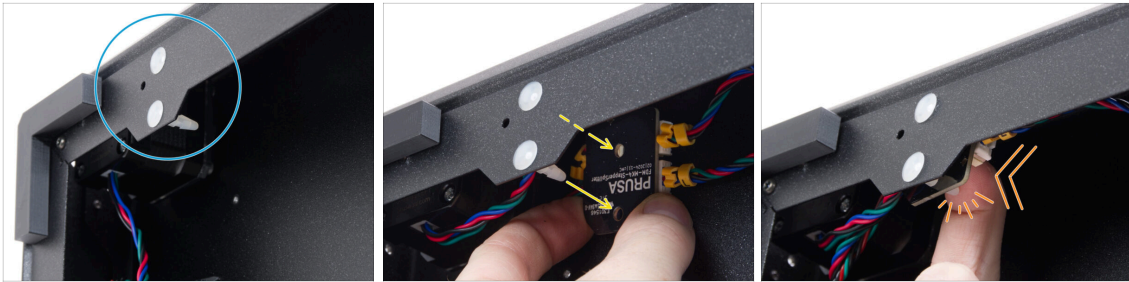

- 🔵 Locate two spacer pins in the bottom frame.
- 🟡 From the inside of the frame, prepare the Stepper splitter and attach its holes opposite the pins.
- ⬛ Check the correct orientation of the part by the logo on the board. **The logo is upside down.**
- 🟠 Push the aligned Stepper Splitter onto the pins until you feel a click - this secures the Stepper Splitter. Push in the center of the board.
- 📄 ⓘ It is necessary to apply a significant pressure to seat the part in. Yet, be very careful not to damage the components.

SCHRITT 39 LCD cable: parts preparation

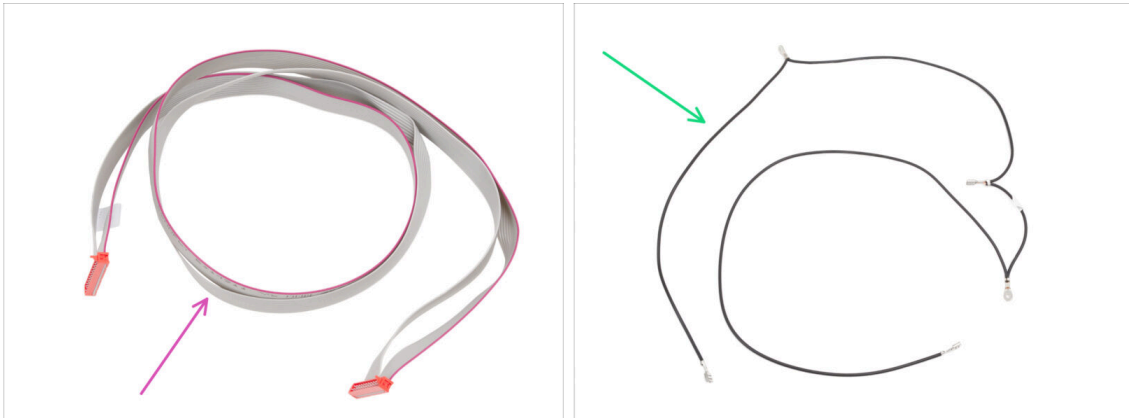


- ⬛ **For the following steps, please prepare:**
- 🟡 xLCD cable (1x) *found in the Electronics & Fasteners package*
- 🟢 Main FE cable (1x) *found in the Electronics & Fasteners package*

SCHRITT 40 Guiding the LCD cable




- Guide the Stepper splitter cable through the oval hole to the electronics.
- Take the end of the xLCD cable with the QR code label.
- Push a few centimeters of the xLCD cable (the end with the QR code label) through the oval hole in the bottom panel.
- ⓘ The cable must be slightly folded to pass through the hole.
- Guide the xLCD cable through the zip ties on the left side of the frame.
- Guide the xLCD cable through the rectangular opening in the front profile. Keep protruding approximately 6 cm (2.36 in).
- Leave the cable hang freely for now.

SCHRITT 41 Main FE cable INFO

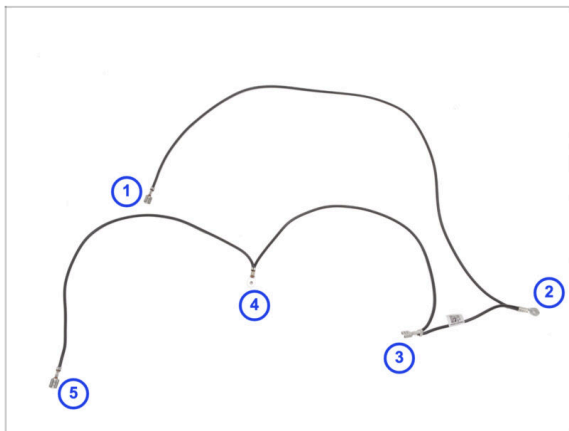

- Lay out the Main FE cable as shown in the picture, ensuring each connector is positioned accordingly.
- The connectors are numbered in the picture for reference only. This numbering will be used in the following steps to help with proper connections.
- ⓘ Note: We will always indicate which connector to use in the following steps. However, it's a good idea to remember this overview for easier assembly.

SCHRITT 42 Connecting the FE cable (no 3.)

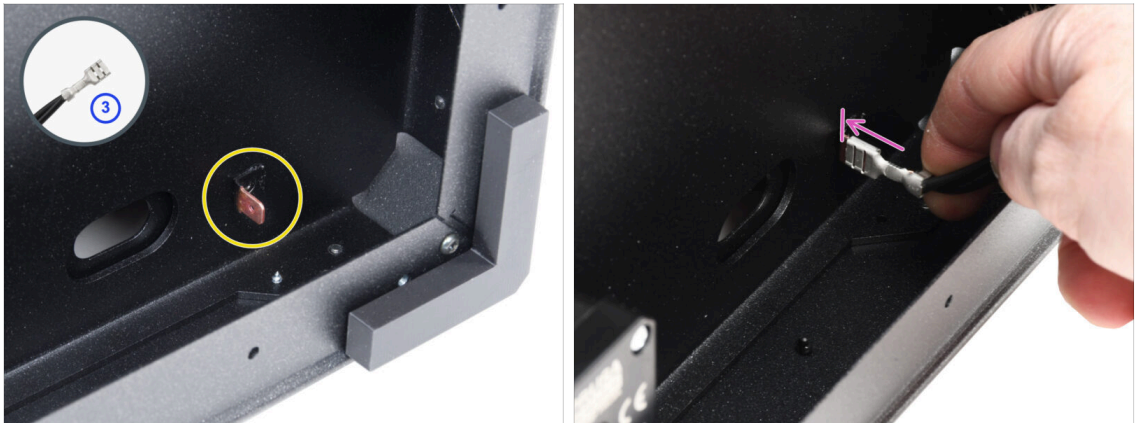


- Prepare the connector number 3.
 - ⓘ That's the female faston connector in the middle of the cable.
- Locate the male Faston connector in the bottom right corner.
- Slide the FE cable connector completely onto the Faston connector.

SCHRITT 43 Guiding the FE cable (no. 2)




- Take the FE cable connector number 2.
 - ⓘ The round connector nearby.
- Insert the connector loosely into the hole in the bottom panel.

SCHRITT 44 Guiding the FE cable (no. 1)

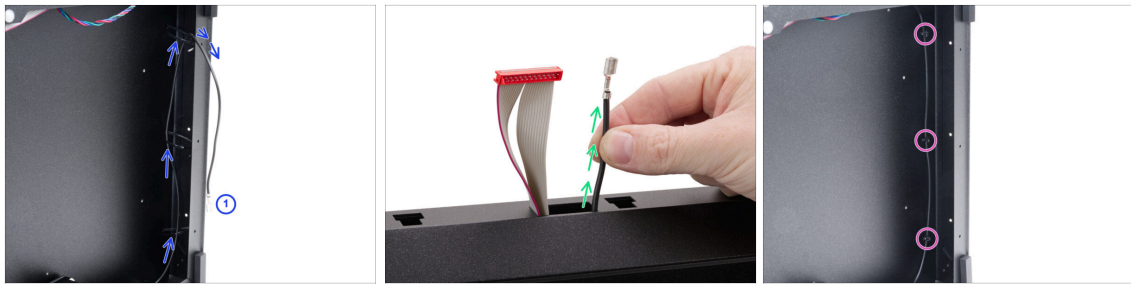


- Take the connector number 1 and guide it through the zip ties on the right side of the frame.
- ❗ That is the long part with just one faston connector at the end.
- Push the connector through the rectangular opening in the front profile. Keep protruding approximately 6 cm (2.36 in).
- Leave the cable hang freely for now.
- Tighten all three zip ties. Cut off the excess.

SCHRITT 45 Guiding the FE cable (no. 4 and 5)

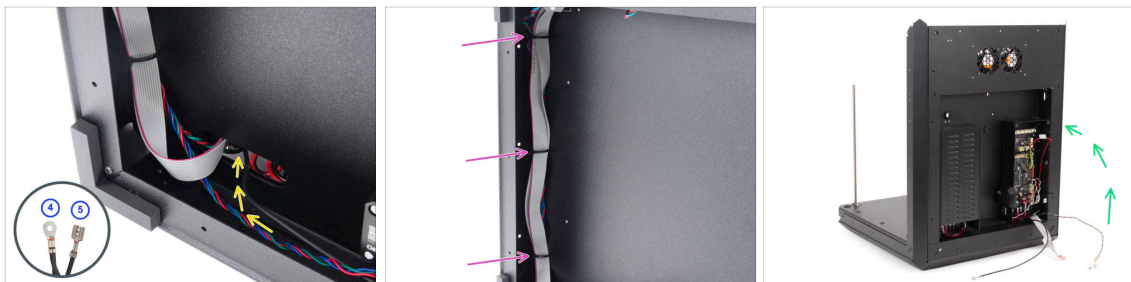

- Take the FE cable connectors number 4 and 5.
- Push both connectors through the leftmost hole in the bottom. Leave them free for now.
- Tighten all three zip ties on the left side of the frame. Cut off the excess.
- There's no need to fully tighten the zip ties. However, the cables must still be easy to move for any necessary length adjustment during connection.
- Carefully turn the printer back on its feet. Focus on the back side.

SCHRITT 46 FE cable - xBuddy: parts preparation

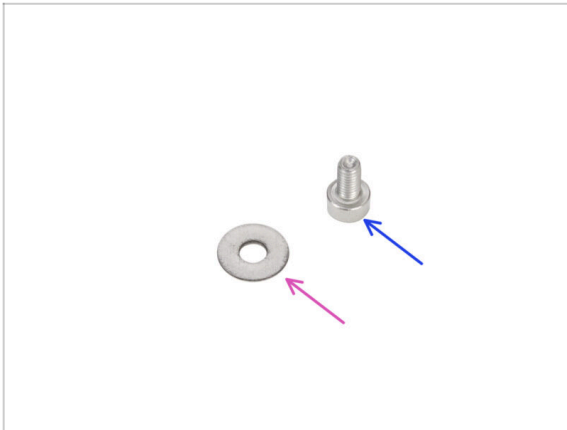

● For the following steps, please prepare:

● M3w Unterlegscheibe (1x)

● Schraube M3x6 (1x)

SCHRITT 47 Connecting the FE cable: xBuddy




- Take the connector number 4 and connect it to the xBuddy using the M3x6 screw and M3w washer.

⚠ The M3 washer must be between the screw head and the connector.


- Guide the FE cable (number 5) alongside the xBuddy box and pass it through the right-side holes out of the box.
- Guide the Stepper splitter cable alongside the xBuddy box and connect it to the second slot from the right in the top row on the xBuddy board (labeled ZR).

SCHRITT 48 Plugging the xLCD cable

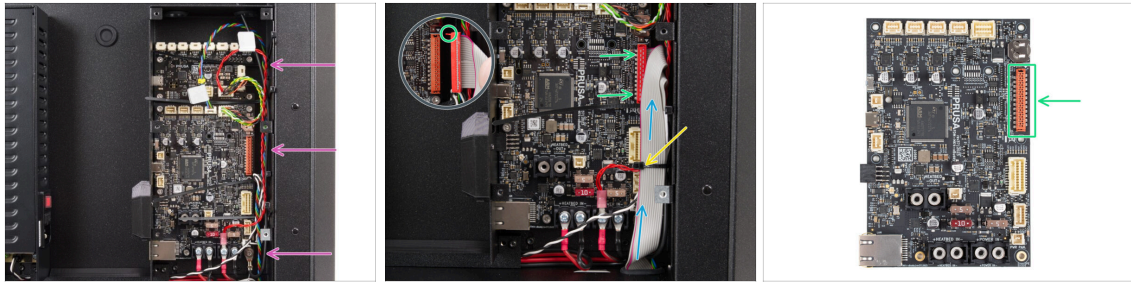

- ◆ Arrange the cables as shown - route all cables along the right side of the xBuddy box.
- ⚠ Make sure all the cables guide through the zip ties in the xBuddy box, not under them.
- ◆ Place the xLCD cable over the other cables and route it upwards.
- ◆ Connect the xLCD to the slot on the right side of the xBuddy. **Note the safety latch on the xLCD cable connector. The latch must fit into the upper side of the connector.**
- ◆ Secure the cable arrangement by tightening the bottom zip tie. **Do not tighten the three remaining zip ties!**
- ⚠ **Do not overtighten the zip tie, as it may damage the wires.**
- ◆ Carefully cut off the excess length of the zip tie. **Avoid cutting cables!**

SCHRITT 49 PSU-cover: Vorbereitung der Teile

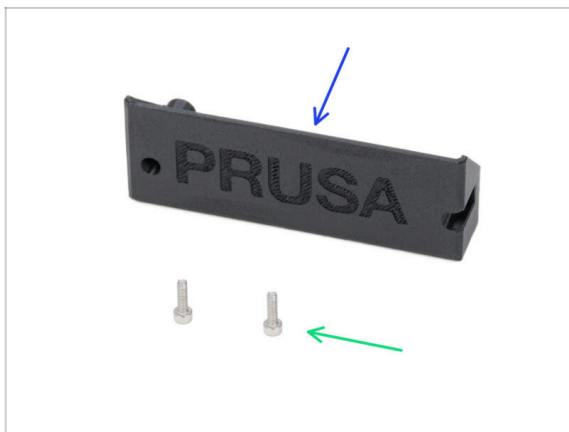


- ◆ For the following steps, please prepare:
- ◆ CORE-One-PSU-cover (1x) found in the Printed parts package
- ◆ Schraube M3x10 (2x)

SCHRITT 50 Connecting the FE cable: PSU



- Remove the screw from the PSU board. **Do not discard it!**
- Ensure the FE connector (number 2) is routed into the PSU compartment.
- Insert the removed screw through the FE cable connector and screw it back to the PSU board.
- Note the correct orientation of the connector.
- Rotate the connector counter-clockwise, positioning it so it doesn't block the threaded hole underneath.
- Attach the PSU-cover over the PSU connectors and secure with two M3x10 screws.

SCHRITT 51 Haribo Zeit!

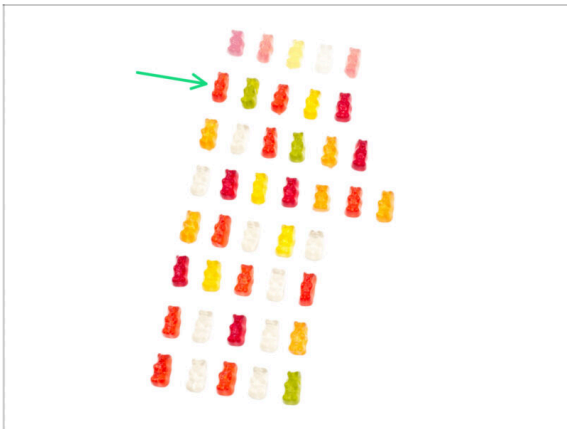

- Time to recharge for the next chapter!
- Eat the second row.
- ⚠ **No cheating**—eat only the number shown!

SCHRITT 52 Abgeschlossen




- Congratulations! The back assembly is installed.
- Now continue to the next chapter.

4. Zusammenbau des Heizbetts




SCHRITT 1 Tools necessary for this chapter

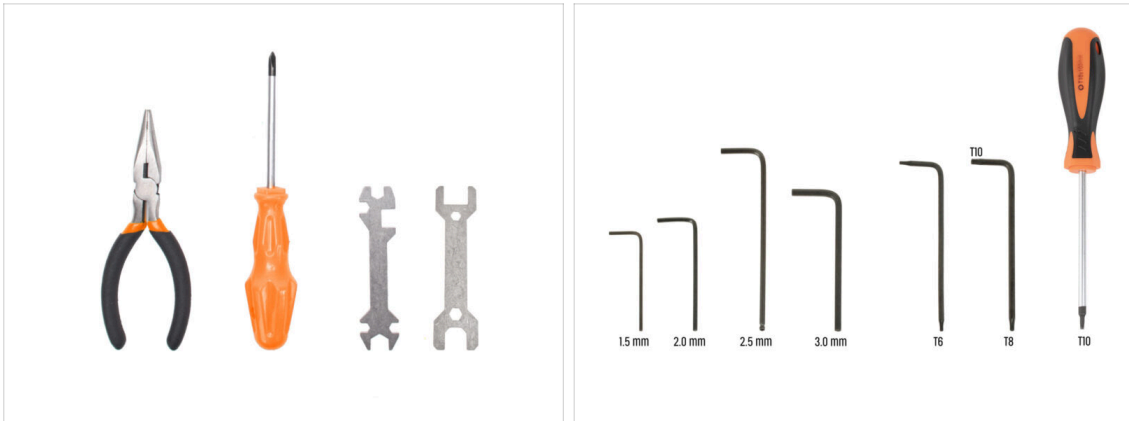

● **For this chapter, please prepare:**

- Spitzzange
- Universal-Schlüssel
- Schraubenschlüssel 13-16
- Phillips Schraubendreher PH2
- 2,5mm Innensechskantschlüssel
- 2,0 mm Innensechskantschlüssel
- T10 torx key / T10 torx screwdriver


SCHRITT 2 Heizbett: Teilevorbereitung

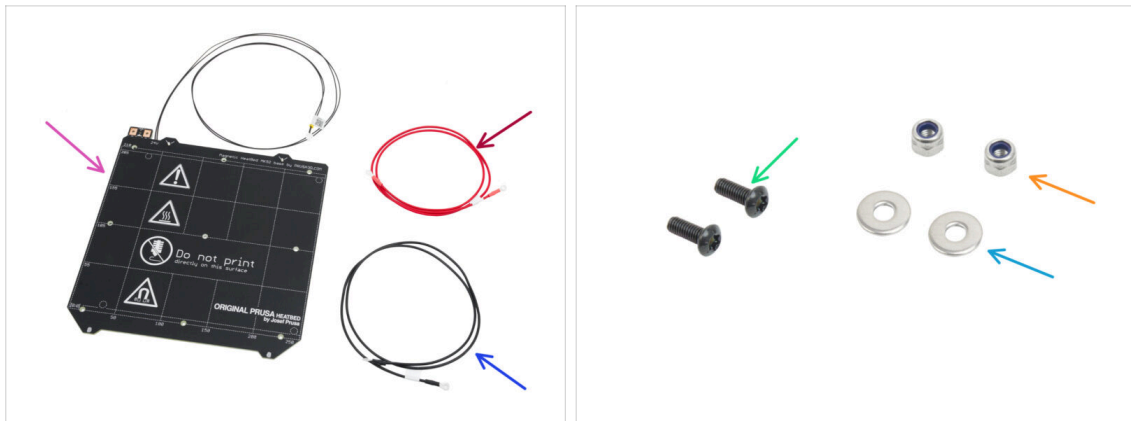

For the following step please prepare:


- Heatbed MK52 24V (1x) found in the CoreXY parts + Hinges set package
- Heatbed cable red (1x) found in the Electronics & Fasteners package
- Heatbed cable black (1x) found in the Electronics & Fasteners package
- Schraube M3x10rT (2x)
- M3nN Mutter (2x)
- M3w Unterlegscheibe (2x)

SCHRITT 3 Heatbed cable assembly (part 1)

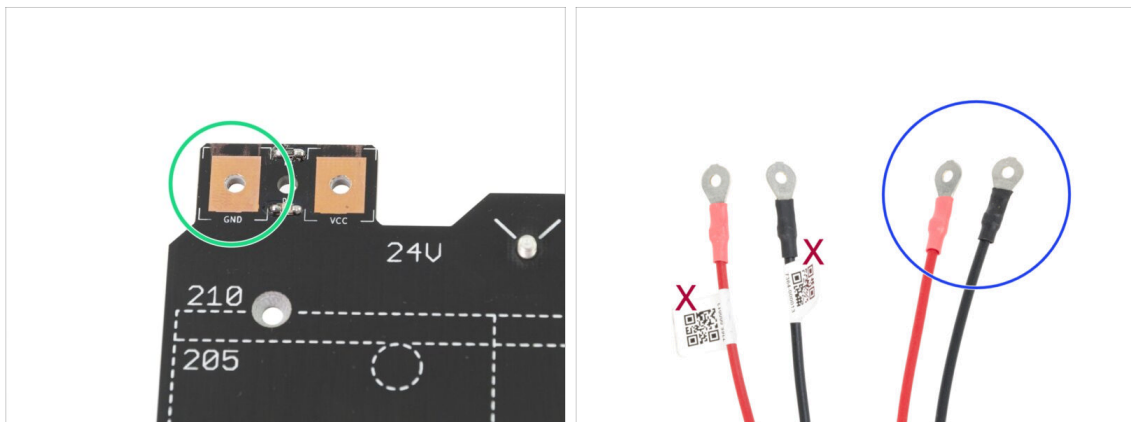


- IT IS IMPORTANT** to connect the power cable correctly. Before you start the assembly have a look at the pins. The one on the left with "GND" sign must be connected to the **BLACK WIRE**.
- Take both Heatbed cables. Note the label on each cable. For the following steps, prepare the ends of the cables **without the label**.

SCHRITT 4 Heatbed cable assembly (part 2)

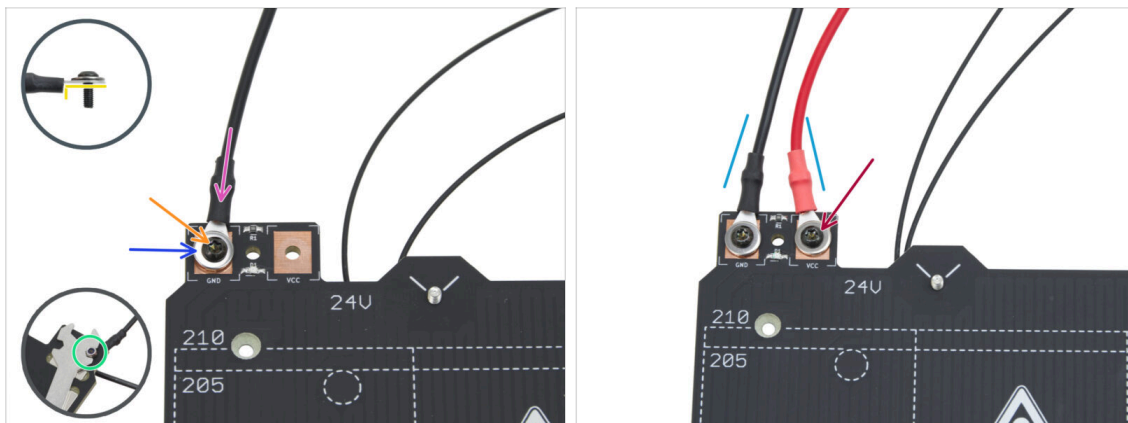


- ✿ Place the black wire above the pin with "GND" sign. **Use the end of the cable that is not labeled with QR code.** The QR code must be at the other end.
- ✿ Note the correct position of the cable terminal lug on the detail.
- ✿ Place the M3w washer above the round cable connector.
- ✿ Push the M3x10rT screw through all parts.
- ✿ Hold the screw and carefully turn the heatbed upside down.
- ✿ Attach the M3nN nut onto the M3x10rT screw and tighten it slightly.
- ✿ Using the same procedure, attach the red cable to the pin labeled "VCC" on the heatbed.
- ✿ Guide the cables from the heatbed slightly towards each other (in a "V" shape). **Then tighten the nuts firmly from underneath.**

SCHRITT 5 Bed-cable-cover-bottom: Vorbereitung der Teile

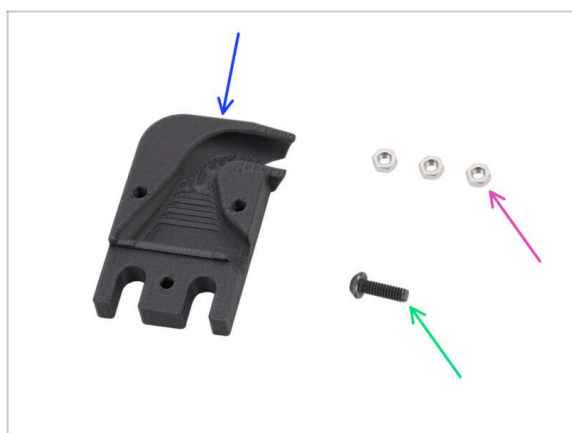

- ✿ **For the following steps, please prepare:**
- ✿ Bed-cable-cover-bottom (1x) *im Paket „Printed parts“ enthalten*
- ✿ M3n Mutter (3x)
- ✿ Schraube M3x10rT (1x)

SCHRITT 6 Attaching the cable cover

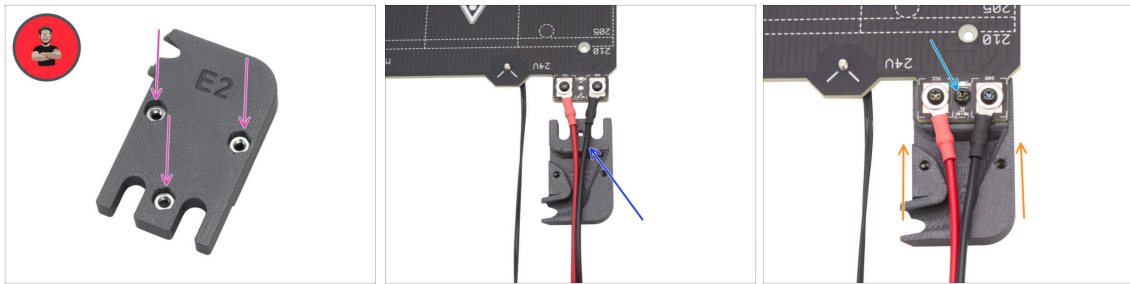


- ✦ Insert three M3n nuts into the Bed-cable-cover-bottom part.
- ❗ Pro tip: Use the screw-pulling technique.
- ⬛ Make sure the nuts are fully inserted and held in place.
- ✦ Insert the Bed-cable-cover-bottom under the heatbed cables. Note the orientation of the part.
- ✦ Slide the Bed-cable-cover-bottom under the cable joint of the heatbed.
- ✦ Line up the hole in the heatbed with the cable cover and secure it with the M3x10rT screw.

SCHRITT 7 Heatbed carriage: parts preparation




- ⬛ **For the following steps, please prepare:**
- ✦ Heatbed carriage (1x) *found in the Metal parts 1/3 package*
- ✦ Expansion joint (8x) *found in the Electronics package*
- ⬛ Ausgleichsverbindung (8x)
- ✦ PTFE washer M3 (16x)

SCHRITT 8 Installing the expansion joint screws

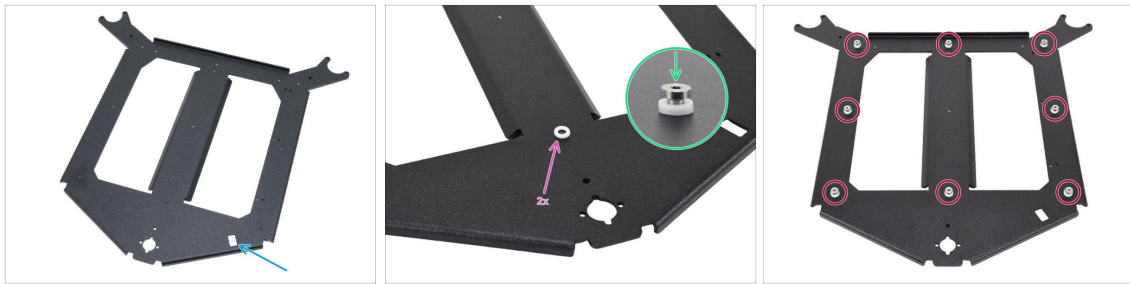


- Place the heatbed carriage in front of you in the same orientation as in the picture.
- Make sure the **rectangular cutout is facing you on the right side**.
- Legen Sie die beiden PTFE-Unterlegscheiben übereinander in die vordere Gewindebohrung des Z-Schlittens ein.
- Führen Sie die Schraube für den Expansion-joint durch die Unterlegscheiben in die Gewindebohrung ein und ziehen Sie die Schraube vollständig fest, ohne sie jedoch zu fest anzuziehen.
- ⓘ A small gap between the washers and the screw head is normal due to the screw's non-threaded section.
- Verfahren Sie bei den übrigen Gewindebohrungen ebenso.

SCHRITT 9 Installing the expansion joints

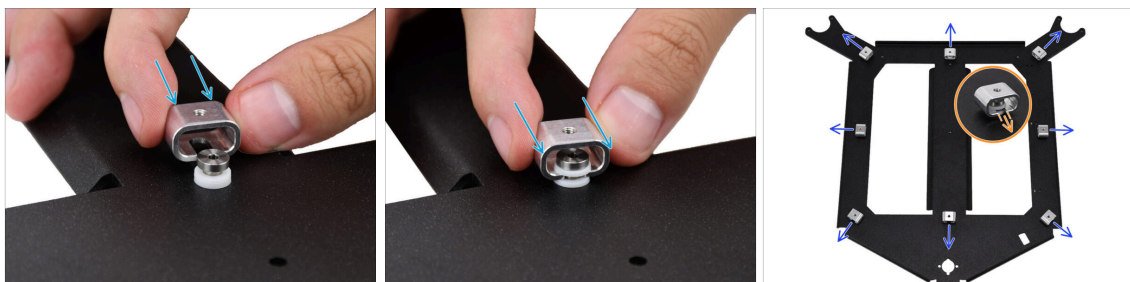

- Schieben Sie den Expansion-joint mit der Nut an der Unterseite auf die Schraube **zwischen** den PTFE-Unterlegscheiben.
- Richten Sie die Expansion-joint so aus, dass die Nut **vom Z-Schlitten weg zeigt**.
- Wiederholen Sie diesen Vorgang für alle übrigen Expansion-Joints.
- ⓘ The final position will be adjusted in the following steps.

SCHRITT 10 RGB LED strip: parts preparation

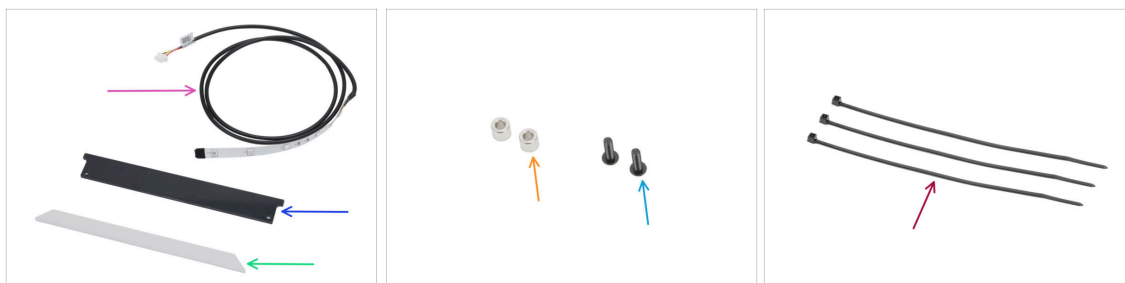

For the following steps, please prepare:


- RGB LED strip 166 mm (1x) *found in the Electronics & Fasteners package*
- ⚠️ **Avoid direct contact with the LED and resistors on the LED strip.**
- LED status cover (1x) *found in the Electronics & Chamber parts package in a bag labeled Others*
- LED strip diffuser (1x) *found in the CoreXY parts + Hinges set package*
- Spacer 3.2/6x5 mm (2x) *found in the Electronics & Fasteners package*
- Schraube M3x10rT (2x)
- Kabelbinder (3x)

SCHRITT 11 Installing the LED strip




- Place the heatbed carriage in front of you in the same orientation as in the picture.
- Make sure the **rectangular cutout is far from you and on the right side**.
- Carefully peel off the protective (paper) layer from the RGB LED strip.
- ⚠️ **After removing the protective layer, the RGB LED strip is adhesive.**
- Stick the RGB LED strip evenly to the front of the heatbed carriage, approximately 3 mm (0.12 in) from the folded edge.
Align the middle LED with the screw on the carriage.
- The RGB LED strip **must point to the right**.
- After sticking, press lightly on the blank areas of the strip to ensure adhesion. **Do not touch LEDs and resistors!**

SCHRITT 12 Attaching the LED strip diffuser

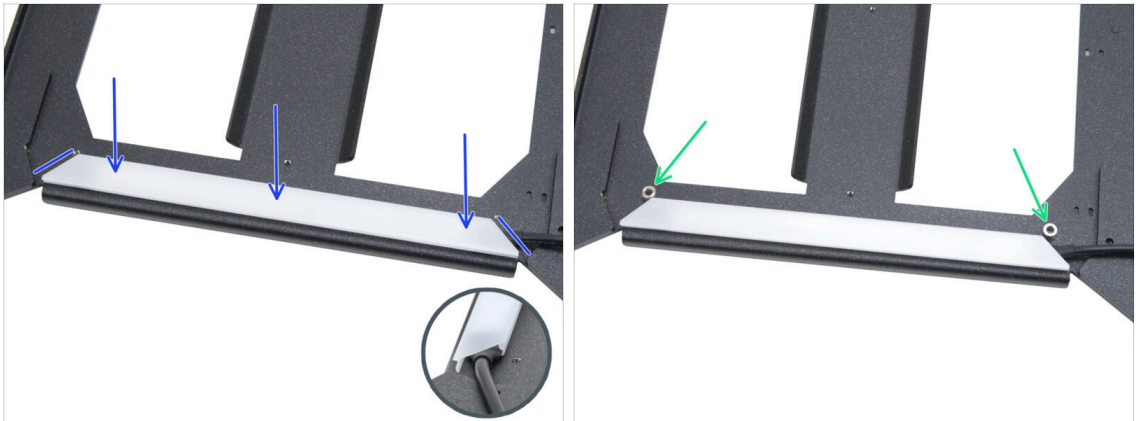


- Place the LED strip diffuser over the RGB LED strip. Note the orientation of the part - according to the beveled edges.
- Place two spacers 3.2/6x5 mm on the holes in the edges of the LED assembly.

SCHRITT 13 Covering the RGB LED strip

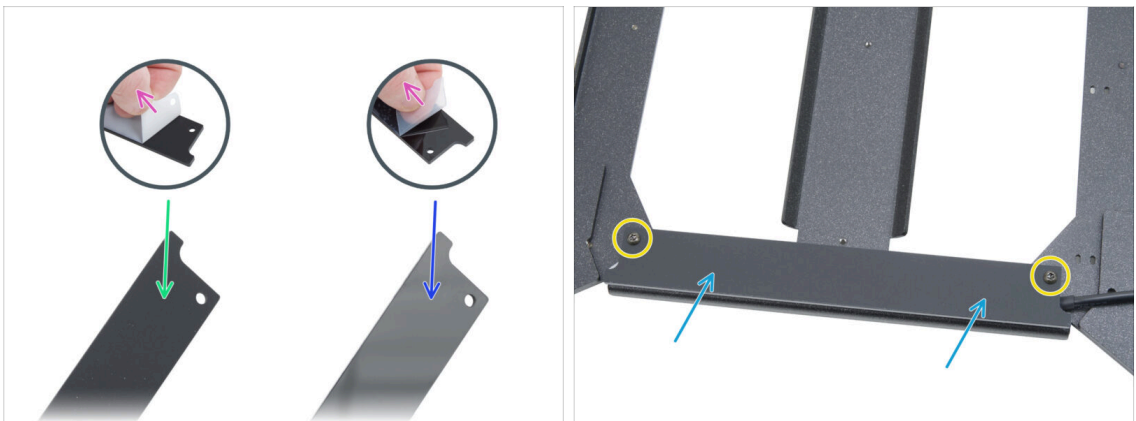


- From both sides of the LED status cover, peel off the protective layers.
- Note that one side of the cover is matte.
- The other side of the cover is glossy.
- Attach the LED strip cover to the assembly, **matte side up**.
- Secure all parts together by inserting and tightening two M3x10rT screws. **Do not overtighten the screws**, as it may crack the cover.

SCHRITT 14 Guiding the RGB LED strip cable

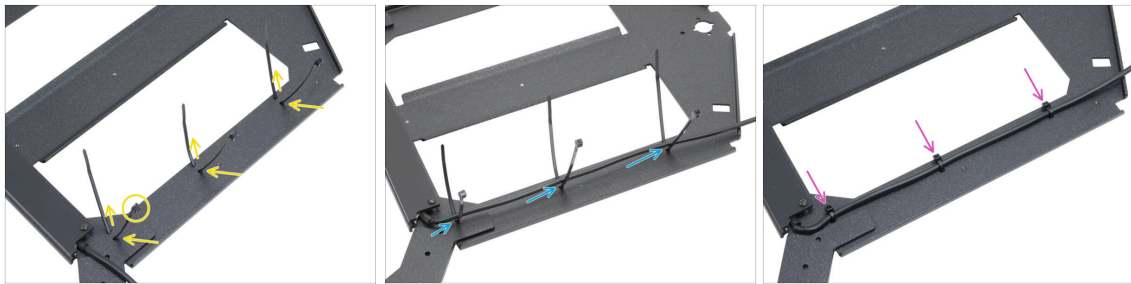

- ✦ Thread the three zip ties along the **RIGHT SIDE** of the heatbed carriage. Make sure the zip tie heads are facing outward.
- ✦ Guide the RGB LED strip cable through all zip ties.
- ✦ Then tighten all three zip ties. Cut off excess zip ties.

SCHRITT 15 Bed mounts: parts preparation

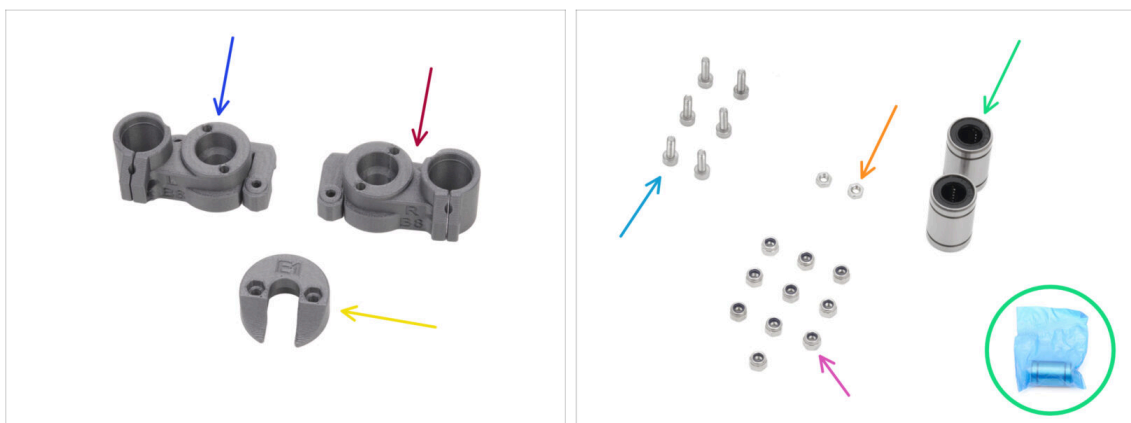

- ✦ **For the following steps, please prepare:**
- ✦ CORE-One-bed-mount-left (1x) *found in the Printed parts package*
- ✦ CORE-One-bed-mount-right (1x) *found in the Printed parts package*
- ✦ CORE-One-bed-spacer-rear (1x) *found in the Printed parts package*
- ✦ LM8UU bearing (2x) *found in the Electronics package*
- ❗ The bearings in the kit are packed in blue bags.
- ✦ Schraube M3x10 (6x)
- ✦ M3n Mutter (2x)
- ✦ M3nN Mutter (10x)

SCHRITT 16 Assembling the bed mounts



- Place the CORE-One-bed-mount-left onto the bearing, ensuring the correct orientation.
- Press the part onto the bearing, applying more force to ensure it moves all the way down. You will feel a click, indicating that the plastic part and bearing are correctly seated.
- ⓘ Use any flat screwdriver to carefully expand the opening in the bed mount if you struggle to insert the bearing.
- ⚠ The bearing must be fully enclosed within the part and must not protrude.
- Follow the same procedure with CORE-One-bed-mount-right.

SCHRITT 17 Securing the bed mounts



- Insert one M3n nut into the CORE-One-bed-mount-left.
- Position the CORE-One-bed-mount-left according to the picture:
 - Position the bearing so that two ball rows face the bottom of the part, not just one.
- Keep the bearing in the position and secure it by inserting and tightening one M3x10 screw.
- ⚠ Ensure that the top surface of the bearing is flush with the top surface of the plastic part.
- Follow the same procedure with CORE-One-bed-mount-right.

SCHRITT 18 Bed mounts: inserting the nuts



- Insert four M3nN nuts into both bed mounts.
- Make sure they are inserted completely inside.

SCHRITT 19 Zusammenbau der CORE-One-bed-spacer-rear



- Insert two M3nN nuts into the CORE-One-bed-spacer-rear.
- Insert the nuts down as much as possible.

SCHRITT 20 Installieren des Bed-mount-right




- Turn the heatbed carriage piece with the "forks" facing you and with the **expansion joints facing up**.
- Take the CORE-One-bed-mount-**right** part and slide it **under** the **right** fork - with the bearing on the right.
- Fix it with two M3x10 screws.

SCHRITT 21 Installieren des Bed-mount-left




- Take the One-bed-mount-**left** part and slide it **under** the **left** fork - with the bearing on the left.
- Fix it with two M3x10 screws.

SCHRITT 22 Mounting the heatbed: parts preparation

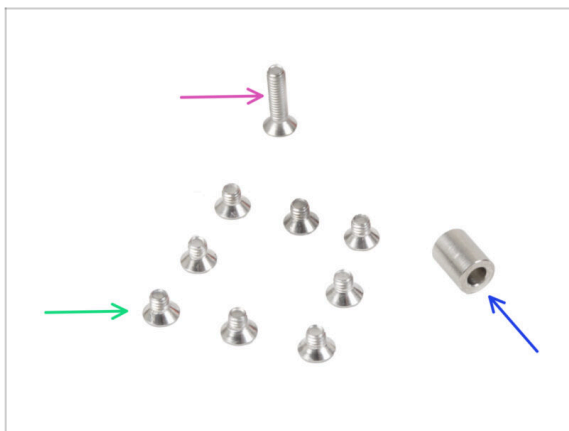

- For the following steps, please prepare:
- Senkschraube M3x14bT (1x)
 - i** Hinweis: Auf der Verpackung kann diese Schraube als M3x14cT bezeichnet sein.
- Spacer 6x3.1x10 mm (1x) *found in the Nextruder assembly package inside the Electronics box.*
- M3x4bT countersunk screw (8x)

SCHRITT 23 Sichern des Heizbettes

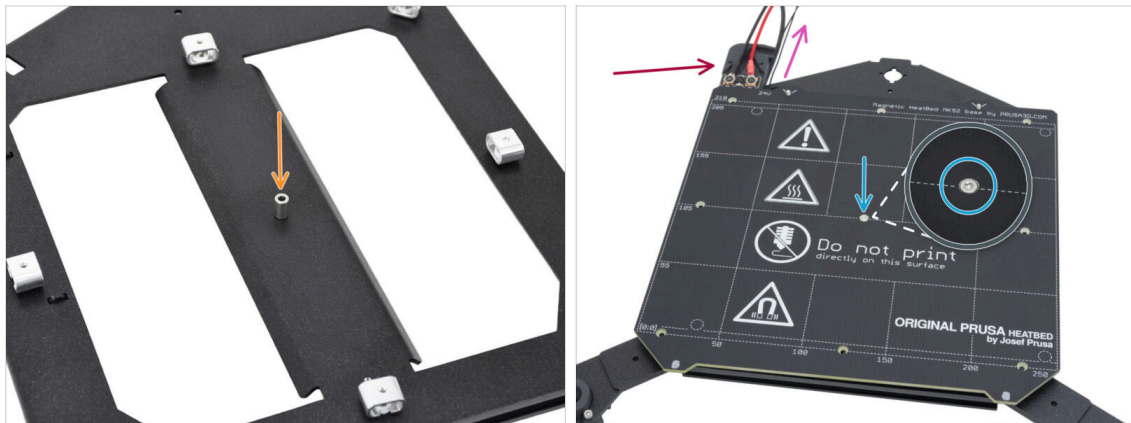

- ✿ Place the spacer onto the heatbed carriage on the side with the expansion joints and align it with the hole in the center.
- ✿ Setzen Sie das Heizbett auf den Heatbed-carriage und sichern Sie es mit der M3x14bT. **Ziehen Sie die Schraube noch nicht ganz fest.**
- ✿ Make sure the heatbed thermistor cable (the thinnest pair) is routed alongside the heatbed power cables. Do not route it around or across any expansion joints.
- ⚠ **Ensure the correct orientation of the part. Use the heatbed cables as a guide.**

SCHRITT 24 Expansion-joint-aligner




- ✿ Bereiten Sie den **Expansion-joint-aligner** für die folgenden Schritte vor.
- ⓘ Ihr Paket enthält die **schwarze Version**. Die orangefarbene Version wird in dieser Anleitung zur besseren Veranschaulichung abgebildet.
- ✿ In the following steps, you will precisely align each expansion joint.
- ✿ Als Orientierungshilfe sehen Sie sich bitte das zweite Bild an, das die vereinfachte Ausrichtung des Aligners für einen einzelnen Expansion-Joint zeigt.
- ✿ Das dritte Bild zeigt, wie das Ausrichtungswerkzeug zur Orientierung auf den Expansion-Joint geschoben wird.
- ✿ The expansion joint is shown outside the printer for clarity. During alignment, it is installed under the heatbed.

SCHRITT 25 Aligning the front side expansion joint




- ✦ Insert the M3x4bT screws into **all eight holes** around the heatbed. Tighten each screw by **one turn only**.
- ⬛ Start by aligning the **middle expansion joint on the front side**.
 - ❶ Use the symbols on the heatbed as a reference.
- ✦ Schieben Sie die gerade Gabel auf den Expansion-joint und drücken Sie den Expansion-joint-aligner gegen das Heizbett. Dadurch wird der Expansion-joint ausgerichtet.
- ✦ Drücken Sie den Aligner fest gegen den Rand des Heizbetts.
- ✦ Ziehen Sie die Schraube nur ganz leicht an.

SCHRITT 26 Aligning the front left expansion joint

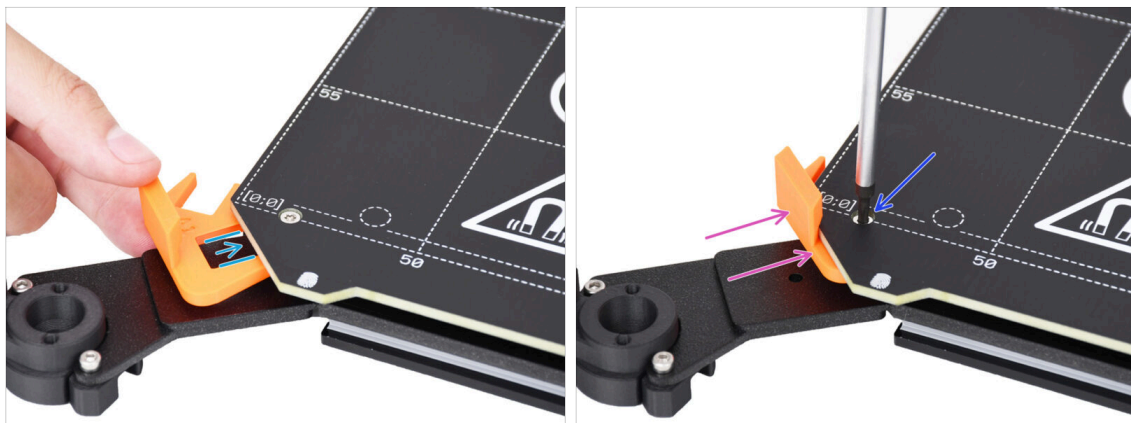


- ⬛ Begeben Sie sich zur **linken Ecke**.
- ✦ Schieben Sie die gerade Gabel auf den Expansion-joint und drücken Sie den Expansion-joint-aligner gegen das Heizbett. Dadurch wird der Expansion-joint ausgerichtet.
- ✦ Drücken Sie den Aligner fest gegen den Rand des Heizbetts.
- ✦ Ziehen Sie die Schraube nur ganz leicht an.

SCHRITT 27 Aligning the left side expansion joint

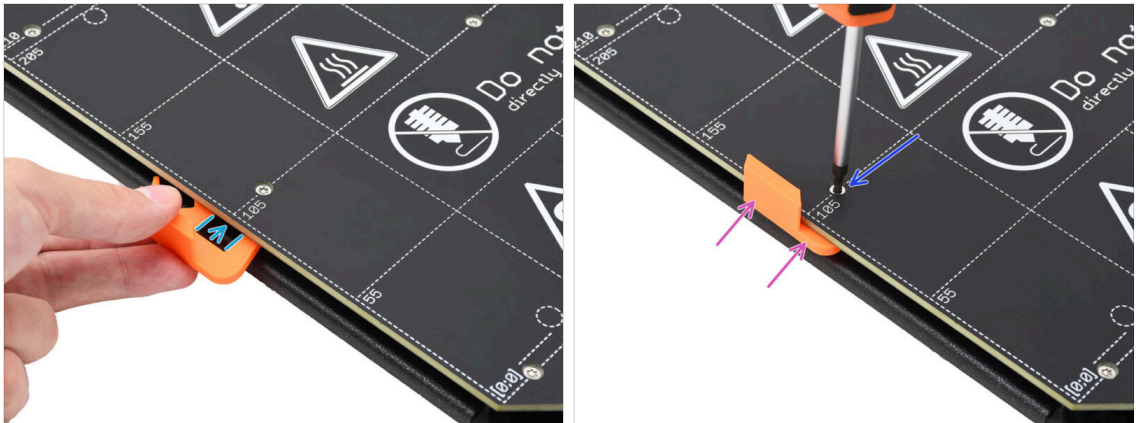

- Gehen Sie zur **linken Seite** des Heizbetts.
- Schieben Sie die gerade Gabel auf den Expansion-joint und drücken Sie den Expansion-joint-aligner gegen das Heizbett. Dadurch wird der Expansion-joint ausgerichtet.
- Drücken Sie den Aligner fest gegen den Rand des Heizbetts.
- Ziehen Sie die Schraube nur ganz leicht an.

SCHRITT 28 Aligning the rear left expansion joint

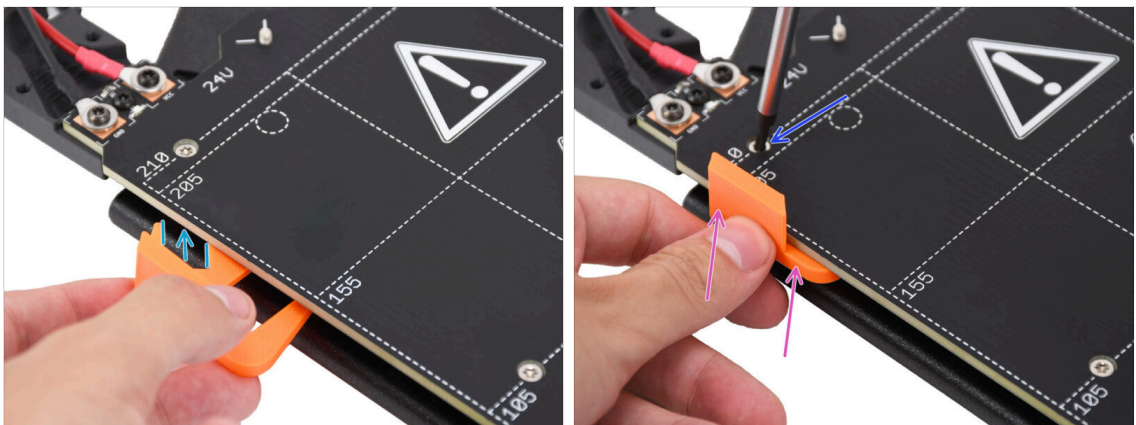

- Move to the **rear left corner**.
- Slide the **angled** fork onto the expansion joint and push the Expansion-joint-aligner against the heatbed. This will align the expansion joint.
- Drücken Sie den Aligner fest gegen den Rand des Heizbetts.
- Ziehen Sie die Schraube nur ganz leicht an.

SCHRITT 29 Aligning the middle rear expansion joint




- Fahren Sie mit der **mittleren hinteren** Expansion-Joint fort.
- Schieben Sie die gerade Gabel auf den Expansion-joint und drücken Sie den Expansion-joint-aligner gegen das Heizbett. Dadurch wird der Expansion-joint ausgerichtet.
- Drücken Sie den Aligner fest gegen den Rand des Heizbetts.
- Ziehen Sie die Schraube nur ganz leicht an.

SCHRITT 30 Aligning the rear right expansion joint



- Fahren Sie mit der **hinteren rechten Ecke** fort.
- Schieben Sie die **abgewinkelte** Gabel auf den Expansion-joint und drücken Sie den Expansion-joint-aligner gegen das Heizbett. Dadurch wird der Expansion-joint ausgerichtet.
- Drücken Sie den Aligner fest gegen den Rand des Heizbetts.
- Ziehen Sie die Schraube nur ganz leicht an.

SCHRITT 31 Aligning the right side expansion joint

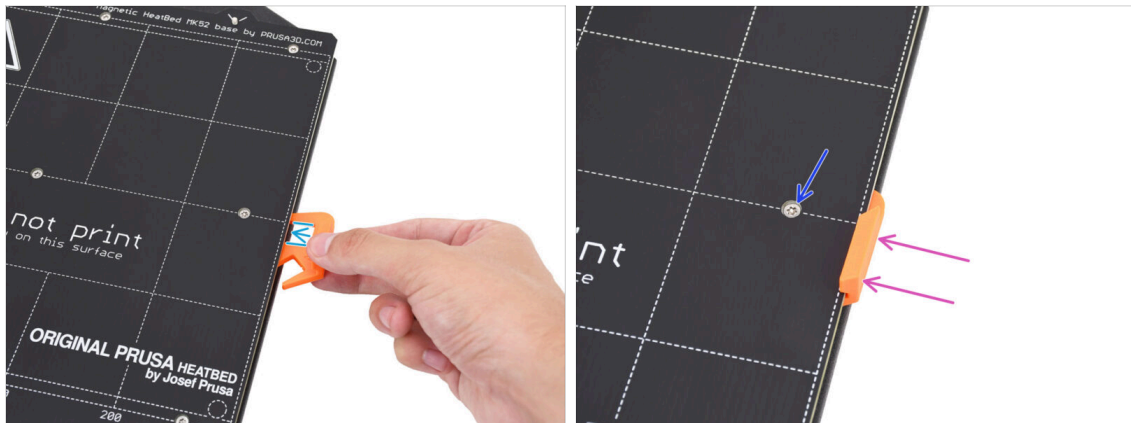


- Move to the **right side** of the heatbed.
- Schieben Sie die gerade Gabel auf den Expansion-joint und drücken Sie den Expansion-joint-aligner gegen das Heizbett. Dadurch wird der Expansion-joint ausgerichtet.
- Drücken Sie den Aligner fest gegen den Rand des Heizbetts.
- Ziehen Sie die Schraube nur ganz leicht an.

SCHRITT 32 Aligning the front right expansion joint



- Fahren Sie mit der **vorderen rechten Ecke** fort.
- Schieben Sie die gerade Gabel auf den Expansion-joint und drücken Sie den Expansion-joint-aligner gegen das Heizbett. Dadurch wird der Expansion-joint ausgerichtet.
- Drücken Sie den Aligner fest gegen den Rand des Heizbetts.
- Ziehen Sie die Schraube nur ganz leicht an.


SCHRITT 33 Befestigen des Heizbetts

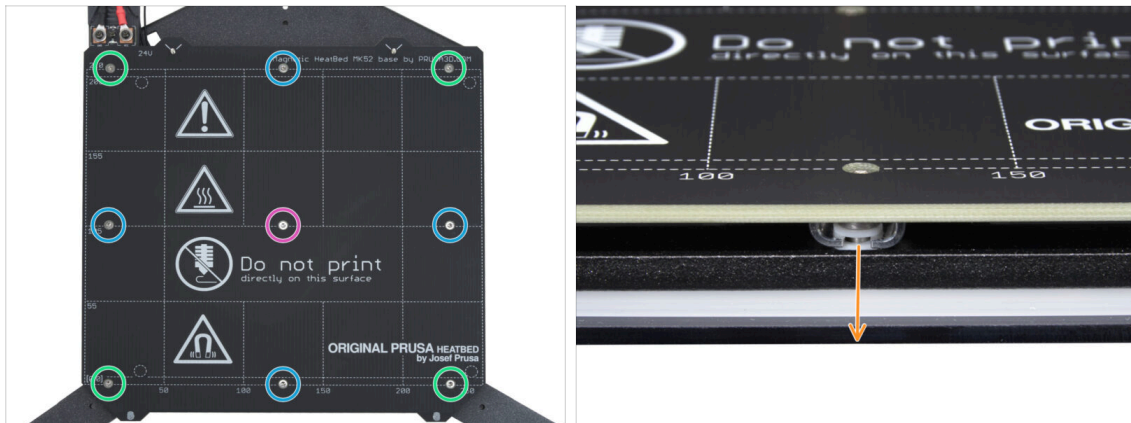

⚠ WICHTIG: Das Heizbett muss in einer bestimmten Reihenfolge festgezogen werden. Wiederholen Sie die Abfolge mehrmals und achten Sie darauf, dass das letzte Anziehen nach frühestens zwei Runden erfolgt.


- After all screws are in place, tighten them in the following sequence:
 - Mittlere Schraube
 - Erste vier Schrauben (Kanten)
 - Last four screws (corners)
- Tighten the screws gently, but firmly.
- Double-check that the expansion joint has not rotated and that the groove is facing outwards from the printer.

SCHRITT 34 Covering the cables: parts preparation

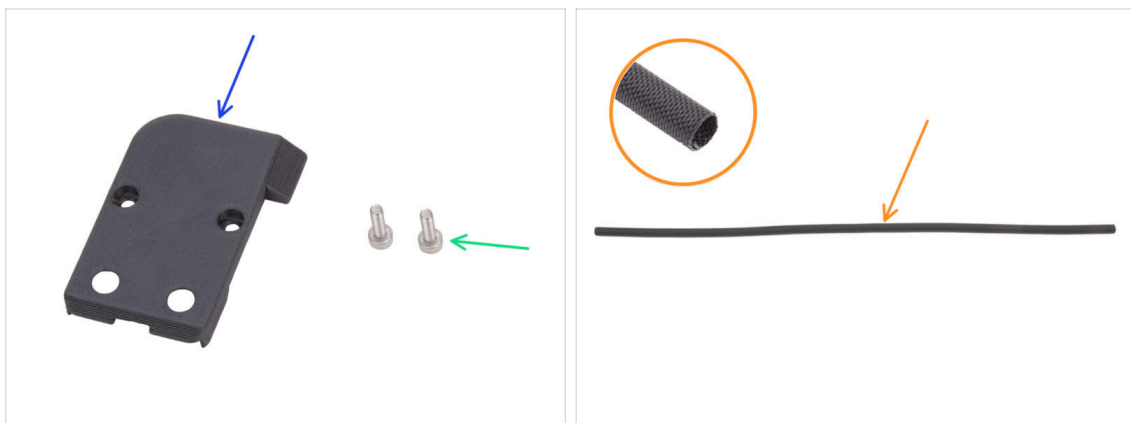


- For the following steps, please prepare:
 - CORE-One-bed-cable-cover-top (1x) found in the Printed parts package
 - Schraube M3x10 (2x)
 - Textile sleeve 520 x 8 mm (1x) found in the Electronics & Chamber parts package

SCHRITT 35 Guiding the heatbed cables

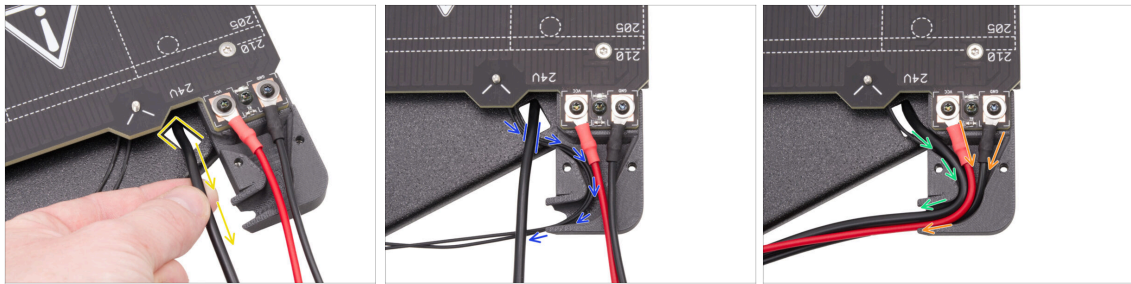

- ✦ Pull the RGB LED strip cable from the bottom through the rectangular cutout to the top.
- ✦ Guide the heatbed thermistor cable under the RGB LED cable, and insert the heatbed thermistor cable into the cable channel in the cable cover.
- ✦ Route the RGB LED strip cable through the cable channel.
- ✦ Guide the heatbed power cables through the cable channel.

SCHRITT 36 Covering the heatbed cables

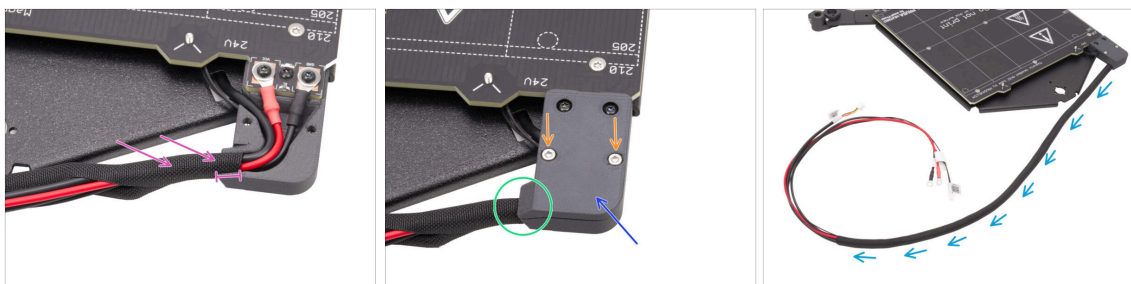

- ✦ Thread approximately 5 cm (2 in) of the textile sleeve onto the heatbed cable bundle and slide the textile sleeve 1 cm (0.39 in) into the cable channel.
- ✦ Attach the CORE-One-bed-cable-cover-top on the heatbed cables.
- ✦ Make sure the textile sleeve is still in place - inside the cable cover. **Do not pull on the textile sleeve.**
- ✦ Secure the top cover with two M3x10 screws.
- ✦ Wrap the rest of the textile sleeve around the cable bundle.

SCHRITT 37 Nozzle wiper assembly: parts preparation



For the following steps, please prepare:


- Nozzle-wiper-holder (1x)
- Düsen Abstreifer (1x)
- M3nN Mutter (1x)
- Schraube M3x6r (1x)
- Schraube M3x10 (1x)
- Expansion-joint (1x)

SCHRITT 38 Assembling the nozzle wiper




- Insert the M3x6r screw into the expansion joint with the screw head first.
- Führen Sie einen 2,0-mm-Innensechskantschlüssel durch die Gewindebohrung ein, um an die Schraube zu gelangen.
- Attach the expansion joint to the Nozzle-wiper-holder and tighten the screw. Do not overtighten it.
- Stecken Sie die M3nN-Mutter in das vorgesehene Loch.

SCHRITT 39 Mounting the nozzle wiper

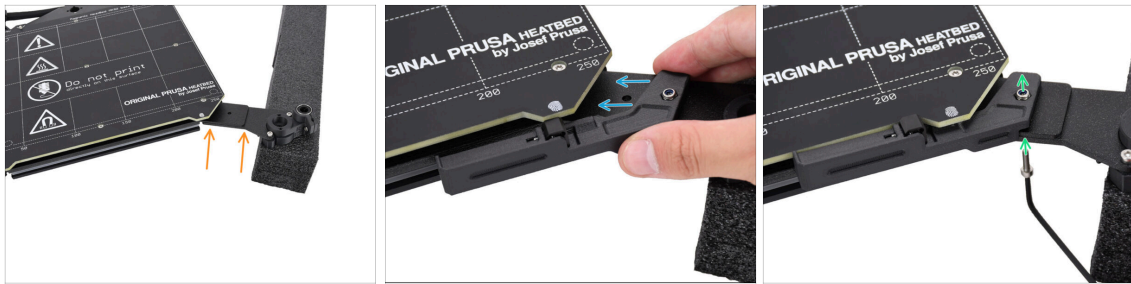

- 🟠 Heben Sie die vordere rechte Ecke des Heizbetts vorsichtig an.
- ⬛ Es wird empfohlen, die Ecke von unten mit einer weichen Unterlage abzustützen, damit sie angehoben bleibt.
- 📘 **i** Tip: Use a piece of foam padding from the package to place underneath the corner.
- 🔵 Schieben Sie die Düsenabstreifer-Baugruppe gegen das Heizbett.
- 🟢 Setzen Sie die M3x10-Schraube von der Unterseite des Z-Schlittens ein und ziehen Sie sie fest an.

SCHRITT 40 Sticking the wiper pad

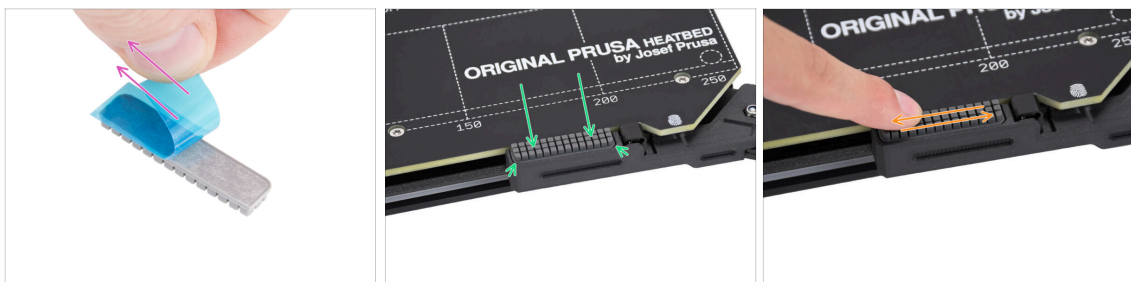

- 🟣 Entfernen Sie die Schutzfolie vom Düsenabstreifer-Pad ab.
- 📘 **i** Das Pad ist unter der Schutzschicht selbstklebend. **Vermeiden Sie es, die Klebefläche zu berühren.**
- 🟢 Insert the nozzle wiper pad into the matching recess in the nozzle wiper assembly.
- 📌 Bitte beachten Sie, dass das Pad **abgerundete Ecken** auf einer Seite aufweist. Passen Sie diese an die Form der Aussparung an.
- 🟠 Fahren Sie mehrmals mit dem Finger über die gesamte Oberfläche des Düsenabstreifers, um sicherzustellen, dass es gleichmäßig haftet und vollständig sitzt.

SCHRITT 41 Mounting the heatbed: parts preparation





For the following steps, please prepare:

Trapezmutter (3x)

i Two trapezoidal nuts are included in the motors set package, and one nut can be found in the Electronics & Chamber parts package.


Schraube M3x18 (6x)

SCHRITT 42 Attaching the heatbed assembly

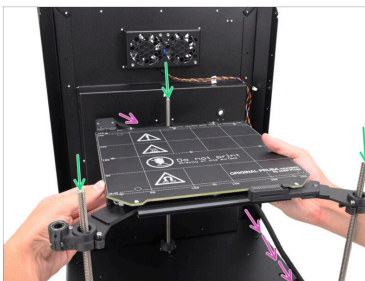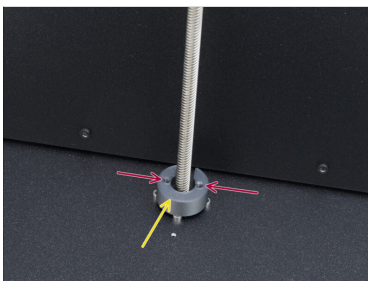

- Take the back and base assembly and orient the front side towards you.
- Place the CORE-One-bed-spacer-rear onto the rear motor screw heads, making sure it stays in place.
 - !** Note the orientation of the part and holes as shown. The holes must be parallel to the motor screw heads.
- Very carefully thread the heatbed assembly onto the threaded rods of the Z motors, then **gently** lay it down onto the base. **Make sure that the spacer at the bottom does not move.**
 - !** Ensure that the heatbed cable does not touch the spacer and remove it from the motor.
- The heatbed cable must run **under the heatbed** and **behind the rear motor**.

SCHRITT 43 Mounting the heatbed assembly: rear motor

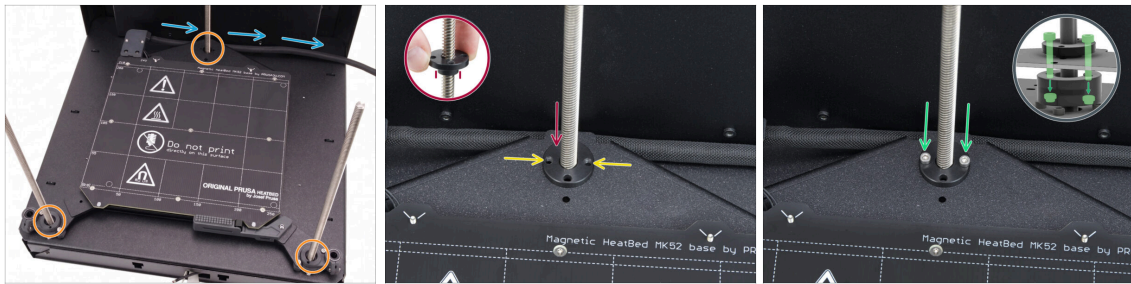

- ✦ Ensure the heatbed assembly is seated correctly—all threaded rods pass through the correct holes.
- ✦ Double-check that the heatbed cable bundle (textile sleeve) runs properly—it **must go under the heatbed assembly** and **behind the threaded rod** of the rear motor.
- ✦ Manually thread the trapezoidal nut onto the rear Z motor. Screw the nut all the way down until it seats into the heatbed carriage.
 - ⚠ Ensure the correct orientation of the part. **The protruding section must face downwards.**
- ✦ Align the holes in the trapezoidal nut, carriage and bed-spacer-rear.
 - ⓘ It doesn't matter which holes you use in the trapezoidal nut.
 - ⓘ Tip: You can push a 1.5 mm Allen key through the holes in all the parts to align them.
- ✦ Secure the trapezoidal nut, heatbed carriage and bed-spacer-rear together with two M3x18 screws.

SCHRITT 44 Mounting the heatbed assembly: front motor left




- ✦ Manually thread the trapezoidal nut onto the **left** Z motor. Screw the nut all the way down until it seats into the plastic part.
 - ⚠ Ensure the correct orientation of the part. **The protruding section must face downwards.**
- ✦ Align the holes in the trapezoidal nut with those in the plastic part. Either pair of holes can be used.
- ✦ Secure all the parts together with two M3x18 screws.
 - ⓘ Once the screws are tightened, loosen them by a quarter turn to provide a small amount of leeway.

SCHRITT 45 Mounting the heatbed assembly: front motor right




- Manually thread the trapezoidal nut onto the **right** Z motor. Screw the nut all the way down until it seats into the plastic part.
 - ⚠ Ensure the correct orientation of the part. **The protruding section must face downwards.**
- Align the holes in the trapezoidal nut with those in the plastic part. Either pair of holes can be used.
- Secure all the part together with two M3x18 screws.

SCHRITT 46 Attaching the heatbed cables I.

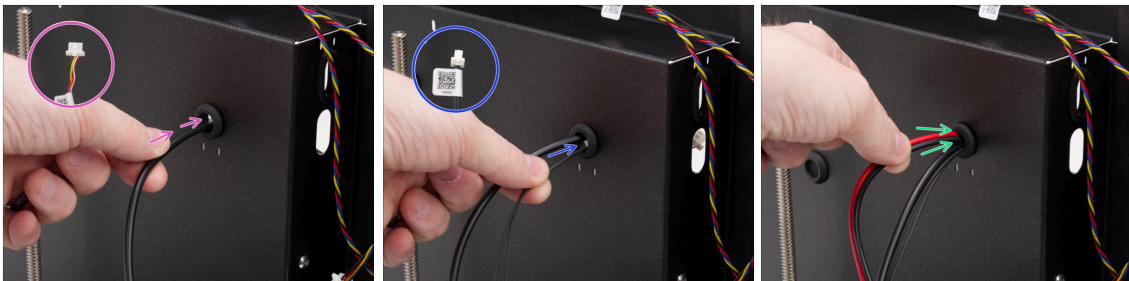


- Locate the grommet hole at the top right of the rear assembly and push the heatbed cables through in the following order:
 - Guide the RGB LED strip cable through the hole first.
 - Route the thermistor cable through the hole.
 - Finally, insert both power cables of the hole.

SCHRITT 47 Attaching the heatbed cables II.

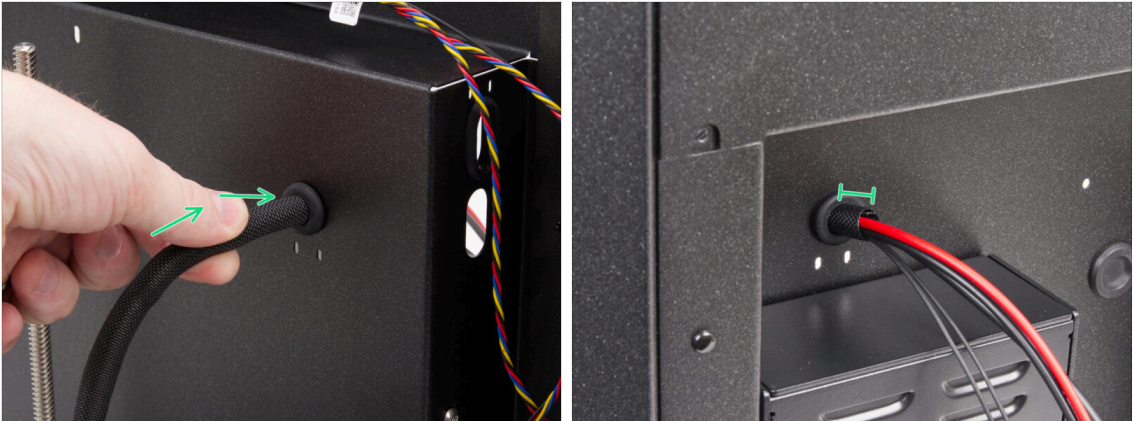


- Push the heatbed cables and the textile sleeve through the grommet hole.
- No more than 1 cm (0.39 in) of the textile sleeve should protrude from the back side.

SCHRITT 48 Securing the heatbed cables: parts preparation

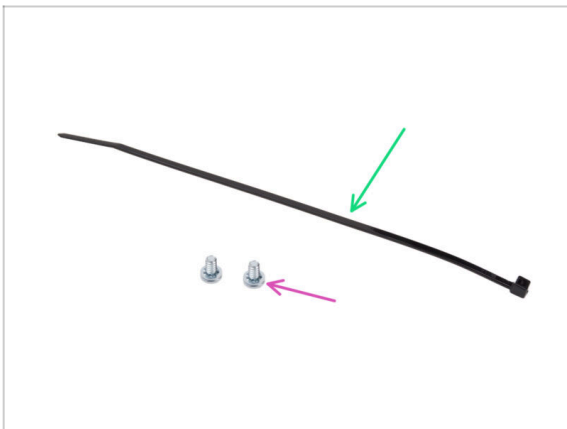


- For the following steps, please prepare:
- Kabelbinder (1x)
- Power terminal screw 6-32 (2x)

SCHRITT 49 Securing the textile sleeve

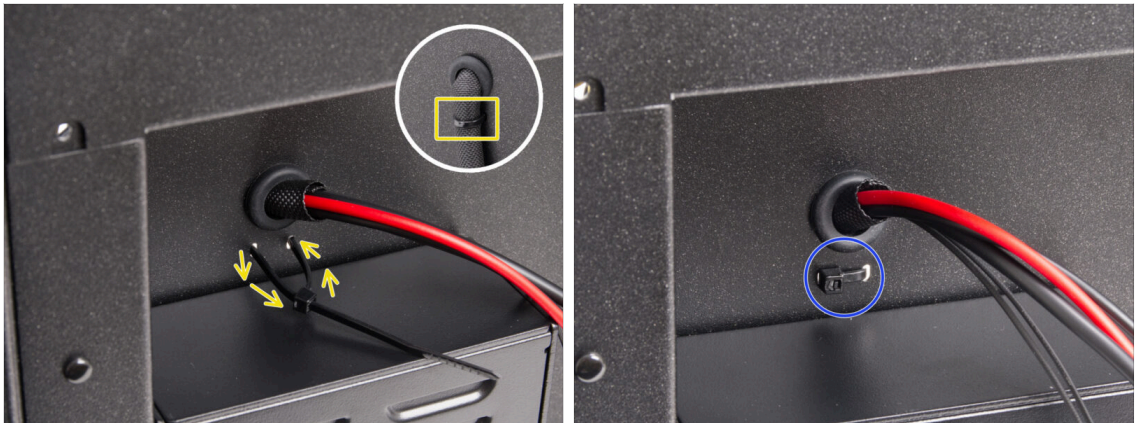


- Guide the zip tie through the two holes under the heatbed cables and make a loop around the heatbed cable bundle (textile sleeve) on the inside.
- Tighten the zip tie firmly and cut off the excess.

SCHRITT 50 Guiding the heatbed assembly cables

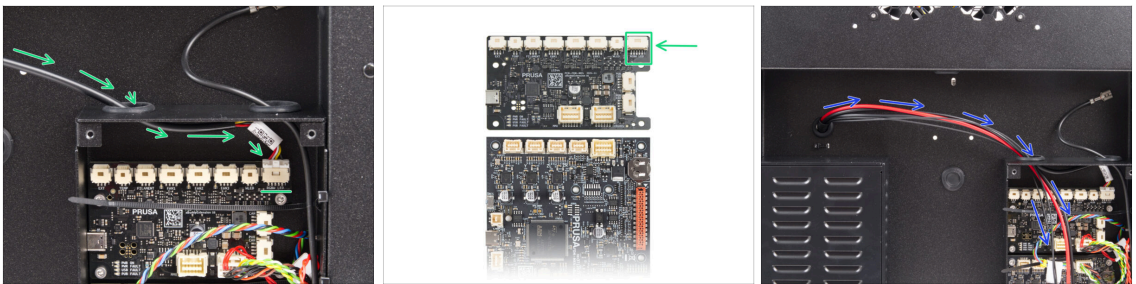


- Route the RGB LED strip cable through the left hole in the xBuddy box and connect it to the xBuddy Extension board labeled 'RGBW LED.'
- Connect it to the first slot from the right on the xBuddy extension board.
- Guide the heatbed power cables along with the thermistor through the left hole. Leave the cables hanging freely for now.

SCHRITT 51 Connecting the heatbed power cables

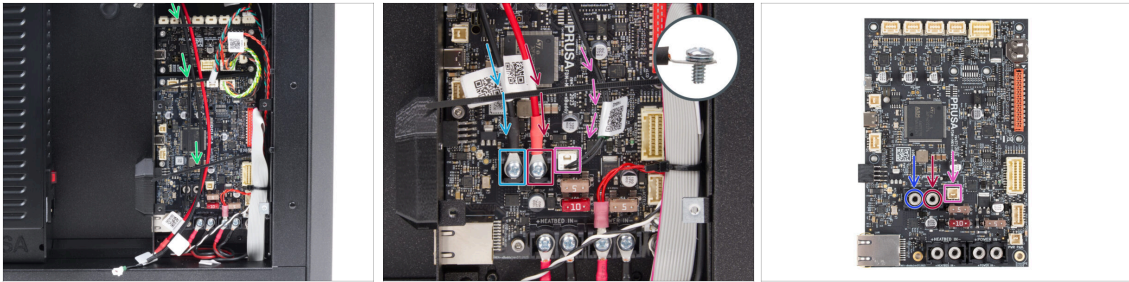

- Ensure that none of the heatbed cables run over the zip ties—they must be guided underneath.
- Using the 6/32" terminal screw connect the **black** power cable to the **left** terminal slot on the xBuddy board. Tighten firmly.
- Using the 6/32" terminal screw to connect the **red** power cable to the **right** terminal slot. Tighten firmly.
- Plug the heatbed thermistor connector to the slot next to the power terminals.

SCHRITT 52 Haribo Zeit!

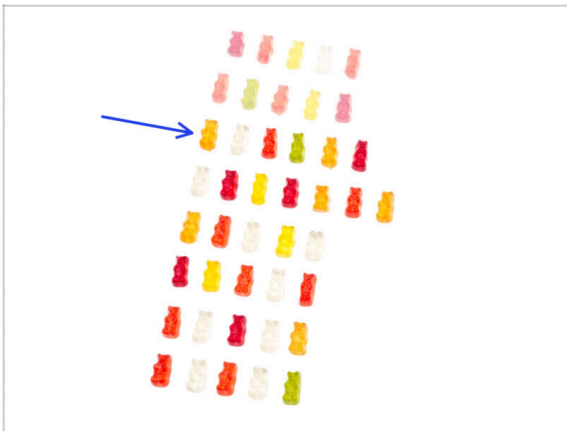

- Time for another quick energy boost!
- Eat the third row.
 - With one extra treat. You deserve it!

SCHRITT 53 Abgeschlossen




- ◆ Congratulations! You have just assembled and installed the heatbed.
- ◆ Let's go to the next chapter.

5. CoreXY Montage




SCHRITT 1 Tools necessary for this chapter

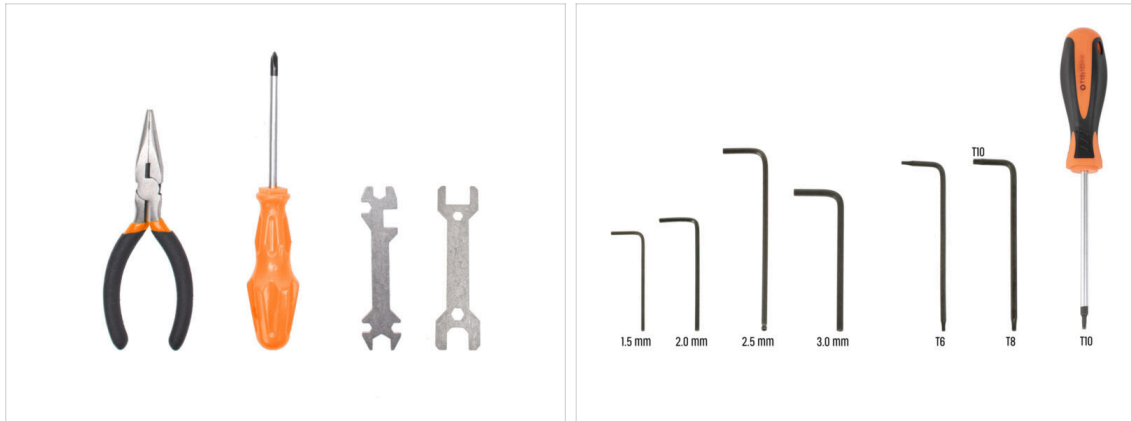


- **For this chapter, please prepare:**
- Spitzzange
- 2,0 mm Innensechskantschlüssel
- 2,5mm Innensechskantschlüssel
- T10 torx key / T10 torxy screwdriver

SCHRITT 2 Rod holders: parts preparation

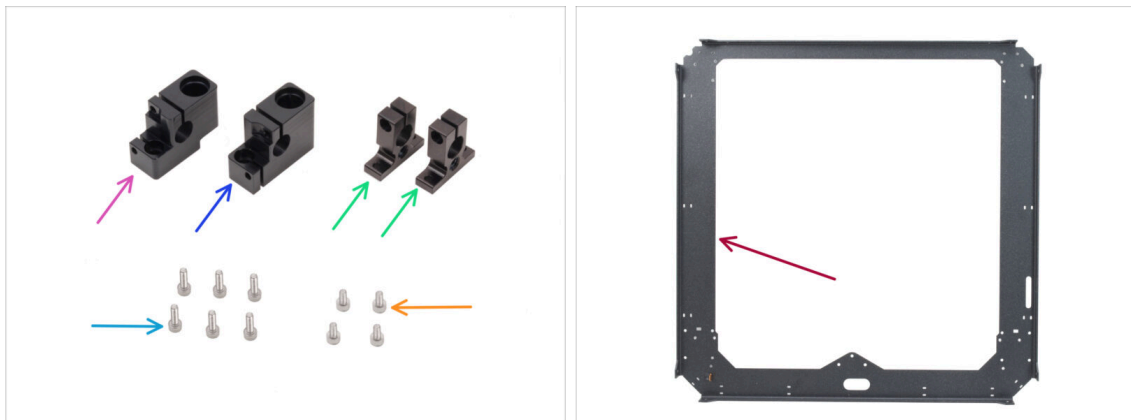


- **For the following steps, please prepare:**
- Rod holder left (1x) *found in the CORE XY parts + hinges + HB set package*
- Rod holder right (1x) *found in the CORE XY parts + hinges + HB set package*
- Rod holder rear (2x) *found in the CORE XY parts + hinges + HB set package*
- Schraube M3x10 (6x)
- Schraube M3x6 (4x)
- CoreXY plate (1x) *found in the Metal parts 1/3 package*

SCHRITT 3 Assembling the rod holders

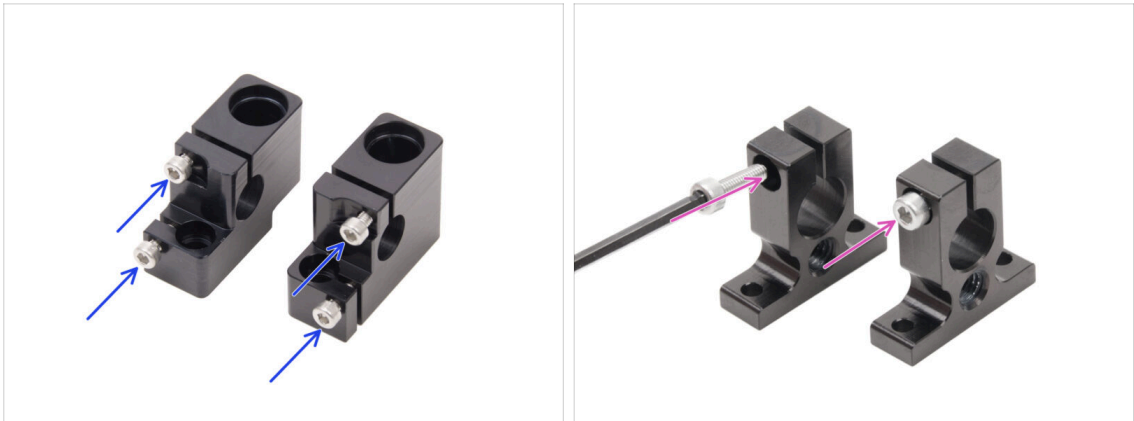


- Insert two M3x10 screws into the Rod holder left and two into the Rod holder right.
- **Do not tighten them completely**, a few turns are enough for now.
- Insert one M3x10 screw into each Rod holder rear. Insert from the **side with the screw head hole**.
- **Do not tighten them completely**, a few turns are enough for now.

SCHRITT 4 Preparing the front rod holders

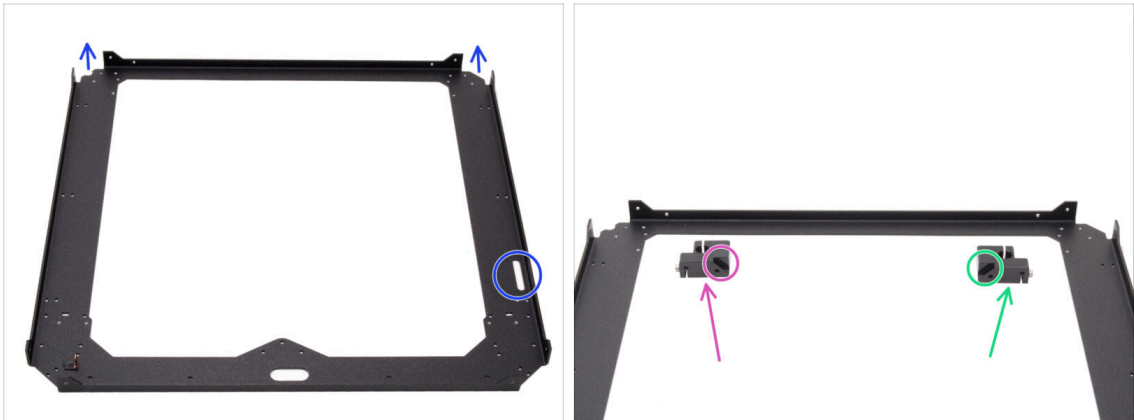

- Place the CoreXY plate as shown - the **bent parts of the plate must point upwards**.
- Divide the Rod holder left and the Rod holder right into the sides of the front:
 - ⚠ **Ensure you are preparing the correct part for the correct side. Use the chamfers on both parts as a reference for alignment.**
 - **Rod-holder-left**
 - **Rod-holder-right**

SCHRITT 5 Installing the front rod holders

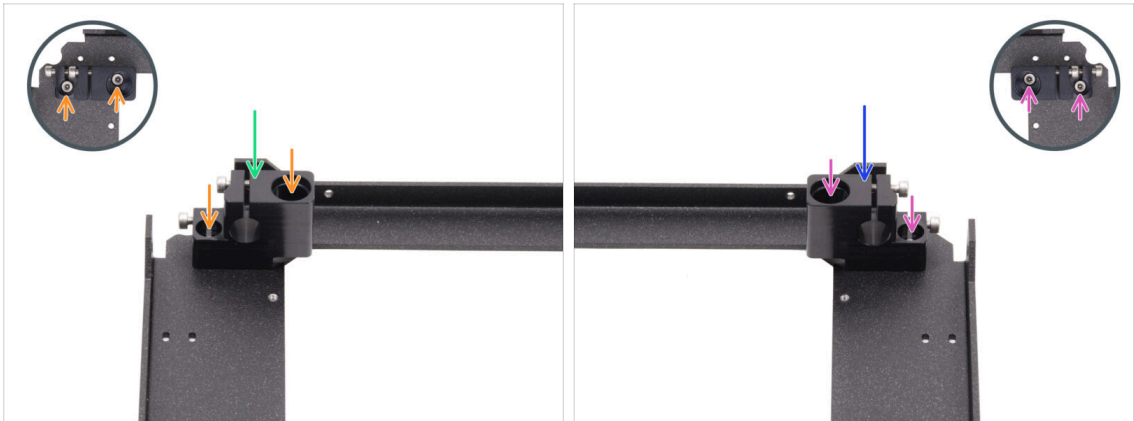


- Place the Rod holder left to the left front corner on the corresponding threaded holes.
- Secure it with two M3x6 screws.
- Place the Rod holder right to the right front corner on the corresponding threaded holes.
- Secure it with two M3x6 screws.

SCHRITT 6 XY carriage: parts preparation




- For the following steps, please prepare:
- Linear holder left (1x) found in the Metal parts 1/3 package
 - Linear holder right (1x) found in the Metal parts 1/3 package
 - XY-carriage (2x) found in the Printed parts package
 - LM10LUU linear bearing (2x) found in the CORE XY parts + hinges + HB set package
 - GT2-20 Idler pulley (4x) found in the Electronics & Fasteners package
 - M3x8rT black screw (8x)
 - Schraube M3x18 (10x)

SCHRITT 7 Zusammenbau der XY-carriages

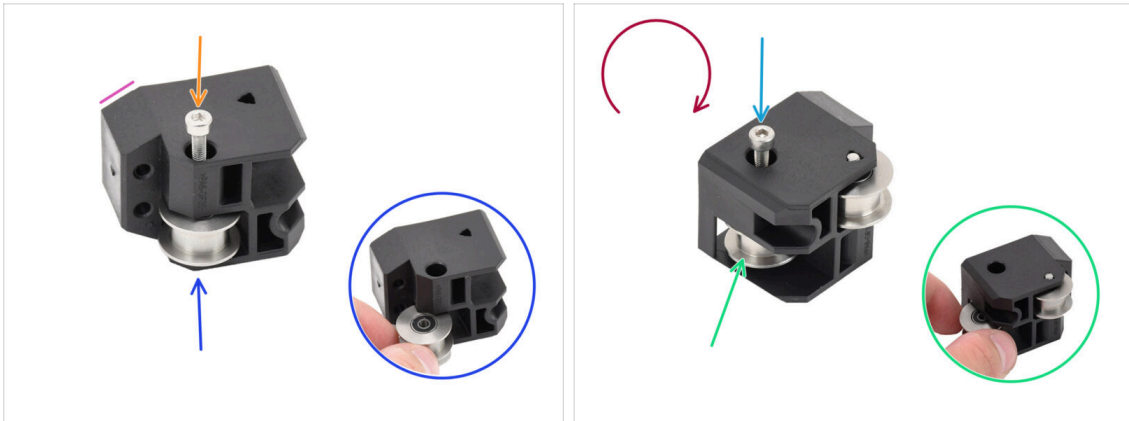


- ◆ Take one of the XY-carriage and orient it as shown. Use the beveled side as a guide.
- ◆ Insert the GT2-20 Idler pulley into the XY-carriage.
- ◆ Push one M3x18 screw through the pulley and tighten it completely down.
- ◆ Turn the part upside down.
- ◆ Insert another GT2-20 Idler pulley into the XY-carriage.
- ◆ Secure it with the M3x18 screw. Tighten it completely down.
- ◆ Repeat the same procedure with the second XY-carriage.

SCHRITT 8 Assembling the linear holder left

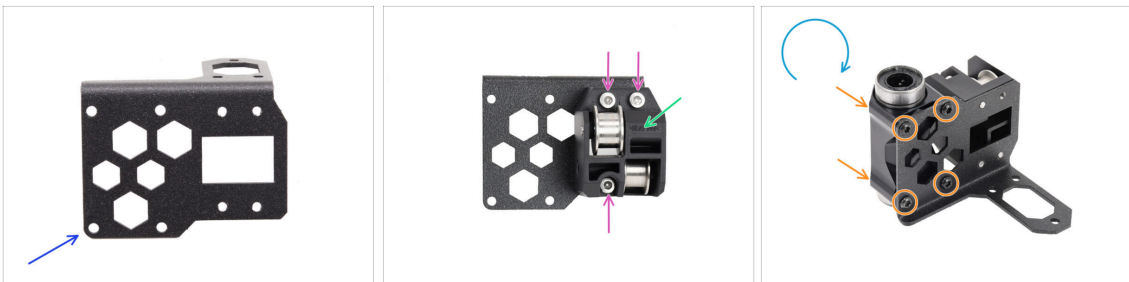


- ◆ Prepare the Linear holder **left** and position it as in the picture.
- ◆ Attach one of the XY-carriages to the Linear holder.
- ◆ Install it to the Linear holder with three M3x18 screws.
- ◆ Turn the Linear holder upside down.
- ◆ From the XY-carriage side, attach the LM10LUU linear bearing to the holder and secure it with four M3x8rT screws.

SCHRITT 9 Assembling the linear holder right

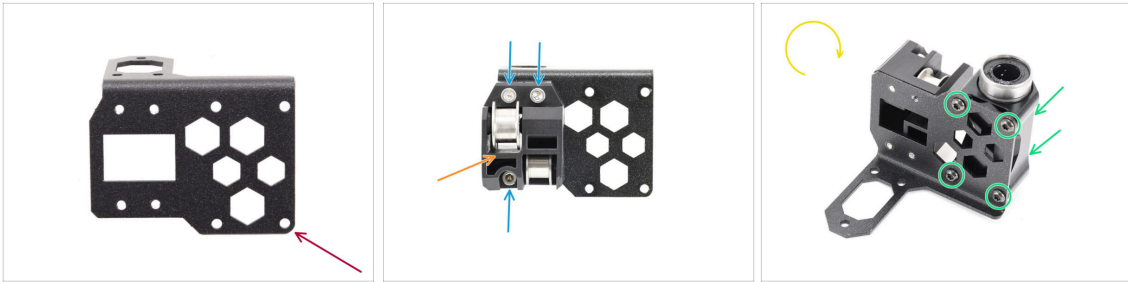


- Prepare the Linear holder **right** and position it as in the picture.
- Attach one of the XY-carriages to the Linear holder.
- Install it to the Linear holder with three M3x18 screws.
- Turn the Linear holder upside down.
- From the XY-carriage side, attach the LM10LUU linear bearing to the holder and secure it with four M3x8rT screws.

SCHRITT 10 Attaching the linear holder assemblies

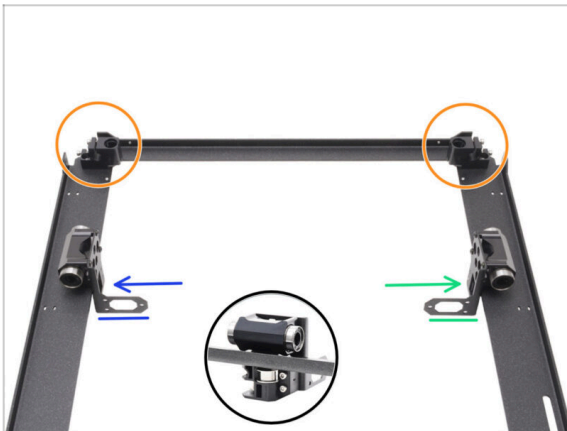

- Position the CoreXY plate as shown in the picture, ensuring the front rod holders are facing up.
- Slightly lift the CoreXY plate and from the plate's inner side loosely attach the Linear holder of the assemblies.
- **Linear-holder-left**
- **Linear-holder-right**
- ① The linear holders are now only loosely seated.

SCHRITT 11 Glatte Stangen INFO

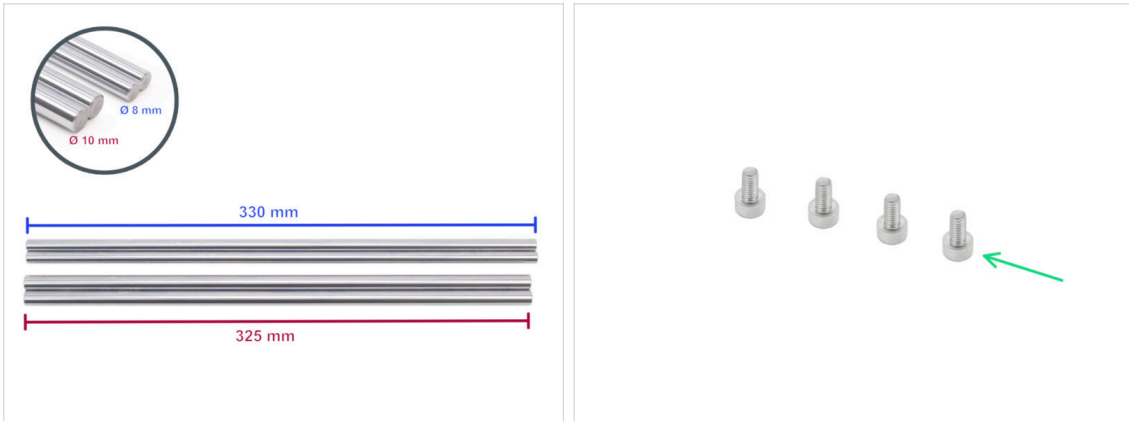


- ⬢ **There are two different types of smooth rods** in the package. Compare carefully with the picture and prepare the correct ones required.
- ❗ Smooth rods are included in the Rods box.
 - 🔵 Smooth rod 330 x 8 mm (2x)
 - 🔴 Smooth rod 325 x 10 mm (2x) **required for the following steps**
- ⬢ **For the following steps, please prepare:**
 - 🟢 Schraube M3x6 (4x)

SCHRITT 12 Mounting the smooth rods




- 🔵 Slide both rear rod holders onto both 10mm smooth rods.
- 🟡 Line up the ends of the rods with the holders.
- 🟠 Push both 10mm smooth rods through the LM10LUU bearing to the front rod holders.
- ⬢ Make sure the screws on the rear rod holders are pointing out of the frame.
- 🟡 Line up the front end of the 10mm smooth rods with the front rod holders.

SCHRITT 13 Securing the rear rod holders

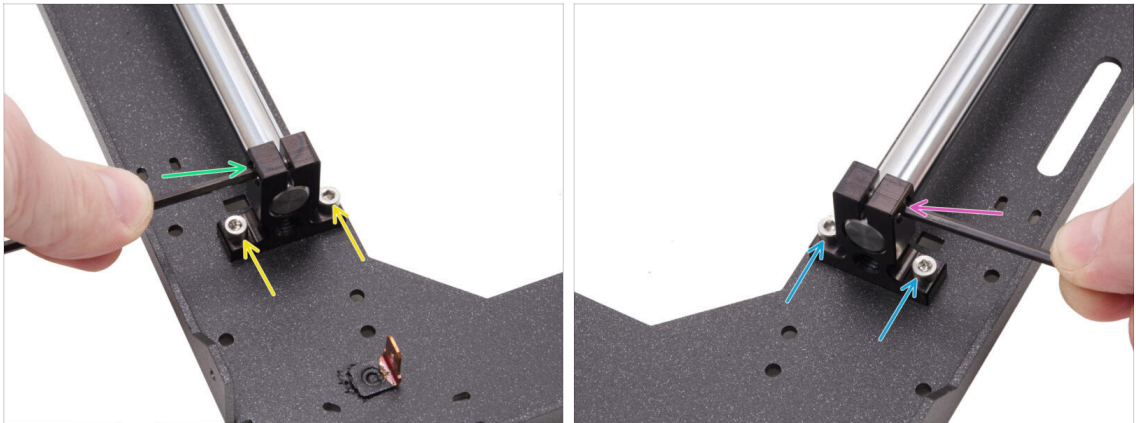


- Line up the left rear rod holder with the threaded holes in the plate.
- Fix it with two M3x6 screws.
- Firmly tighten the screw in the rod holder.
- Line up the right rear rod holder with the threaded holes in the plate.
- Fix it with two M3x6 screws.
- Firmly tighten the screw in the rod holder.

SCHRITT 14 Securing the front rod holders

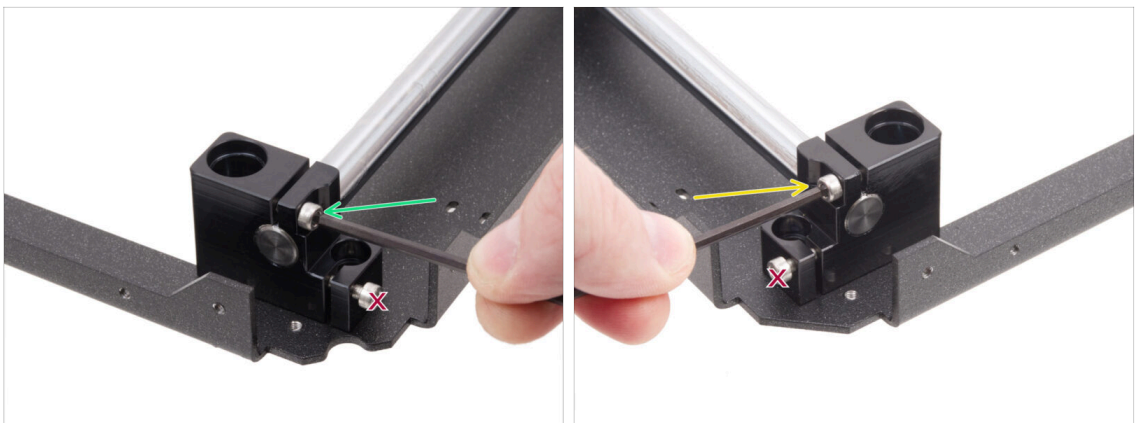

- Focus on the front left holder (currently on the right) and secure the rod by tightening the screw in the holder.
- ⚠ **Do not tighten the bottom screw.**
- Focus on the front right holder (currently on the left) and secure the rod by tightening the screw in the holder.
- ⚠ **Do not tighten the bottom screw.**


SCHRITT 15 Motor mounts: parts preparation

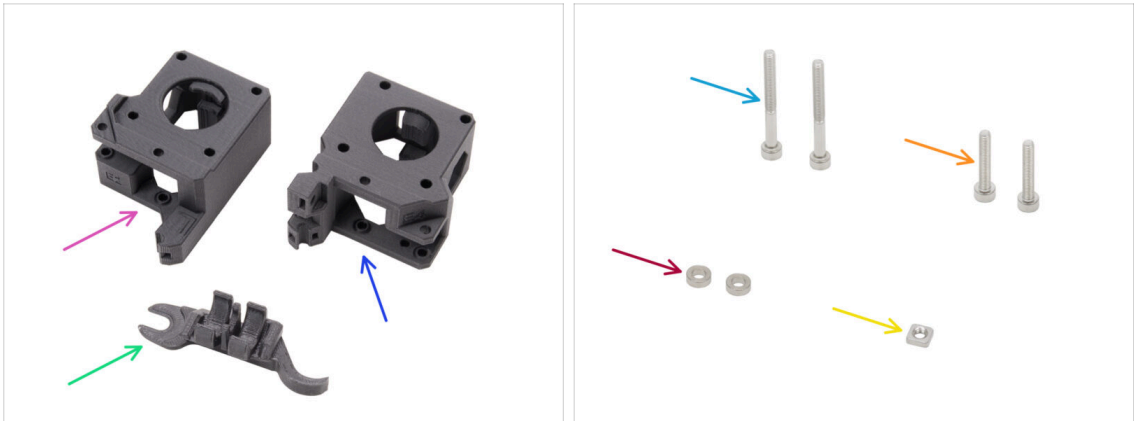

● **For the following steps, please prepare:**


- XY-motor-mount-left (1x) *found in the Printed parts package*
- XY-motor-mount-right (1x) *found in the Printed parts package*
- Assembly-multi-tool (1x) *you already used*
- Schraube M3x30 (2x)
- Schraube M3x18 (2x)
- Spacer 3.2/6x2 (2x) *found in the Small parts & fasteners bag located in the Electronics & Fasteners box.*
- M3nS Mutter (1x)
- **i** The list continues in the next step...

SCHRITT 16 Motor mounts: part preparation

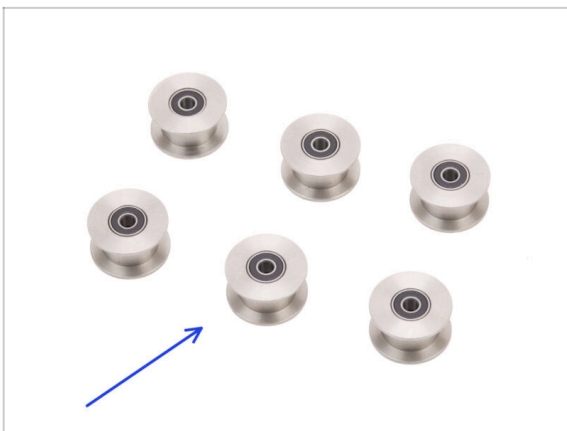

- GT2-20 Idler pulley (6x) *found in the Electronics & Fasteners package*

SCHRITT 17 Assembling the XY-motor-mount-right I.

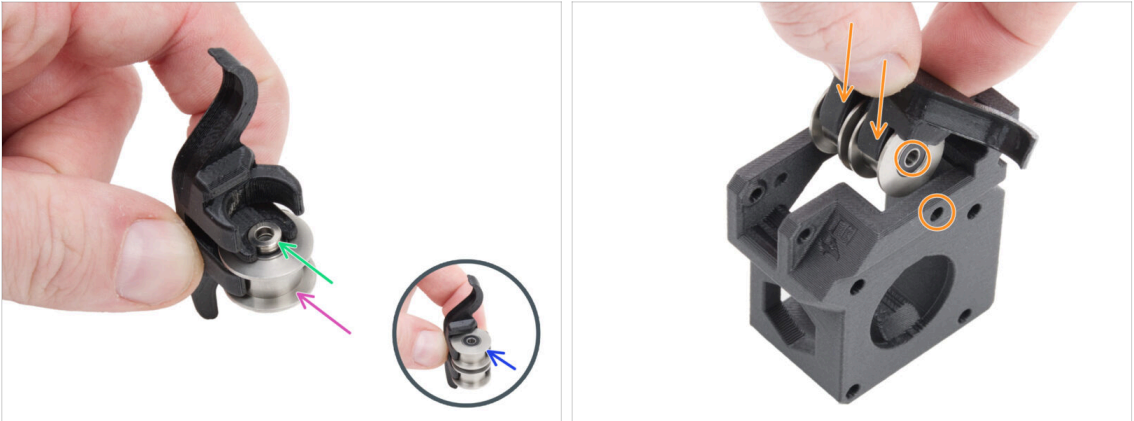

- ◆ Insert one pulley into the lower position in the Assembly-multi-tool.
- ◆ Insert the spacer 3.2 on the pulley.
- ◆ Insert the second pulley into the Assembly-multi-tool.
- ◆ Insert the whole assembly into the XY-motor-mount-right as shown. Note the beveled corner.

SCHRITT 18 Assembling the XY-motor-mount-right II.



- ◆ Align the holes in both parts and insert the M3x30 screw. Slowly and carefully tighten the screw.
- ① The plastic part has no pre-cut thread, so the screw will create it as you tighten. Slight resistance is expected.
- ◆ **Stop tightening once the M3x30 screw head reaches the XY-motor-mount. Do not overtighten the screw!**
- ◆ Entfernen Sie das Assembly-multi-tool.
- ◆ Insert another pulley into the XY-motor-mount-right.
- ◆ Secure it with M3x18 screw. Do not overtighten the screw.
- ◆ Insert the M3nS nut into the XY-motor-mount-right.

SCHRITT 19 Assembling the XY-motor-mount-left I.




- ✿ Insert one pulley into the lower position in the Assembly-multi-tool.
- ✿ Insert the spacer 3.2 on the pulley.
- ✿ Insert the second pulley into the Assembly-multi-tool.
- ✿ Insert the whole assembly into the XY-motor-mount-left.
- ⬛ Position the part according to the picture. Note the bevel next to the screw hole.

SCHRITT 20 Assembling the XY-motor-mount-left II.



- ✿ Align the holes in both parts and insert the M3x30 screw. Slowly and carefully tighten the screw.
- ⓘ The plastic part has no pre-cut thread, so the screw will create it as you tighten. Slight resistance is expected.
- ⬛ **Stop tightening once the M3x30 screw head reaches the XY-motor-mount. Do not overtighten the screw!**
- ✿ Entfernen Sie das Assembly-multi-tool.
- ✿ Insert another pulley into the part.
- ✿ Secure it with M3x18 screw. Do not overtighten the screw.

SCHRITT 21 Belt tensioners: parts preparation I.

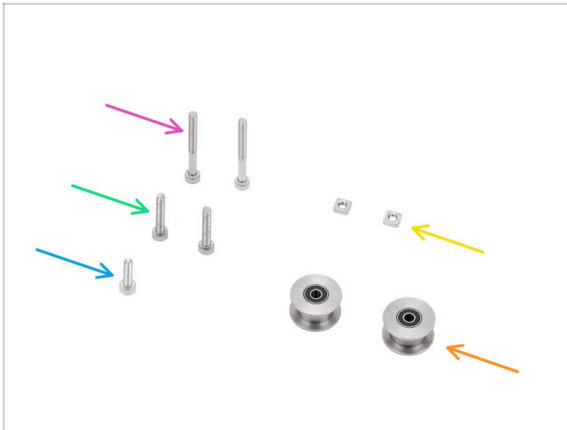

For the following steps, please prepare:

GT2-20 Idler pulley (2x) *found in the Electronics package*

Schraube M3x30 (2x)


Schraube M3x18 (2x)

Schraube M3x12 (1x)

M3nS Mutter (2x)

i The list continues in the next step...

SCHRITT 22 Belt tensioners: parts preparation II.

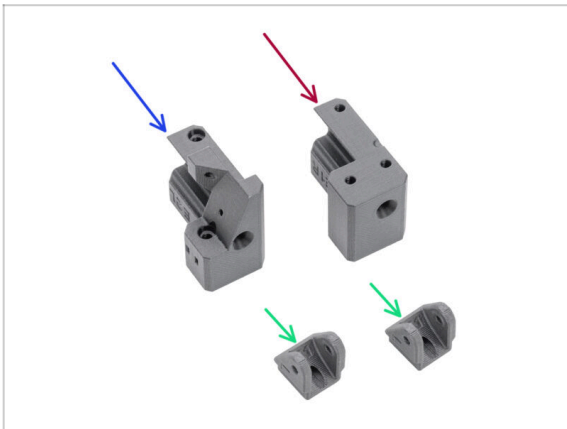


For the following steps, please prepare:

Belt-tensioner-left (1x) *found in the Printed parts package*

Belt-tensioner-right (1x) *found in the Printed parts package*

Belt-tensioner-pulley (2x) *found in the Printed parts package*

SCHRITT 23 Preparing the tensioner pulleys

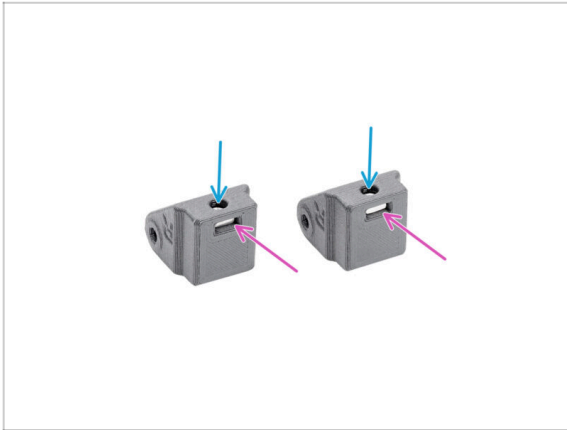

- ✦ Insert one M3nS nut into each Belt-tensioner-pulley.
- ✦ Make sure the nuts are correctly inserted into the parts. The holes in the nuts and the parts **must be aligned**.
- ✦ Keep both parts in this position.

SCHRITT 24 Assembling the belt tensioner left I.



- ✦ Apply a small amount of Prusa lubricant to the tip of both M3x30 screws.
- ✦ Spread the lubricant evenly around the entire thread.
 - ⓘ Tip: Use the tip of a zip tie to spread the lubricant.
- ✦ Slide the Belt-tensioner-**left** onto the Belt-tensioner-pulley.
- ✦ **Ensure the parts are oriented correctly**, as shown.
- ✦ Insert the M3x30 screw through the Belt-tensioner-left into the Belt-tensioner-pulley. **Do not tighten completely!** 3-4 turns are sufficient.

SCHRITT 25 Assembling the belt tensioner left II.




- Insert the GT2-20 Idler pulley into the Belt-tensioner-pulley.
- Secure it with the M3x18 screw.
 - ⓘ The plastic part has no pre-cut thread, so the screw will create it as you tighten. Slight resistance is expected.
- Insert the M3x12 screw into the Belt-tensioner-left. Tighten slightly—five turns are enough. It must not protrude through the other side.
 - ⓘ Note: This screw, referred to as the tensioning screw, will later be used to adjust the door sensor.

SCHRITT 26 Assembling the belt tensioner right



- Slide the Belt-tensioner-**right** onto the Belt-tensioner-pulley.
 - ⬛ **Ensure the parts are oriented correctly**, as shown.
- Insert the M3x30 screw through the Belt-tensioner-right into the Belt-tensioner-pulley. **Do not tighten completely!** 3-4 turns are sufficient.
- Insert the GT2-20 Idler pulley pulley into the Belt-tensioner-pulley-right.
- Secure it with the M3x18 screw.
 - ⓘ The plastic part has no pre-cut thread, so the screw will create it as you tighten. Slight resistance is expected.


SCHRITT 27 Installing the belt tensioners: parts preparation

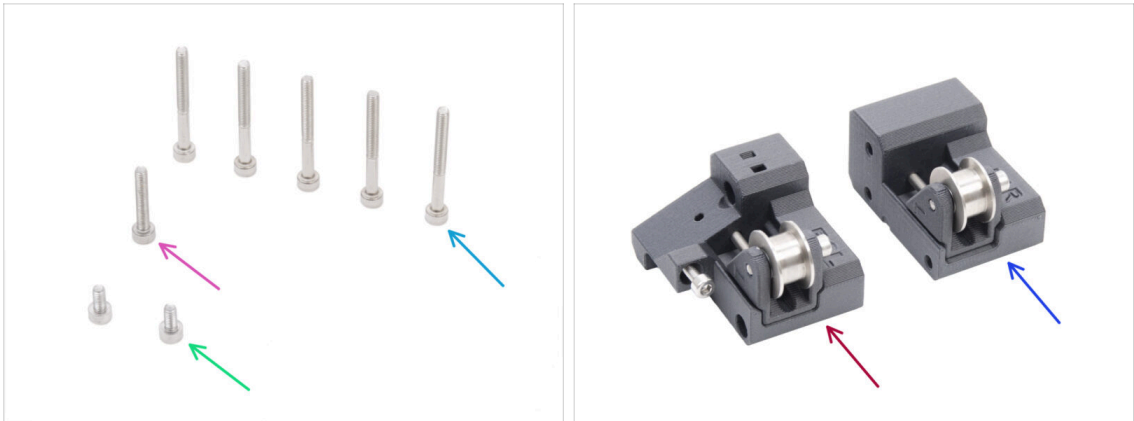

● For the following steps, please prepare:


- Schraube M3x30 (5x)
- Schraube M3x18 (1x)
- Schraube M3x6 (2x)
- Belt tensioner left assembly (1x) *you assembled earlier*
- Belt tensioner right assembly (1x) *you assembled earlier*

SCHRITT 28 Installing the motor mount left

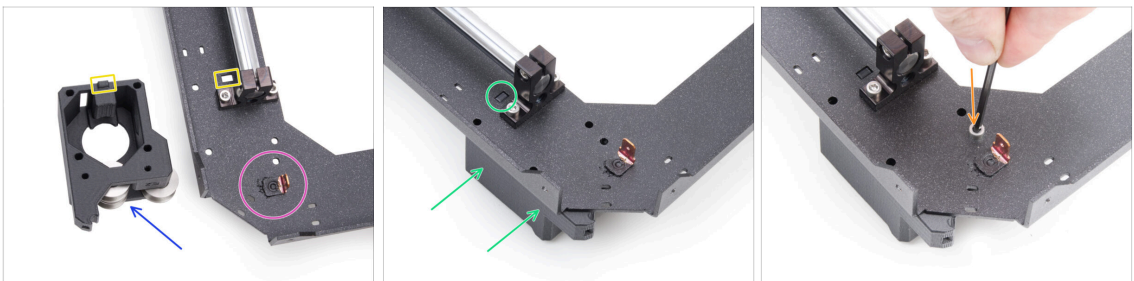


- Locate the corner of the CoreXY plate with the Faston connector on it. It is on the underside of the assembly.
- Position the motor-mount-**left** on the CoreXY plate as shown in the picture.
- Note the rectangular protrusion on the motor-mount-left and the rectangular cutout on the CoreXY plate.
- Slide the motor-mount-left under the CoreXY plate, ensuring the rectangular protrusion fits into the cutout.
- Align the holes in both parts and secure them with an M3x6 screw in the designated hole

SCHRITT 29 Installing the motor mount right

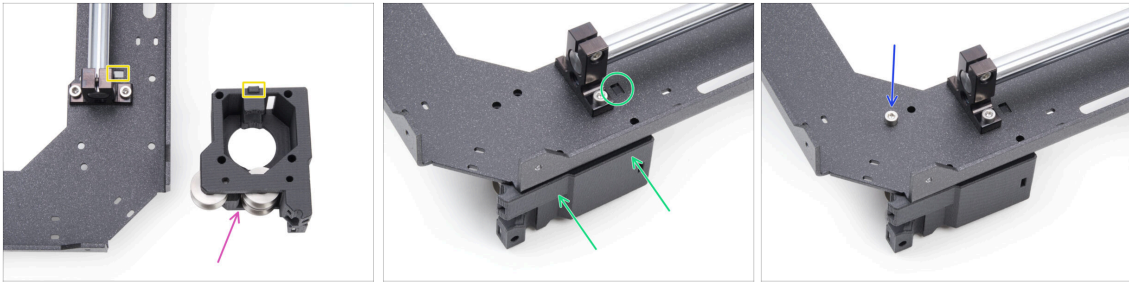


- ◆ Position the motor-mount-**right** on the CoreXY plate as shown in the picture.
- ◆ Note the rectangular protrusion on the motor-mount-right and the rectangular cutout on the CoreXY plate.
- ◆ Slide the motor-mount-right under the CoreXY plate, ensuring the rectangular protrusion fits into the cutout.
- ◆ Align the holes in both parts and secure them with an M3x6 screw in the designated hole

SCHRITT 30 Installieren des Belt-tensioner-left

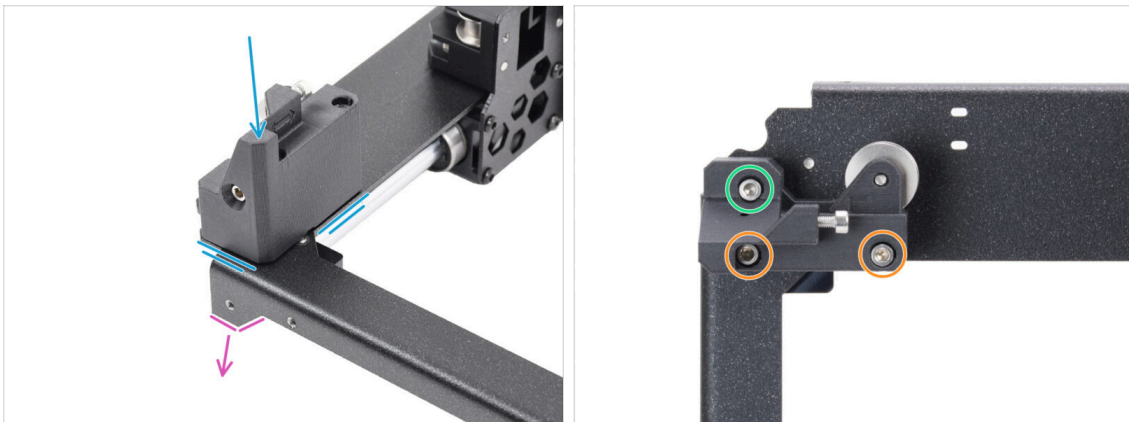


- ◆ Turn the CoreXY assembly upside down so that the bent parts face downward. Focus on the front left corner on the assembly.
- ◆ Place the belt-tensioner-**left** assembly in the front left corner of the CoreXY plate. Align it with the front and inner side edges.
 - ◆ Line up the holes in both parts.
 - ◆ Secure the part with two M3x30 screws.
 - ◆ Insert and tighten one M3x18 screw.

SCHRITT 31 Installieren des Belt-tensioner-right

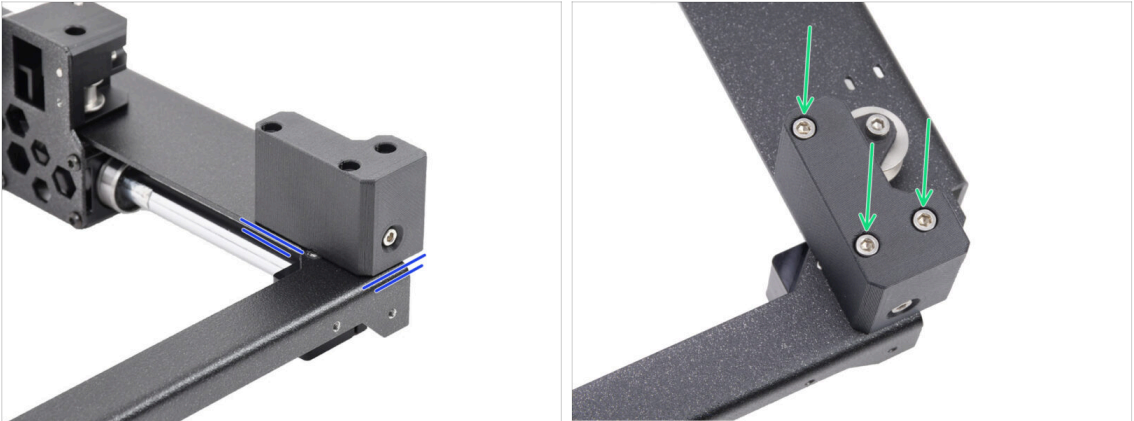


- Place the belt-tensioner-**right** assembly in the front right corner. Align it with the front and inner side edges.
- Line up the holes in both parts.
- Secure the part with three M3x30 screws.

SCHRITT 32 Linear rail: parts preparation

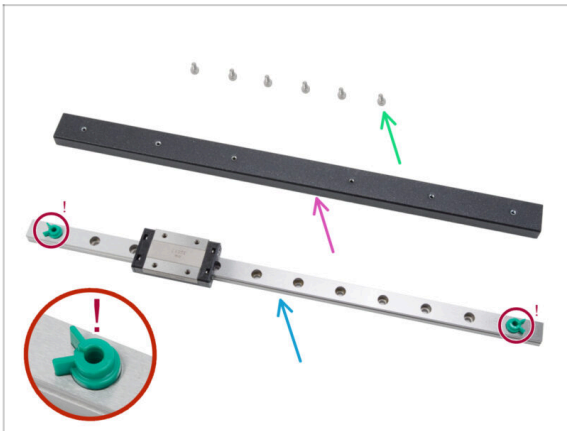

- For the following steps, please prepare:
 - Schraube M3x6 (6x)
 - Linear rail beam (1x) *found in the Metal parts 3/3 package*
 - Linear rail (1x) *found in the Electronics & Chamber parts package*
- ⚠ **Entfernen Sie unter keinen Umständen die Sicherungsstifte gegen Herausfallen.** Warten Sie auf die Aufforderung in der Anleitung.
- Piece of cloth or a paper towels to wipe the preservative lubricant from the linear guide.


SCHRITT 33 Attaching the linear rail

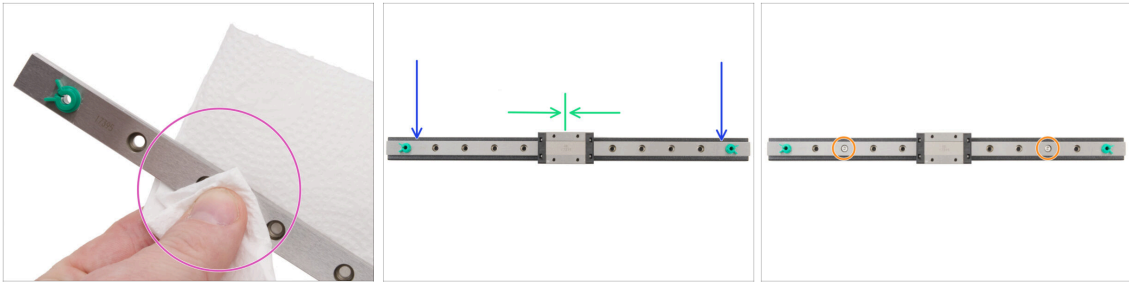

⚠️ Entfernen Sie unter keinen Umständen die Sicherungsstifte gegen Herausfallen. Warten Sie auf die Aufforderung in der Anleitung.

- 🟡 Immediately after removing the linear guide from the package, wipe off the preservative lubricant with a paper towel.
- 🟢 Place the linear rail on the linear rail beam and line up the holes in both parts.
- 🟢 Move the linear carriage approximately to the center of the rail.
- 🟠 Insert and slightly tighten two M3x6 screws into the third holes from both ends.

SCHRITT 34 Securing the linear rail

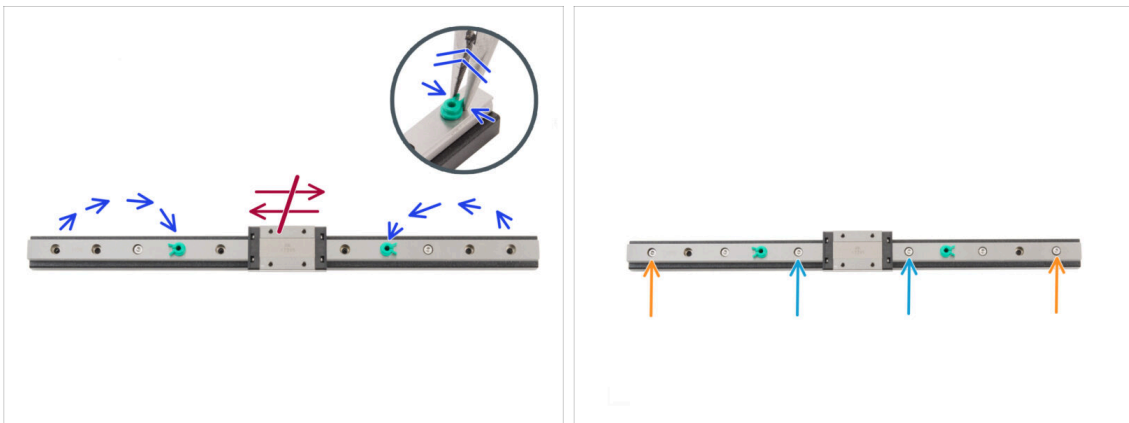


⚠️ Do not move the linear carriage in any way in this step.

- 🟢 Relocate the safety pins from each end to the fourth holes from the ends of the linear rail.
- ⬛ Gently squeeze the safety pin with needle-nose pliers and pull it out.
- 🟢 Insert two M3x6 screws into the fifth holes from the ends of the rail. **Tighten just slightly.**
- 🟠 Insert two M3x6 screws into the first holes in the rail. **Tighten just slightly.**

⚠️ Do not remove the safety pins from the rail.

SCHRITT 35 Installing the linear rail: parts preparation

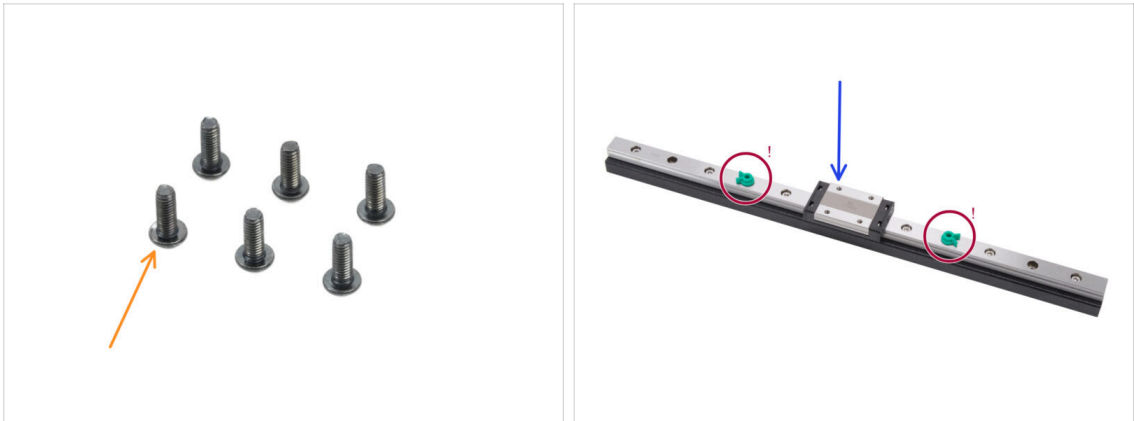

For the following steps, please prepare:


Schraube M3x8rT (6x)

i There are both M3x8rT and M3x8 screws in the kit. Make sure you have prepared the correct ones.

Linear rail assembly (1x) *you assembled earlier*

! Do not remove the safety pins.

SCHRITT 36 Installing the linear rail assembly

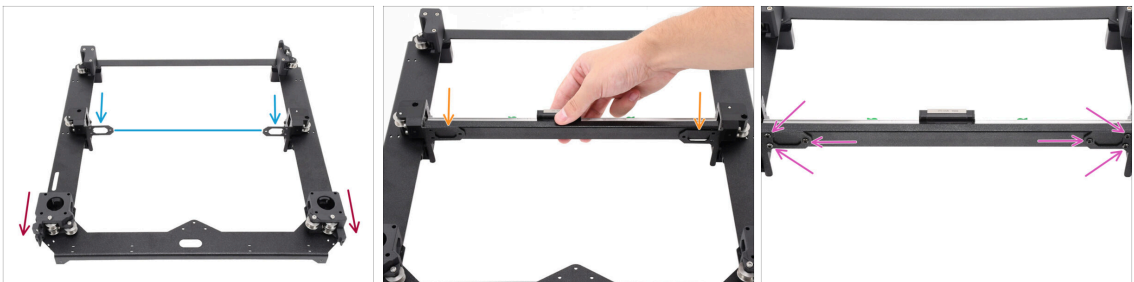


Position the assembly with the motor mounts facing you.

Move both linear holders approximately to the center of the Y-axis.

Attach the linear rail assembly to the holders from the front side of the assembly.


Secure it with three M3x8rT screws from the back side on both the left and right sides.

SCHRITT 37 Linear rail: removing the safety pins

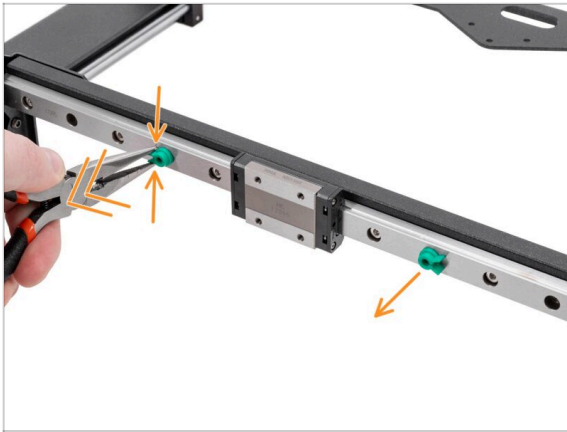

- Gently squeeze both safety pins with needle-nose pliers and pull them out of the linear rail.
- i You can discard the safety pins as they are no longer needed.

SCHRITT 38 Bed-stop: Vorbereitung der Teile

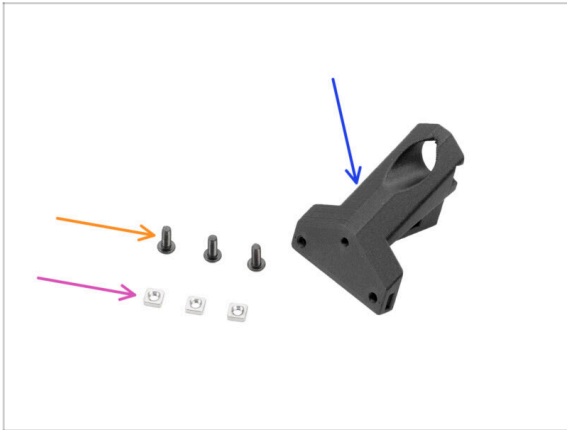

- **For the following steps, please prepare:**
- Bed-stop-rear (1x) *found in the Printed parts package*
- M3nS Mutter (3x)
- Schraube M3x8rT (3x)

SCHRITT 39 Zusammenbau des Bed-stop




- Insert two M3nS nuts into the bed-stop from one side.
- Insert one M3nS nut into the bed-stop from the other side.

SCHRITT 40 Anbringen des Bed-stop



- Position the CoreXY assembly as shown, ensuring the motor mounts face upwards.
- Focus on the triangle protrusion on the metal part.
- Insert the bed-stop-rear **under** the protrusion at the back of the CoreXY plate.
- Align all three holes in both parts.
- Secure both parts together with three M3x8rT screws.
- i** The upper screw is screwed into plastic with no pre-cut thread. It cuts the thread as it's tightened. Slight resistance is expected.

SCHRITT 41 X&Y motors: parts preparation

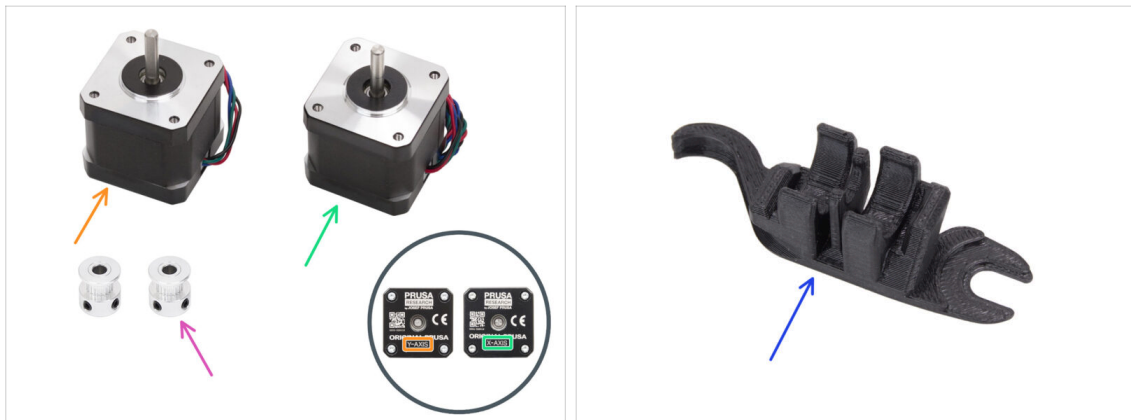

- For the following steps, please prepare:**
- Y-axis motor (1x) *found in the Motors package*
- X-axis motor (1x) *found in the Motors package*
- i** Note that the motors are marked as X and Y-axes in order to distinguish between them. We will continue to follow this marking.
- Pulley T21-1.5GT (2x) *finden Sie im Electronics Paket*
- Assembly-multi-tool (1x) *you already used*

SCHRITT 42 Installing the X-axis pulley



- Prepare the **X-axis** motor.
- Note the flat part on the motor shaft.
- ⚠ Slide the Pulley on, **note the CORRECT orientation.**
- Rotate the motor shaft with the flat part facing you.
- Using the fork on the Assembly-multi-tool set a gap between the pulley and the motor.
- Push the pulley on the tool and firmly tighten the screw against the flat part on the shaft.
- Rotate the pulley and firmly tighten the second grub screw.
- ⚠ Double-check the pulley orientation. **The toothed side of the pulley must be on the motor side.**

SCHRITT 43 Installing the Y-axis pulley



- Prepare the **Y-axis** motor.
- Note the flat part on the motor shaft. Rotate the motor shaft with the flat part facing you.
- ⚠ Slide the Pulley on, and **note the CORRECT orientation. The Y-axis pulley orientation is DIFFERENT from the X-axis. Make sure the pulley teeth face away from the motor. Use the wider hook on the assembly tool.**
- Using the hook on the Assembly-multi-tool, place the thicker curved part between the pulley and the motor.
- ⚠ **Do not try to hook it around the shaft.** Just rest the tool against the motor and make sure the hook tip slides between the motor and the pulley.
- Push the pulley on the tool and firmly tighten the screw against the flat part on the shaft.
- Rotate the pulley and firmly tighten the second grub screw.
- ⚠ **Double-check the pulley orientation. The teeth must face away from the motor.**

SCHRITT 44 XY belts: parts preparation



■ **For the following steps, please prepare:**

- X-axis motor assembly (1x) *you assembled earlier*
- Y-axis motor assembly (1x) *you assembled earlier*
- Nexttruder holder (1x) *found in the CORE XY parts + hinges + HB set package*
- XY belt 1.5GT (2x) *found in the CORE XY parts + hinges + HB set package*
- Schraube M3x35 (8x)

SCHRITT 45 XY Riemen INFO




❗ The next steps cover belt installation and guiding on the core XY assembly. Before starting, refer to the illustration for an overview and better understanding of each belt's path.

- X-axis belt - at the **top position**
- Y-axis belt - at the **bottom position**


■ Let's guide the belts step by step...

SCHRITT 46 Y belt guiding: Y motor pulley

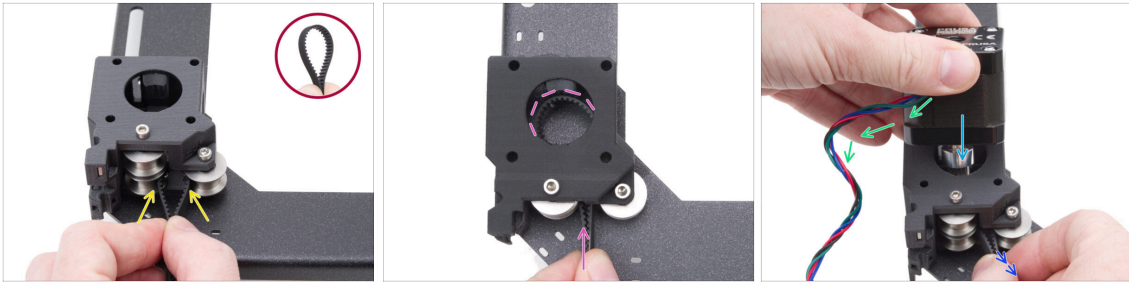

- From the back of the CoreXY, focus on the motor-mount on the **left** side.
- Create a loop anywhere on the belt so the **belt teeth are pointing inside** the loop.
- Push this loop through the space between the lower pulleys inside the motor mount.
- Push through enough to make the loop follow the top round hole of the motor-mount as closely as possible.
- Insert the **Y** motor into the motor holder, the pulley must be in the middle of the belt loop.
- Insert the Y motor pulley into the motor mount, ensuring the pulley is centered within the belt loop.
Fully attach the motor to the motor-mount with the motor cable facing you.
- Pull lightly on the belt loop to encircle the pulley.

SCHRITT 47 Securing the Y-axis motor

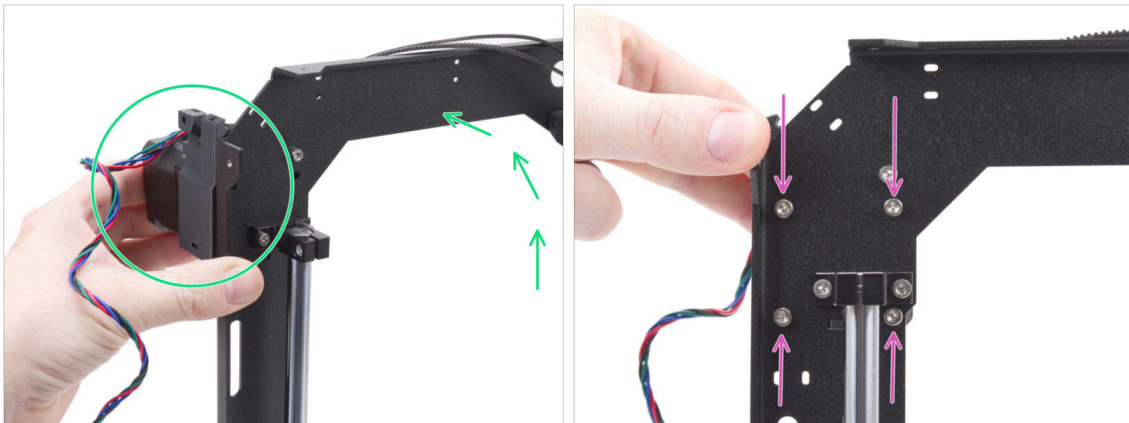

- Firmly grasp the Y-axis motor assembly and position the CoreXY assembly vertically. **Do not drop the motor!**
- ⚠ Be careful not to pull the entire belt out of the motor.
- Keep holding the motor with one hand. With the other hand, secure the motor using four M3x35 screws on the underside of the frame. **Tighten firmly.**
- Place the CoreXY assembly back into the horizontal position.

SCHRITT 48 Y belt guiding: Y motor mount




- 🟡 Guide the left end of the belt around the lower left pulley.
- 🟣 Push the belt through the part and guide it to the front of the CoreXY plate.
- ⚠️ **Don't pull too long so you don't pull the whole belt out.** Remember that the other end is loose. The whole process would then have to be repeated.

SCHRITT 49 Y belt guiding: belt tensioner




- 🟡 Guide the belt around the pulley in the belt tensioner.
- 🟣 Push the belt around the front pulley in the linear assembly.
- 🟢 Prepare the Nextruder holder in the same orientation as in the picture. Note the holes for securing the belts.
- 🟠 Push the end of the belt through the middle hole into the left hole in the bottom row - leave 4-5 teeth sticking out.
- ⬛ The belt is secured on this end. You can leave it free for now.
- 📘 If it is difficult to reach the Nextruder holder with the belt, try temporarily loosening the belt tensioner screw on the front of the assembly.

SCHRITT 50 Y belt guiding: X motor mount

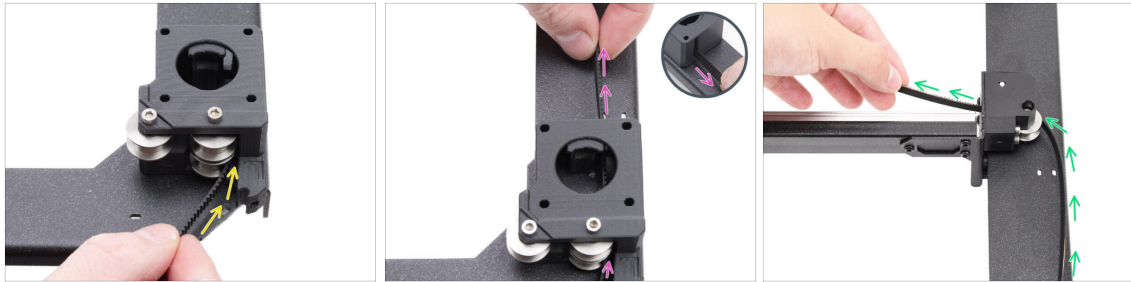


- ⬛ Back to the other end of the Y belt.
- 🟡 Take the other end of the belt and guide it around the lower pulley in the X motor mount.
- 🟣 Push it through the motor mount to the front.
- 🟢 Route the belt around the lower right pulley in the linear rail holder.

SCHRITT 51 Y belt guiding: securing the belt

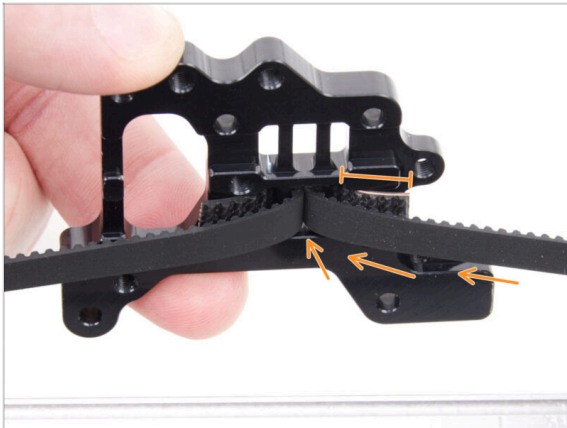


- 🟠 Push the end of the belt through the middle hole to the right hole in the bottom row of the Nextruder holder - leave 4-5 teeth sticking out.
- 📌 ⓘ If it is difficult to reach the Nextruder holder with the belt, try loosening the belt tensioner screw on the front of the assembly.
- 📌 ⚠ Don't forget to adjust it back after securing the belt.

SCHRITT 52 X belt guiding: X motor pulley

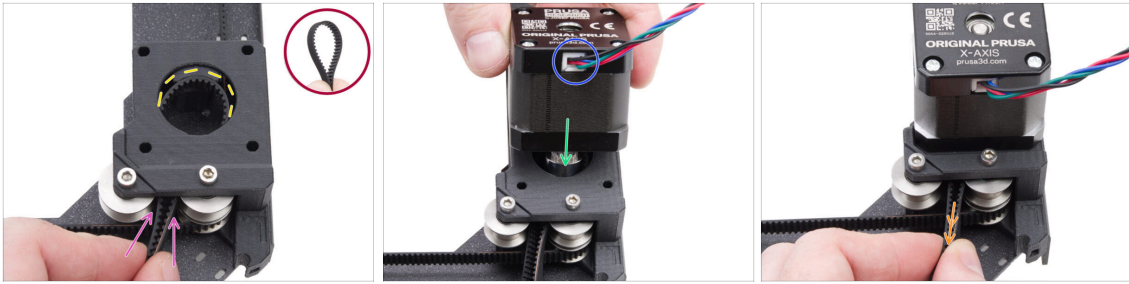

- From the back of the CoreXY, focus on the motor-mount on the **right** side.
- Create a loop anywhere on the second belt so the belt teeth are pointing inside the loop.
- Push this loop through the space between the upper pulleys inside the motor mount.
- Push through enough to make the loop follow the top round hole of the motor-mount as closely as possible.
- Insert the **X** motor pulley into the motor mount, ensuring the pulley is centered within the belt loop.
- Ensure the motor cable is facing you (rear).
- Pull lightly on the belt loop to encircle the pulley.

SCHRITT 53 Securing the X-axis motor

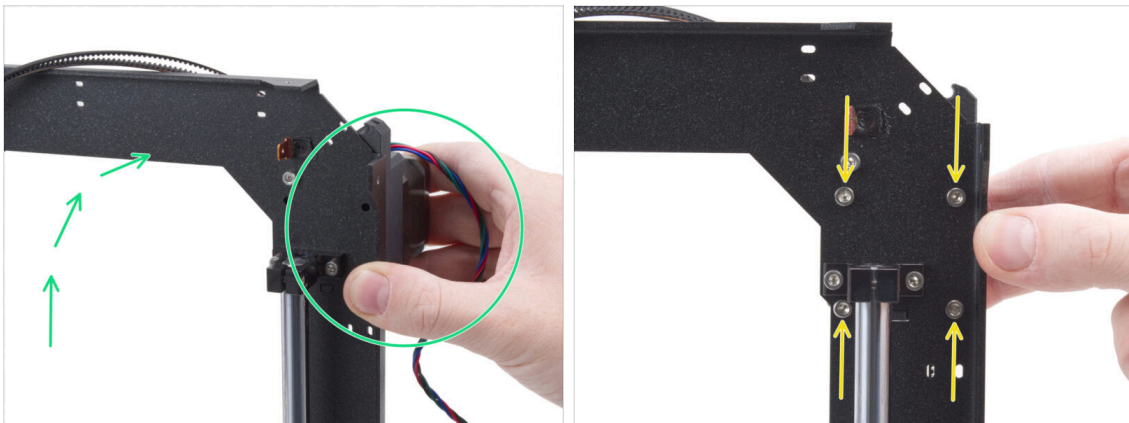

- Firmly grasp the X-axis motor assembly and position the CoreXY assembly vertically. **Do not drop the motor!**
- ⚠ Be careful not to pull the entire belt out of the motor.
- Keep holding the motor with one hand. With the other hand, secure the motor using four M3x35 screws on the underside of the frame. **Tighten firmly.**
- Place the CoreXY assembly back into the horizontal position.

SCHRITT 54 Y belt guiding: X motor mount




- Guide the right end of the belt around the upper right pulley.
- Push the belt through the part and guide it to the front of the CoreXY plate.
- ⚠ **Don't pull too long so you don't pull the whole belt out.** Remember that the other end is loose. The whole process would then have to be repeated.

SCHRITT 55 X belt guiding: belt tensioner



- Guide the belt around the pulley in the belt tensioner.
- Push the belt around the front upper pulley in the linear assembly.
- Route the end of the belt through the middle hole into the right hole - leave 4-5 teeth sticking out.
- ⓘ The belt is secured on this end. You can leave it free for now.

SCHRITT 56 X belt guiding: Y motor mount

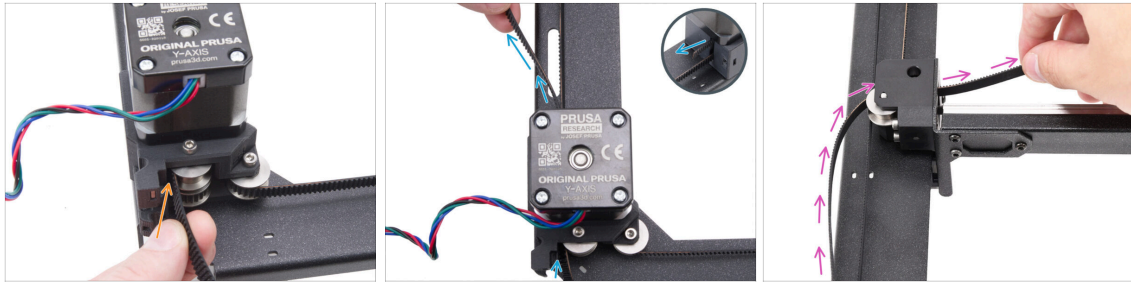

- Back to the other end of the X belt.
- Take the other end of the belt and guide it around the upper pulley in the Y motor mount.
- Push the belt through the motor mount.
- Route the belt around the upper front pulley in the linear rail holder.

SCHRITT 57 X belt guiding: securing the belt





- Push the end of the belt through the middle hole to the left hole in the upper row of the Nextruder holder - leave 4-5 teeth sticking out.

SCHRITT 58 Checking the belt guidance



Before proceeding, recheck the belt routing according to the illustration.


SCHRITT 59 Bowden guide: parts preparation

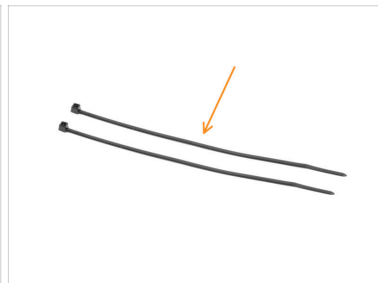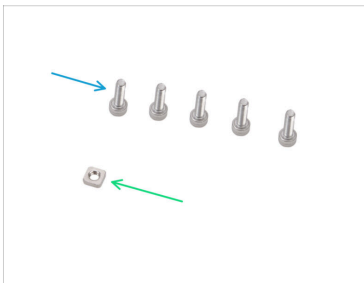

● For the following steps, please prepare:

- Bowden-guide (1x) *found in the Printed parts package*
- Schraube M3x10 (5x)
- M3nS Mutter (1x)
- Kabelbinder (2x)


SCHRITT 60 Securing the Nextruder holder

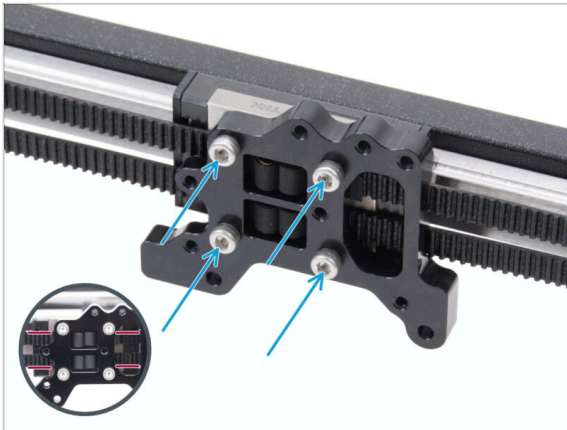

- Attach the Nextruder holder to the linear rail carriage and secure it using four M3x10 screws.


CAUTION: Ensure no belt obstructs the screw. Avoid screwing through the belt!

SCHRITT 61 Securing the Y motor cable

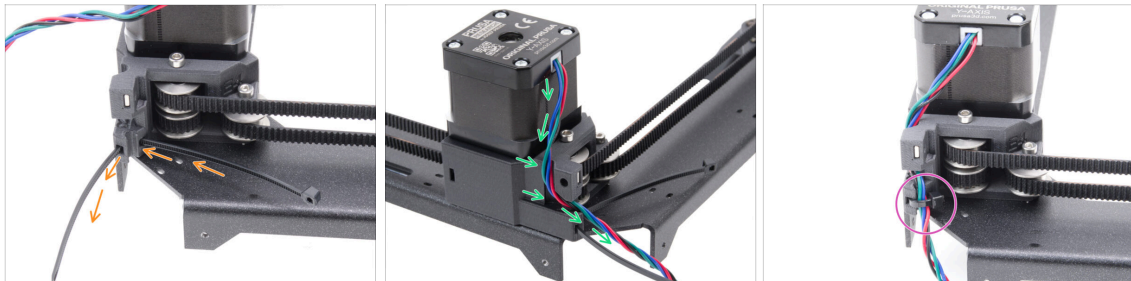


- Push the zip tie through the motor-mount-right.
- Route the Y motor cable through the cable channel in the motor-mount-right and over the zip tie.
- Secure the cable with a zip tie and trim the excess.

SCHRITT 62 Securing the X motor cable

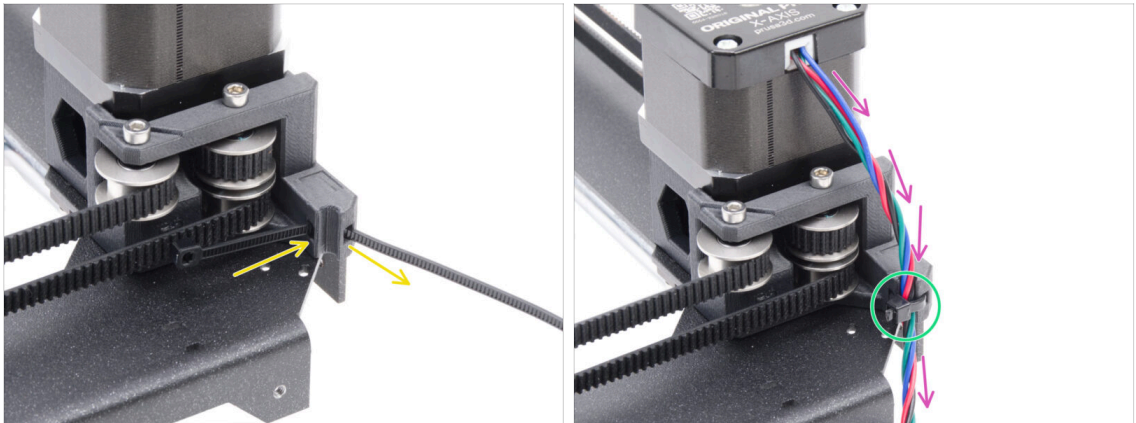

- ✚ Push the zip tie through the motor-mount-left.
- ✚ Route the X motor cable through the cable guide in the motor-mount-left and over the zip tie.
- ✚ Secure the cable with a zip tie and trim the excess.

SCHRITT 63 Installing the bowden guide

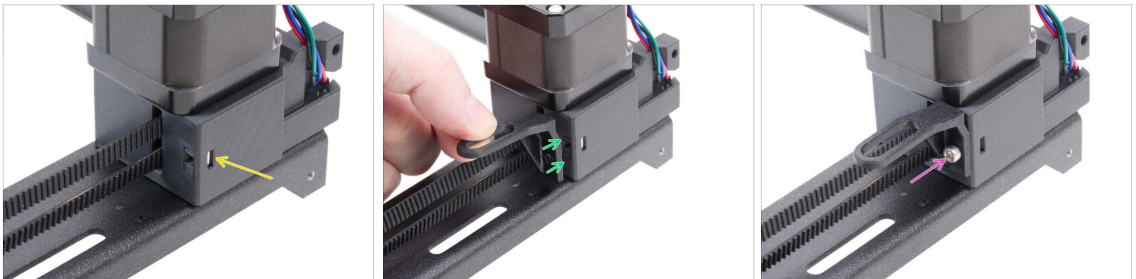

- ✚ Insert the M3nS nut into the motor-mount-right.
- ✚ Attach the bowden-guide to the motor-mount-right.
- ⚠ Note the correct orientation of the part.
- ✚ Fix the bowden-guide in place using the M3x10 screw.

SCHRITT 64 White LED strip: parts preparation



For the following steps, please prepare:

White LED strip (1x) found in the Electronics & Fasteners package

CoreXY strut (1x) found in the Metal parts 1/3 package

i The part is inserted in a foam cutout and may not be immediately visible at first glance.

Schraube M3x4rT (2x)

SCHRITT 65 Sticking the White LED strip



Carefully peel off the protective (paper) layer from the White LED strip.

! After removing the protective layer, the LED strip is adhesive.


Position the White LED strip near the CoreXY strut to check alignment, but **do not attach it yet**.

! Note the rectangular cutout on the strut, orient the strip cable to the same side.

Stick the White LED strip evenly to the strut - on the side with the rectangular cutout.

After sticking, press lightly on the blank areas of the strip to ensure adhesion. **Do not touch LEDs and resistors!**

SCHRITT 66 Installing the white LED assembly

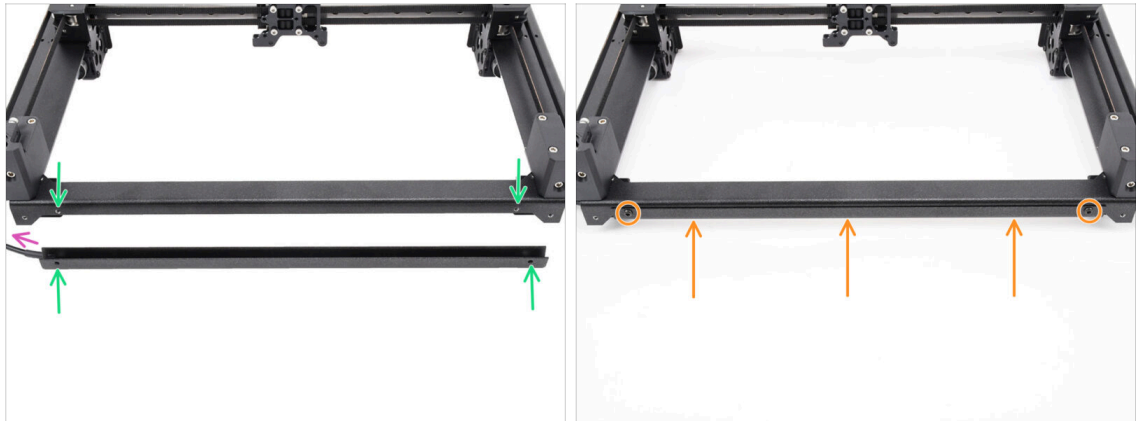


- Take the white LED assembly and attach it to the front of the CoreXY assembly. Align the holes of both parts.
- **The white LED strip cable must point to the left.**
- Attach the LED assembly to the CoreXY plate and secure it with two M3x4rT screws.

SCHRITT 67 Door sensor & White LED strip: parts preparation



- **For the following steps, please prepare:**
- Türsensor (1x) befindet sich im Cables 1/3 Karton, der sich im Electronics and Fasteners Karton befindet.
- M2.5x10 screw (1x) silver
- Kabelbinder (4x)

SCHRITT 68 Inserting the zip ties

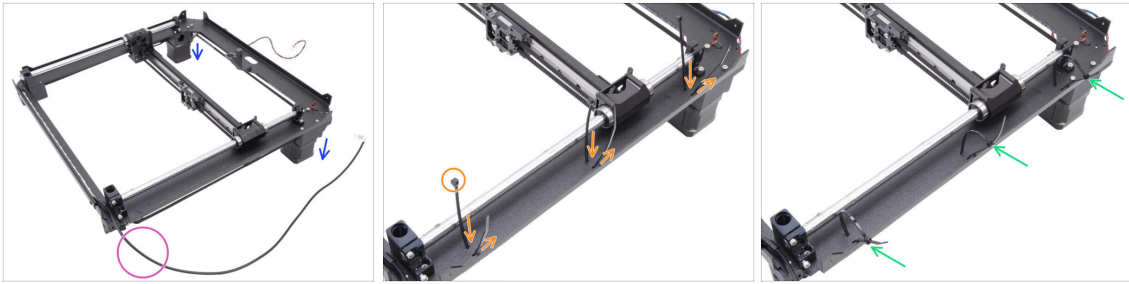


- ◆ Flip the CoreXY assembly upside down and rest it on the motors.
- ◆ Position it with the white LED strip cable facing toward you.
- ◆ Thread three zip ties through the CoreXY plate, ensuring the zip tie heads point inward. **Make sure that the zip ties do not catch the belts from the other side.**
- ◆ Partially tighten the zip ties—just enough to catch the first few teeth.
- ⚠ **Do not fully secure them yet, as we will route cables through them later.**
- ◆ Flip the assembly back with the motors facing upwards.

SCHRITT 69 Installing the door sensor



- ◆ Place the door sensor on the left belt tensioner. The lever of the door sensor must face forward.
- ◆ Secure the door sensor with the M2.5x10 screw.
 - ◆ Tighten the bolt fully and then loosen 1/4 turn. The sensor must be allowed to move.
- ◆ From the rear of the belt tensioner, tighten the M3x12 screw so that it touches the door sensor.

SCHRITT 70 Securing the door sensor cable

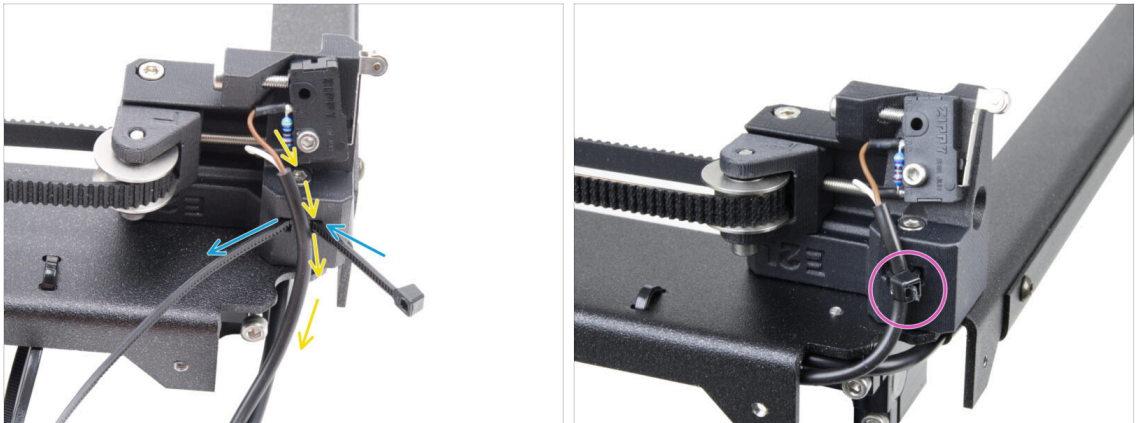


- ◆ Push the zip tie through the hole in the left belt tensioner.
- ◆ Guide the door sensor cable through the zip tie.
- ◆ Tighten the zip tie to secure the door sensor cable. Cut off the excess.

SCHRITT 71 Guiding the cables: LED and door sensor



- ◆ Prepare a cardboard box. You can use any box from the kit. *The box used in the picture is for illustrative purposes only.*
- ◆ Flip the CoreXY assembly upside down, positioning the smooth rods on top.
- ◆ Slightly lift and support the front side of the CoreXY assembly with the cardboard box.
- ⚠ **Be careful not to damage the door sensor.**
- ◆ Route the white LED strip cable and the door sensor cable through the zip ties.
- ◆ Tighten all the zip ties to secure the cables. Cut off the excess zip ties.
- ⓘ **If you plan on adding the Buddy camera, do not tighten the zip ties all the way.** As you will be adding another USB-C cable to the zip ties soon.
- ◆ **Cables must be slightly taut and straight.** Excess slack or bends may cause collisions with the Y-axis and lead to damage.

SCHRITT 72 Buddy3D Kamera Hinweis

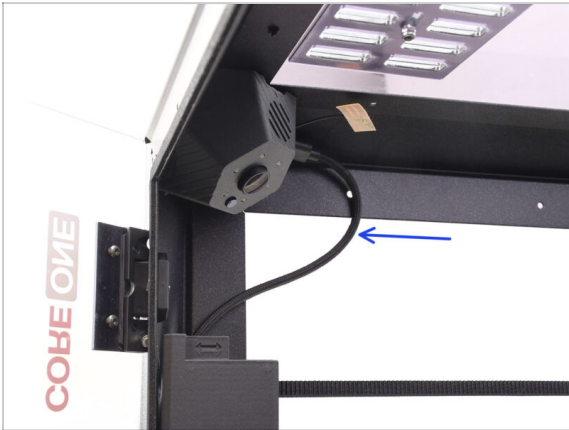

- For future Buddy3D Camera users only. **Skip this step if you are not planning to install the Buddy3D Camera.**



⚠ Disclaimer: Typically, the printer must be fully assembled and tested before any add-ons can be installed. Choosing to install the Buddy3D Camera USB cable now will save you time later on.



For detailed information on cable placement, refer to the separate guide.

- The above-mentioned guide on how to install the Buddy3D Camera shows the printer in a further stage of assembly.
- For now, use the guide to make sure that the cable is installed correctly and tighten the zipties.
- i** We will let you know later on when to return to the guide and finish the Buddy camera installation.

SCHRITT 73 Smooth rods: parts preparation

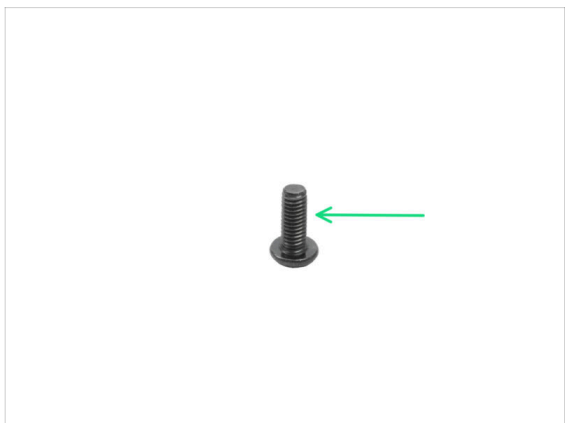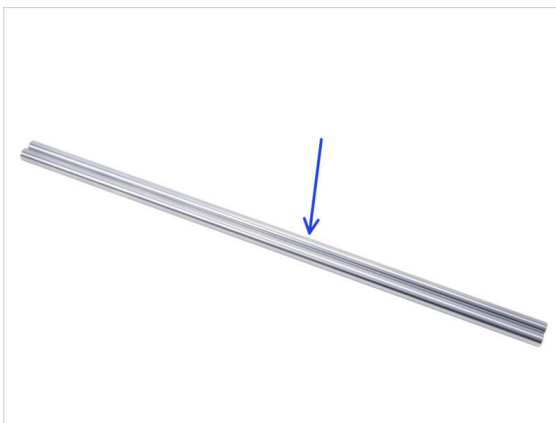


- For the following steps, please prepare:**
 - Smooth rod 330 x 8 mm (2x) *found in the Rods box*
 - Schraube M3x8rT (1x)

SCHRITT 74 Installing the CoreXY assembly




- ⬢ Carefully insert both smooth rods through the heatbed assembly bearings and into the rod mount part in the base assembly.
 - ⚠ **It is a requirement to insert the smooth rod in the axis with the bearing very slowly to prevent the balls from shooting out of the bearing.**
- ⬢ Temporarily hang the cables from the cooling fans over the rear panel. **There must be a space between the cables and the back panel pocket.**
- ⬢ Exercise extreme caution when placing the assembly on the smooth rods and back panel assembly.
 - ⚠ **Ensure that no cables are pinched.**
 - ⬢ Ensure both smooth rods are properly seated in the rod holders.
 - ⬢ The threaded rod of the rear Z motor must pass through the bed-stop-rear part.
- ⚠ **WARNING: When handling the printer, DO NOT lift it by the CoreXY assembly. Always lift it by the base of the entire assembly.**

SCHRITT 75 Securing the smooth rods

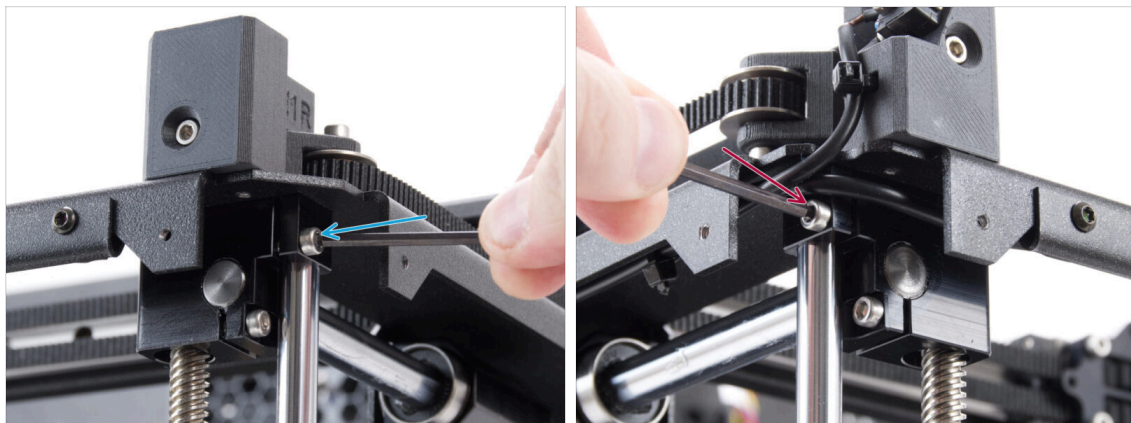


- ⚠ Check that both smooth rods are seated correctly in the holders. **The smooth rods have to be inserted into the holder all the way.**
 - ⓘ If you are not sure, you can **gently** and **carefully** insert a flat screwdriver into the slit and widen it to ensure that the rods are in all the way.
- ⬢ Firmly tighten the right M3x10 screw to secure the smooth rod.
- ⬢ Firmly tighten the left M3x10 screw to secure the smooth rod.

SCHRITT 76 Aligning the linear rail

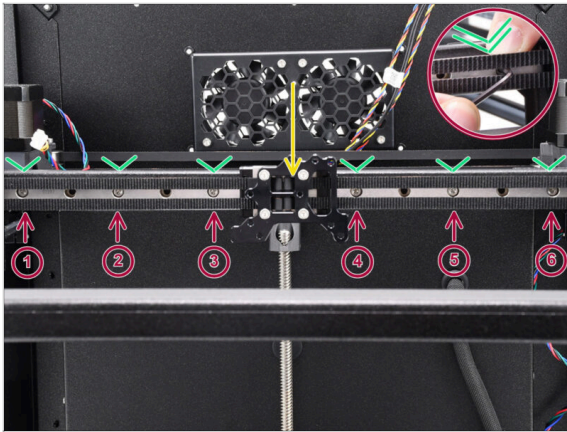

- ✦ Move the linear rail carriage to the center.
- ⚠️ **Firmly tighten all screws in the order shown in the picture.**
- ✦ Push the linear rail down while tightening.

SCHRITT 77 Guiding the corexy cables

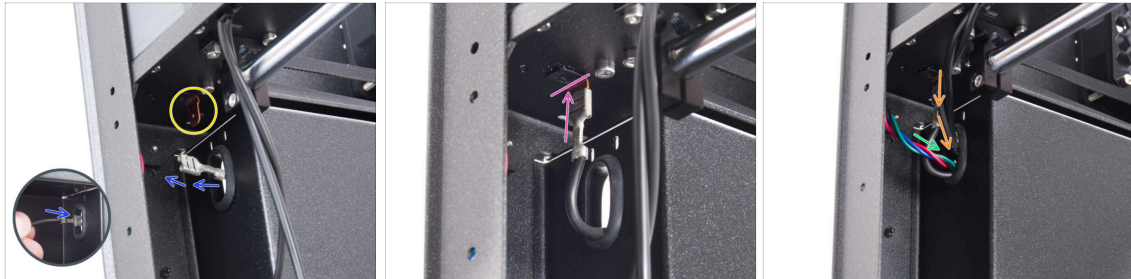


- ✦ From the back of the printer, push the FE connector through the oval hole.
- ✦ Locate the FE cable connector (number 5) in the rear left corner - under the CoreXY assembly.
- ✦ Plug the FE connector onto the Faston on the underside of the CoreXY plate.
- ✦ On the same side, push the X motor cable through the oval hole in the back panel.
- ✦ Push the White LED strip and Door sensor cables through the oval hole in the back panel.

SCHRITT 78 Guiding the cooling fan cables





- Push the cooling fan and thermistor cables through the oval hole in the back panel.
- On the right back corner, locate the Y motor cable and push it through the upper oval hole in the back panel.

SCHRITT 79 Befestigen des Bed-stop

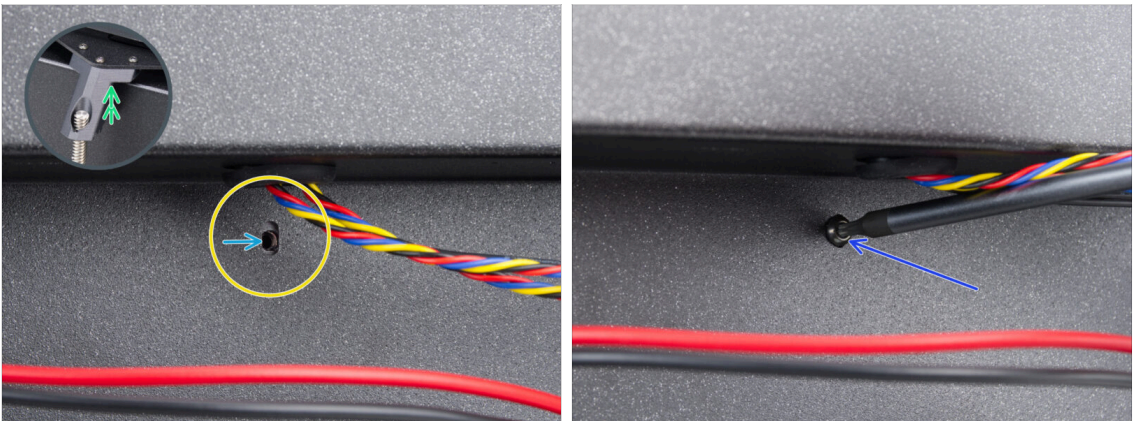



- From the back side, locate the oval screw hole under the cooling fans.
- The oval hole must be flush with the hole in the bed-stop part on the opposite side.
- To compensate, slightly raise the rear of the CoreXY assembly - just a few millimeters.
- After aligning the holes, secure them with an M3x8rT screw.

SCHRITT 80 Connecting the cooling fans cables

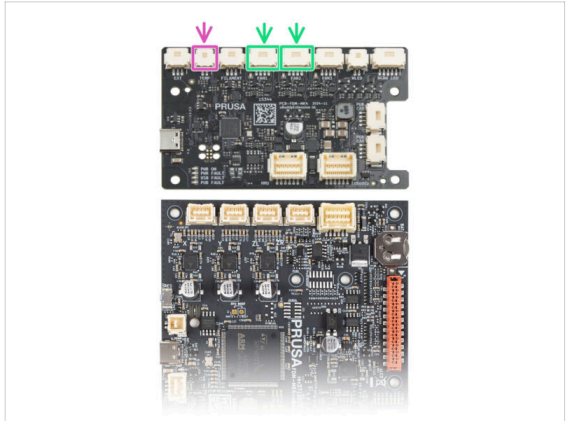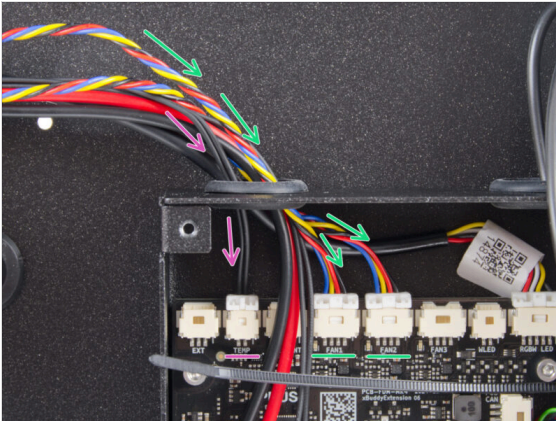


- Route the cooling fan cables through the left hole in the xBuddy box and plug them into the fourth and fifth slots on the xBuddy extension board labeled FAN 1 and FAN 2.
- ❗ The connection order does not matter, both cables are the same.
- Guide the chamber thermistor cable together with the cooling fan cables.
- Connect it to the second slot from the left on the xBuddy extension board labeled TEMP.

SCHRITT 81 Connecting the corexy cables

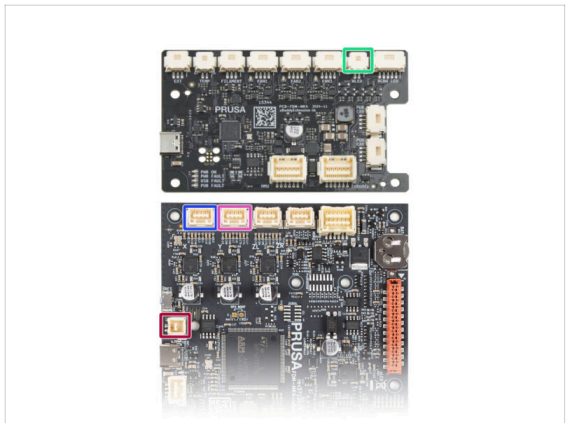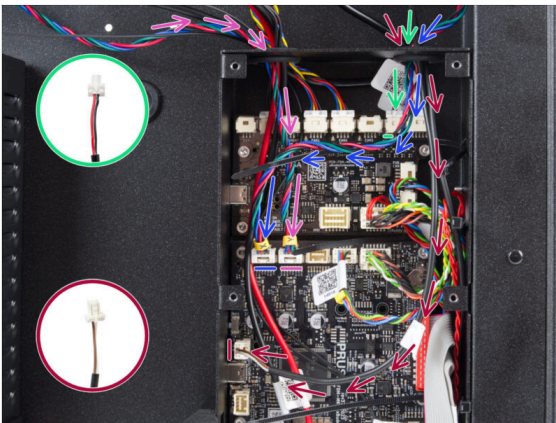

- Guide the X motor cable through the right hole in the xBuddy box. Connect it to the first slot from the left on the xBuddy board.
- Guide the door sensor cable through the right hole in the xBuddy box. Connect it to the lower slot on the left side of the xBuddy board.
- Guide the white LED strip cable through the right hole in the xBuddy box. Connect it to the second slot from the right on the xBuddy extension board.
- Guide the Y motor cable through the left hole in the xBuddy box. Connect it to the second slot from the left on the xBuddy board.

SCHRITT 82 Haribo Zeit!

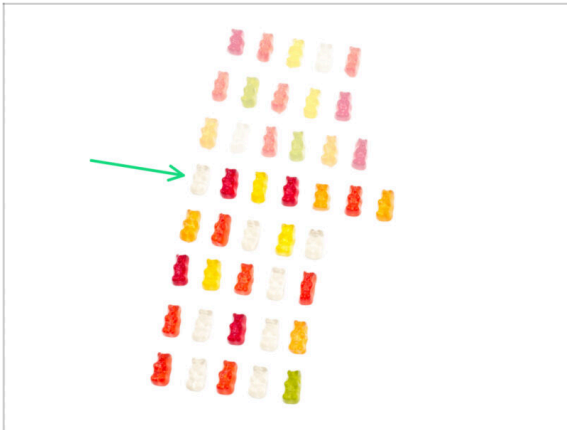


- You deserve to eat the whole bag, but please practice restraint. Eat just the fourth row.

SCHRITT 83 Abgeschlossen




- Congratulations! You have just assembled and installed the CoreXY assembly.
- Let's go to the next chapter.

6. Zusammenbau des Nextruders

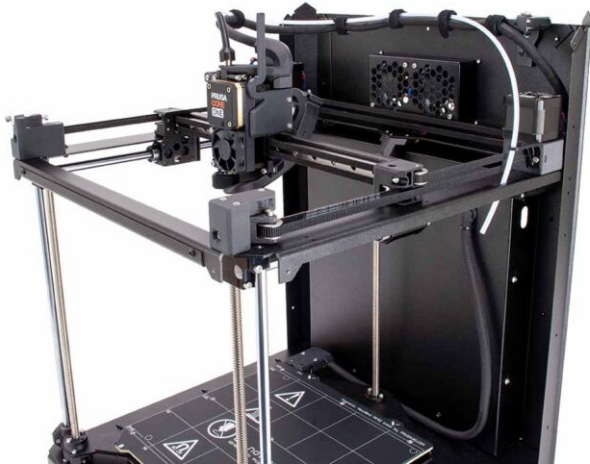


SCHRITT 1 Tool necessary for this chapter

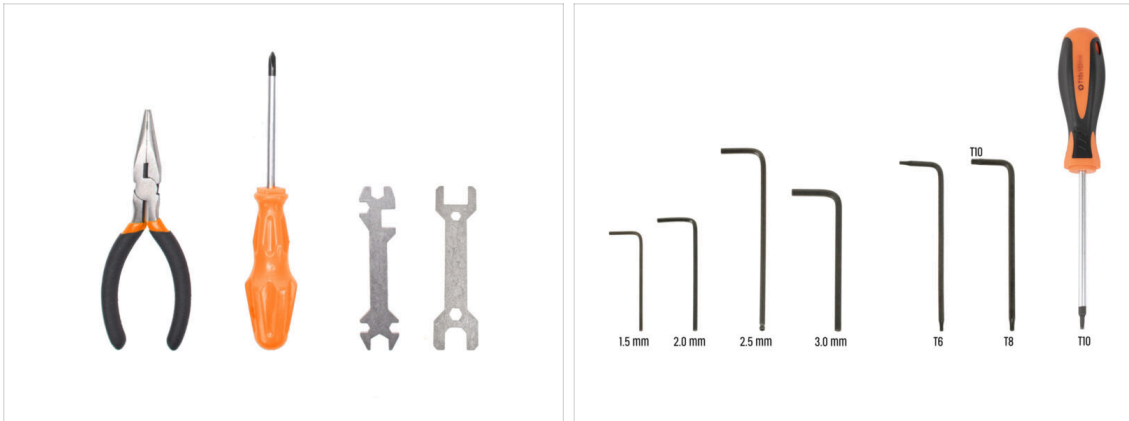

- **For this chapter, please prepare:**
- Universal-Schlüssel
- 1,5mm Innensechskantschlüssel
- 2,5mm Innensechskantschlüssel
- TX6 Innensechsrund Schlüssel
- T10 torx key / T10 torx screwdriver

SCHRITT 2 Nextruder idler assembly: parts preparation

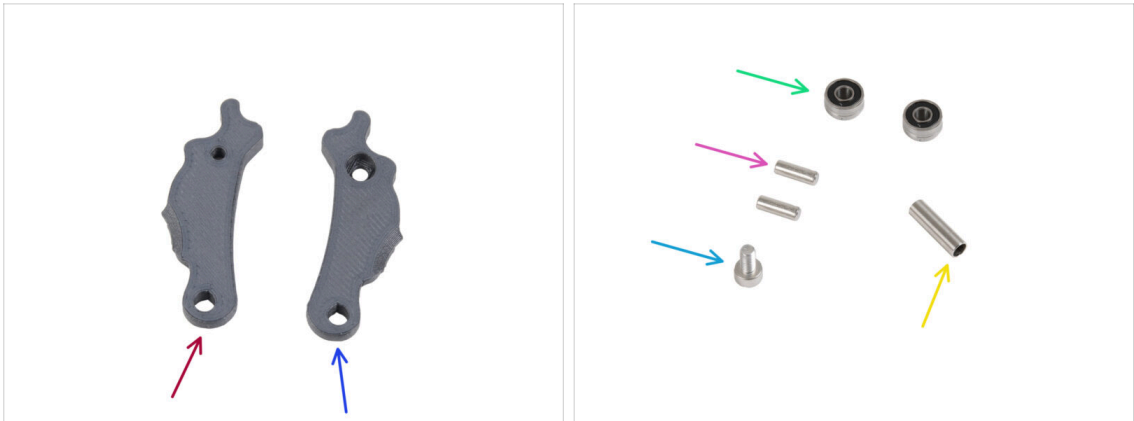

For the following steps, please prepare:

- Idler-lever-a (1x) *found in the Nextruder assembly bag located inside the Electronics box.*
- Idler-lever-b (1x) *found in the Nextruder assembly bag located inside the Electronics box.*
- Bearing 693 2RS (2x) *found in the Electronics package*
- Pin 2.9x8.5 (2x) *found in the Electronics package*
- Schraube M3x6 (1x)
- Tubular spacer 13.2x3.8x0.35 (1x) *found in the Electronics package*

SCHRITT 3 Assembling the extruder idler




- Place both bearings into the Idler-lever-a.
- Insert the pin 2.9x8.5 into each bearing 693 2RS, as seen in the picture.
- Close it up with the Idler-lever-b part and secure it with the M3x6 screw. **Do not overtighten the screw.** Both bearings must be able to rotate without significant resistance.
- From the same side, push the tubular spacer into the assembly. The "bottom" of the tubular spacer must be flush with the bottom part of the Idler assembly.

SCHRITT 4 Assembling the extruder: parts preparation I.




- **For the following steps, please prepare:**
- PG-assembly (1x) *found in the Electronics package*
- Heatsink assembly (1x) *found in the Electronics package*
- Main-plate (1x) *found in the Electronics package*
- PG-ring (1x) *found in the Electronics package*
- PG-assembly-adapter (1x) *found in the Electronics package*
- ① The list continues in the next step...

SCHRITT 5 Assembling the extruder: parts preparation II.

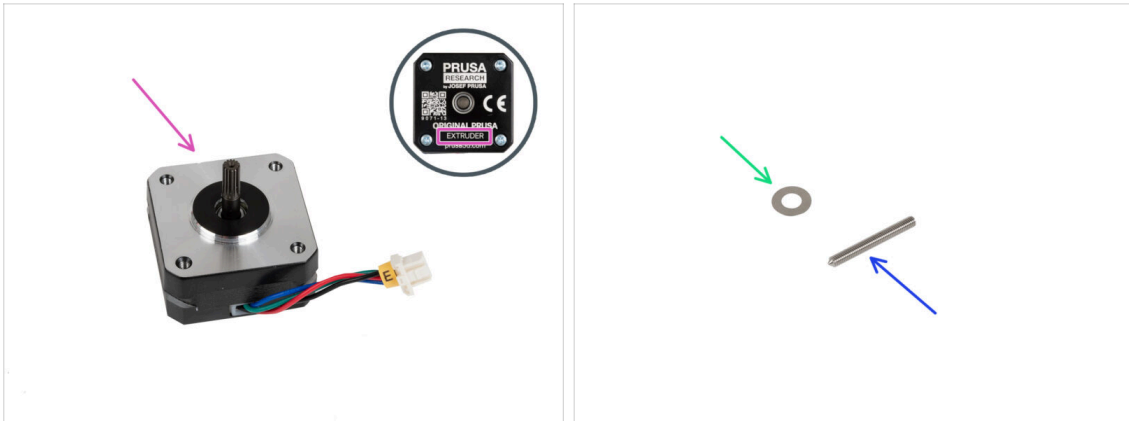


- ◆ Extruder motor (1x) *found in the Motors package*
- ◆ Spacer 5x10x0.1 mm (1x) *found in the Nextruder bag located in the Electronics package*
- ◆ Socket set screw M3x25 (1x) *found in the Electronics & Fasteners package*

SCHRITT 6 Zusammenbau des Extruders

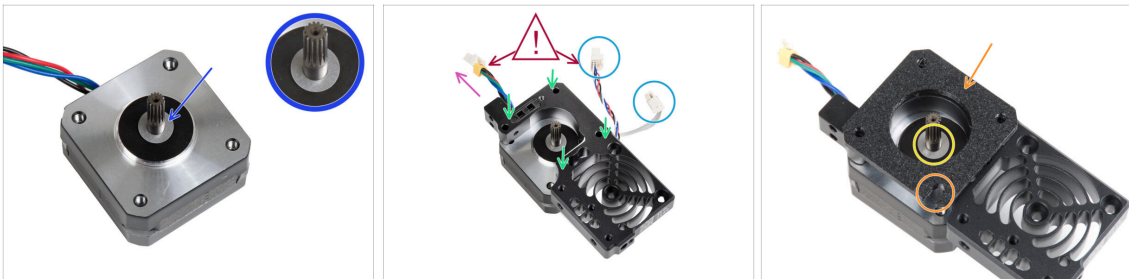


- ◆ Place the 5x10x0.1 spacer over the shaft on the extruder motor.
- ◆ Place the heatsink on the extruder motor. Note the orientation of both parts.
 - ◆ The motor cable must be facing "up".
 - ◆ The heatsink cables must be on the right side.
- ⚠ **Double-check that the motor cable and the heatsink cables are oriented as shown in the photo!**
- ◆ Place the main-plate on the heatsink. Note the orientation of the part. Use the cutout as a guide.
- ◆ Before proceeding to the next step, **make sure that the 5x10x0.1 spacer is placed on the extruder motor.**

SCHRITT 7 Zusammenbau des Getriebes

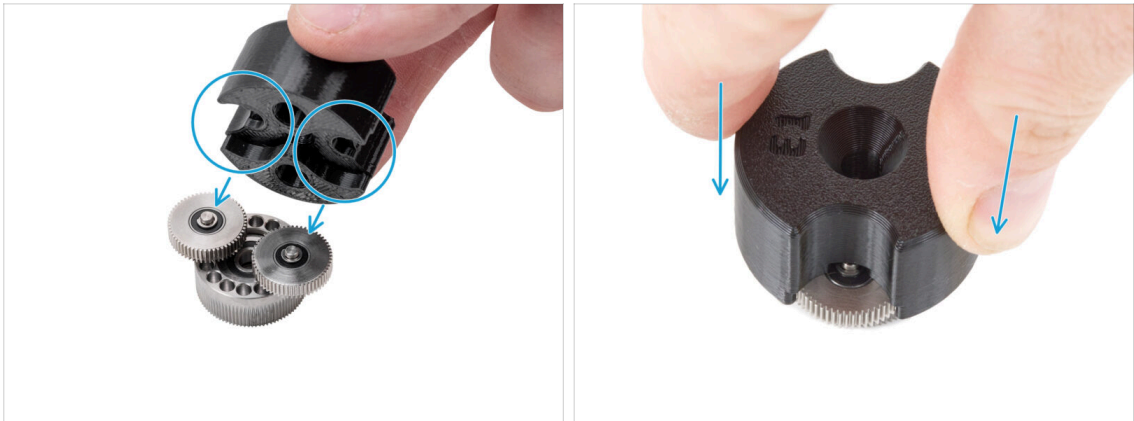


- i** The following instructions need to be done correctly and carefully. Achieve better understanding and successful assembly by watching the video alongside the guide: prusa.io/PG-assembly
- After watching the video, follow the steps in this guide.
 - Attach the PG-assembly-adapter on the PG-assembly. Note the pockets for the gears in the adapter.

SCHRITT 8 Zusammenbau des PG-Rings

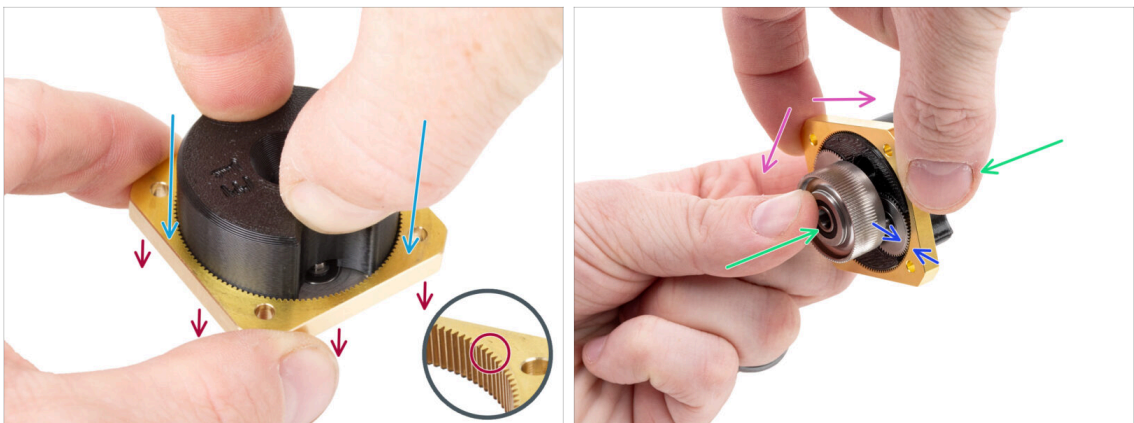

- ⚠ Do not assemble the gearbox without the PG-assembly-adapter. This tool is intended to ensure that the gears are correctly fit together.**
- Slide the PG-ring onto the adapter.
 - Note there is a chamfer on one side of the PG-ring teeth. This side must be facing down (to the PG-assembly).
 - Grasp the entire assembly in one hand so that it can be rotated with the PG-ring.
 - With the other hand, slide the PG-ring onto the PG assembly in a wobbling motion (move the PG-ring left and right repeatedly) - a quarter turn is enough.
 - Stop when the surfaces of the gears are approximately flush with the surface of the PG ring.

SCHRITT 9 Zusammenbau der PG-Baugruppe

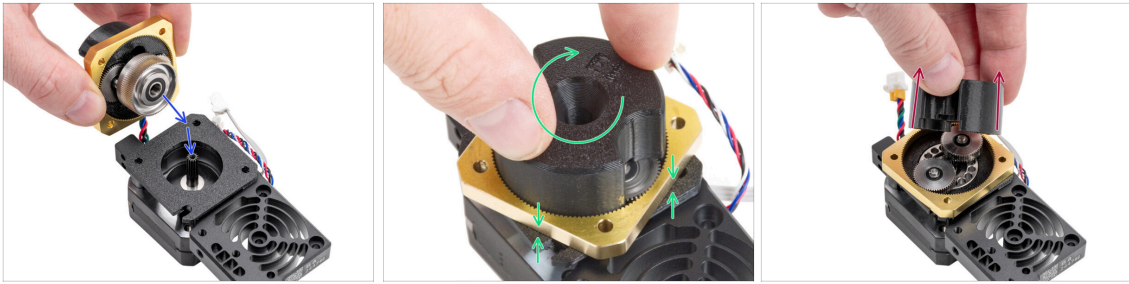

 **Proceed very carefully in this step.**


-  Maintain the position of the PG-assembly and attach it on to extruder motor shaft.
-  Very gently and freely rotate with the whole PG assembly (PG-assembly-adapter, PG-assembly and PG-ring) until it drops down so that there is no gap between the assembly and the main-plate. **Do not push on the assembly.**
-  Entfernen Sie den PG-Montageadapter.

SCHRITT 10 Prüfen der PG-Baugruppe



-  Attach the PG-assembly-adapter back on the PG-assembly again to verify that all parts are properly seated.
-  Rotate with the PG-assembly-adapter. **The PG assembly must be easy to rotate without having to exert much force.**
-  Remove the PG-adapter. You will no longer need it during assembly. We recommend keeping it for maintenance.
-  Ensure that the PG-assembly is not sticking out above the PG-ring. It should be positioned lower than the level of the PG-ring's surface or at the same level as the ring.
-  Ensure that the gap between the PG-ring and the Main-plate is minimal. If a significant gap is observed, disassemble the planetary gear assembly and reposition it.

SCHRITT 11 Assembling the Nextruder idler

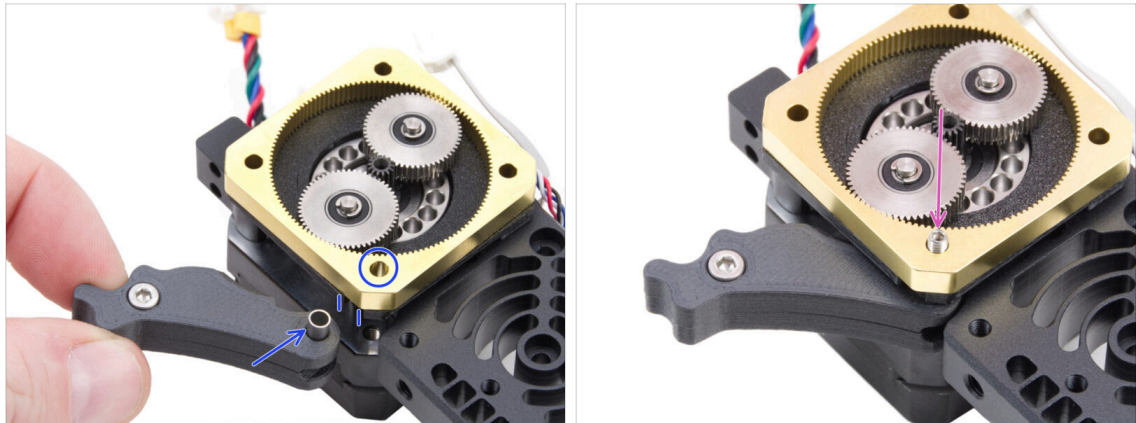

- Insert the idler assembly between the PG-ring and the extruder motor. There is a cutout for the spacer in the main-plate. Line up the idler spacer with the hole in the PG-ring.
- Secure both parts with the socket set screw 3x25. **Do not overtighten the screw! The screw protrudes from the PG-ring after tightening.**

SCHRITT 12 Gear lubrication: parts preparation




- **For the following steps, please prepare:**
- Front Case (1x) *found in the Printed parts package*
 - ⓘ The logo on the Nextruder front case will remain as **PRUSA CORE ONE**.
- Schraube M3x25 (3x)
- Lubricant (1x) *found in the Electronics & Fasteners package*
- Several paper towels to wipe grease from your hands.

SCHRITT 13 Schmieren des Getriebes




- Remove the cap from the lube. Use the spike on the opposite side of the cap to pierce a hole in the lube tube opening.
- Squeeze a small amount of lubricant onto the tip of the zip tie, then spread it over the gears.
- Apply a small amount of Prusa Lubricant **all around** the PG-ring and PG-assembly teeth.
- Close the lubricant; it is no longer needed for the assembly.

SCHRITT 14 Covering the planetary gear

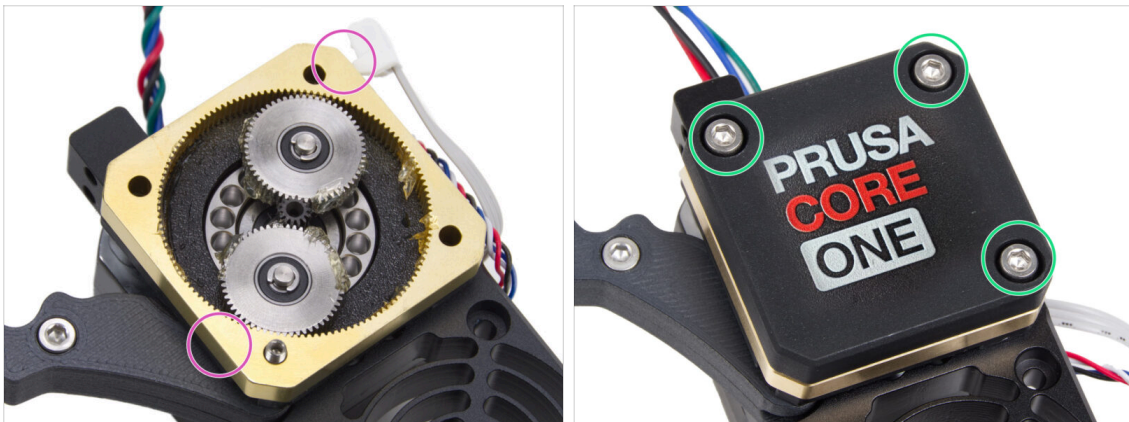

- Using the paper towel, wipe off the lubricant residue from the face surface of the PG-ring.
- Place the front case onto the gearbox and secure it with three M3x25 screws. **Do not tighten them completely** at this moment.
- ① The screws on the front case will be completely tightened during the self-test in the final chapter.

SCHRITT 15 Assembling the Idler-swivel: parts preparation

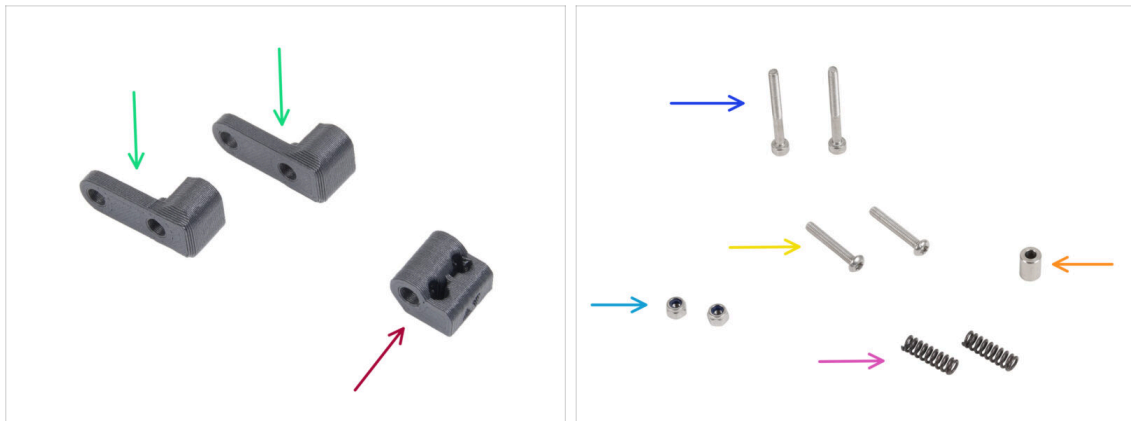

For the following steps, please prepare:

- Idler-swivel (2x) found in the Electronics package
- Idler-nut (1x) found in the Electronics package
- Schraube M3x30 (2x)
- Schraube M3x20rT (2x)
- M3nN Mutter (2x)
- Spring 15x5 (2x) found in the Electronics package
- Spacer 6x3.1x8 (1x) found in the Electronics package

SCHRITT 16 Montieren des Idler-swivels



- Push the M3x20rT screw all the way through one of the idler-swivel.
- Slide the spacer onto the screw.
- Place the second idler-swivel from the opposite side on the screw.
- From the other side, attach the M3nN nut onto the screw. Hold the nut using the universal wrench and tighten the screw. **Tighten just lightly!** The spacer must rotate freely.

SCHRITT 17 Montieren der Idler-Mutter




- ✚ Insert the Idler-nut into the Idler-swivel assembly. Make sure that both parts are oriented correctly according to the picture.
- 🔵 Secure both parts together by inserting the M3x20rT screw from the same side, like the first screw.
- 🟢 Secure the screw with M3nN nut. **Do not overtighten the nut.** It must be possible to move with the Idler-swivel on the Idler-nut.

SCHRITT 18 Mounting the Idler-swivel assembly




- 🟢 Attach the spring 15x5 on both M3x30 screws.
- 🔵 Push the two screws with the springs through the holes in the protrusion on the heatsink. There are no threads inside.
- 🟡 Attach the Idler-swivel assembly on the screws. See the correct orientation of the Idler-nut. The side with version marking must be visible. See the picture.
- ✚ Tighten both screws. **Stop tightening as soon as the screw tips reach the front face of the idler nut.**

SCHRITT 19 NTC thermistor: parts preparation

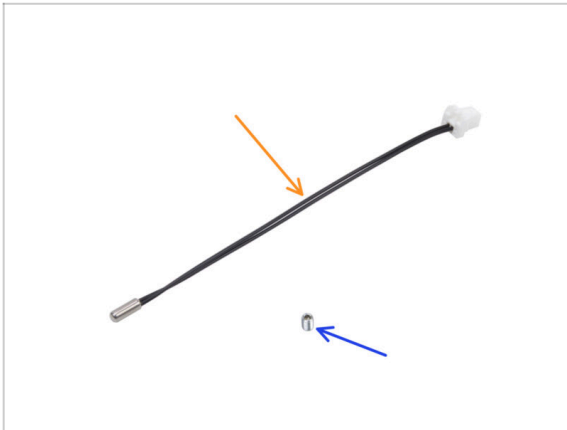


- For the following steps, please prepare:
- NTC thermistor 90 mm (1x) found in the Nextruder box+Heatbed heatsink box located inside the Electronics box.
- M3x4T grub screw (1x)

SCHRITT 20 Assembling the NTC thermistor

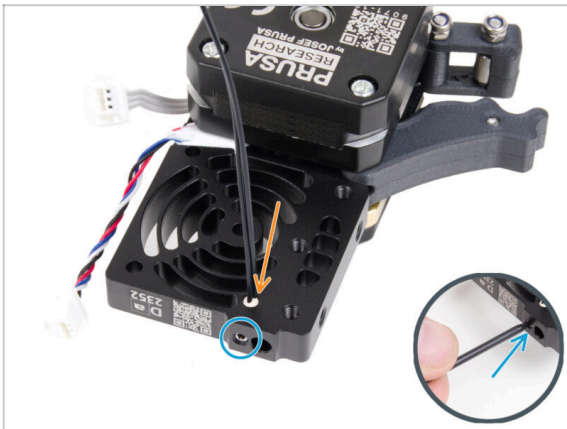

- On the **extruder motor side**, insert the NTC thermistor into the hole in the heatsink.
- Secure it with the M3x4T grub screw. Screw it all the way in. **Tighten gently, but firmly** using two fingers and the short side of the T6 Torx key. Applying more force may cause permanent damage to the thread.

SCHRITT 21 Mounting the Nextruder: parts preparation

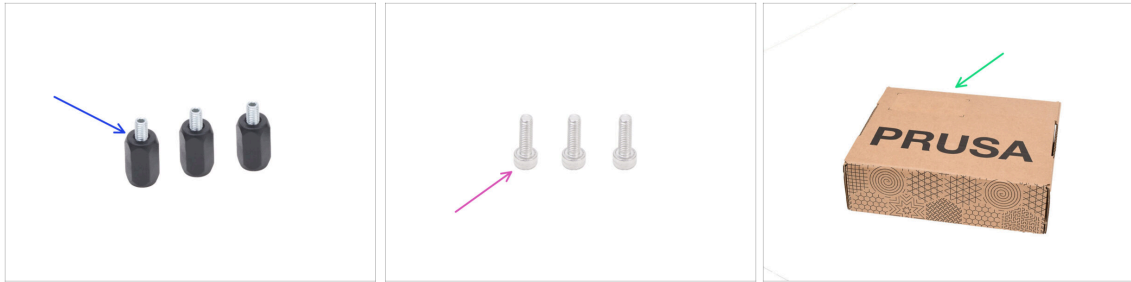


◆ **For the following steps, please prepare:**

- ◆ Nextruder spacer (3x) *found in the Small parts & fasteners bag located inside the Electronics & Fasteners box.*
- ◆ Schraube M3x10 (3x)
- ◆ Cardboard box (1x) *used as temporary heatbed protection*

ⓘ Hint: You can use any cardboard box from the kit package.


SCHRITT 22 Schutz des Heizbettes

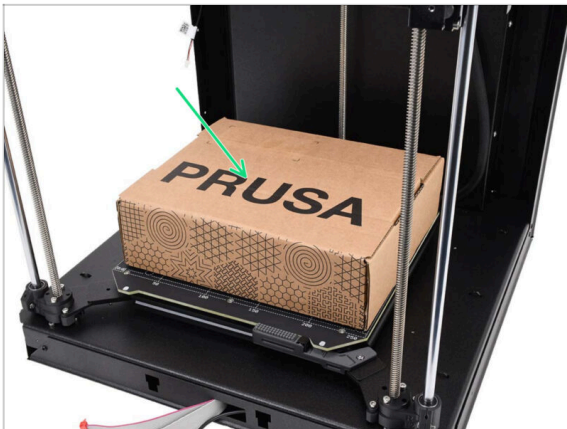

- ◆ Place an empty cardboard box on the heatbed, ensuring it covers as much of the surface as possible.

ⓘ This will protect the heatbed from falling parts.

SCHRITT 23 Befestigen des Nextruders

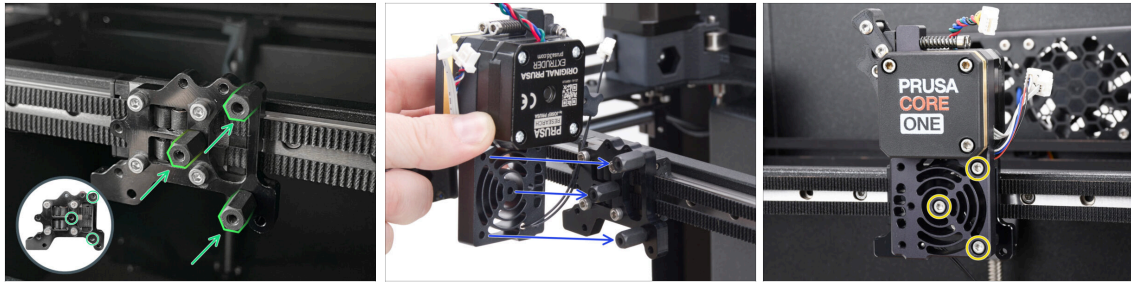


- 🟢 Screw three Nextruder spacers to the Nextruder holder. Tighten the spacers firmly.
- 🟡 Place the Nextruder assembly on the spacers.
- 🟡 Align the holes in the Nextruder with the spacers and secure it with three M3x10 screws. **Do not overtighten the screws.**

SCHRITT 24 Hotend fan: parts preparation




- ⬛ **For the following steps, please prepare:**
- 🟡 Hotend fan (1x) *found in the Electronics package*
- 🟡 Hotend-cable-clip (1x) *found in the Printed parts package*
- 🔴 Schraube M3x4rT (2x)
- 🟢 Schraube M3x18 (2x)

SCHRITT 25 Installing the Hotend fan

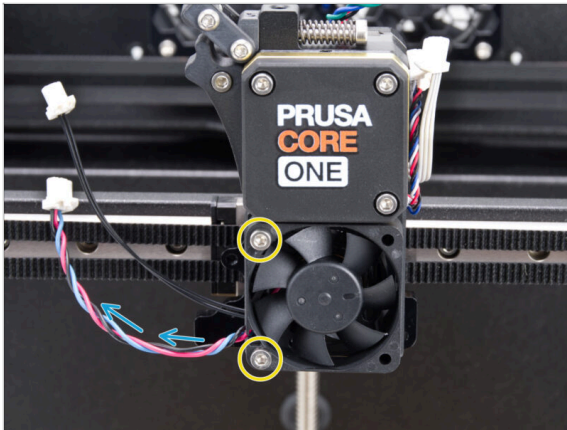

- ✦ Attach the hotend fan onto the heatsink with two M3x18 screws on the left side. **Tighten the screw gently, but firmly, otherwise the plastic housing may crack.**
- ⚠ There is a sticker on the hotend fan, the sticker must be on the rear side of the fan - not visible.
- ✦ The cable must be pointing towards the lower-left corner.

SCHRITT 26 Guiding the Hotend fan cables

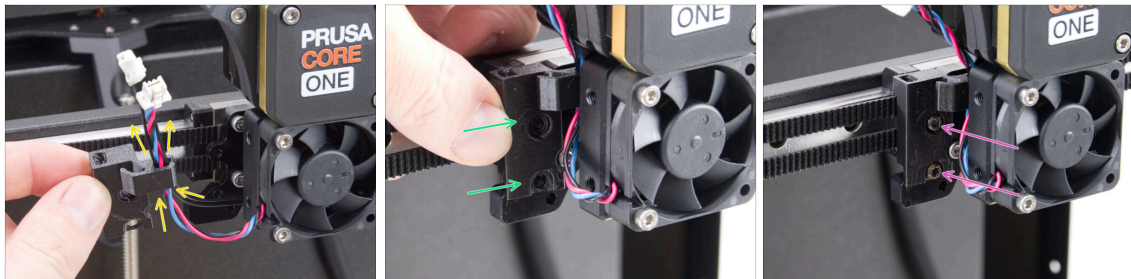

- ✦ Take the Hotend-cable-clip in the same position as shown and guide the **heatsink fan cable** together with the **NTC thermistor cable** through the right cable hook.
- ✦ Attach the Hotend-cable-clip to the Nextruder holder.
- ✦ Secure it using two M3x4rT screws.

SCHRITT 27 LoveBoard: parts preparation I.



● For the following steps, please prepare:


- Printhead-cover (1x) *found in the Printed parts package*
- Loveboard-mount (1x) *found in the Printed parts package*
- Main cable (1x) *found in the Electronics & Fasteners package*

(i) Note: Cable color may vary depending on the batch. This does not affect the procedure.

- Schraube M3x10 (4x)
- Schraube M3x8rT (1x)
- M3nS Mutter (5x)

(i) The list continues in the next step...


SCHRITT 28 LoveBoard: parts preparation II.

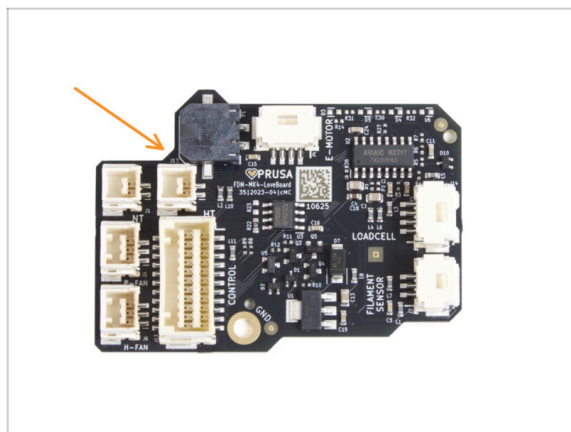

● For the following steps, please prepare:


- LoveBoard (1x) *found in the Electronics package*

SCHRITT 29 Montage des Loveboard-Mounts

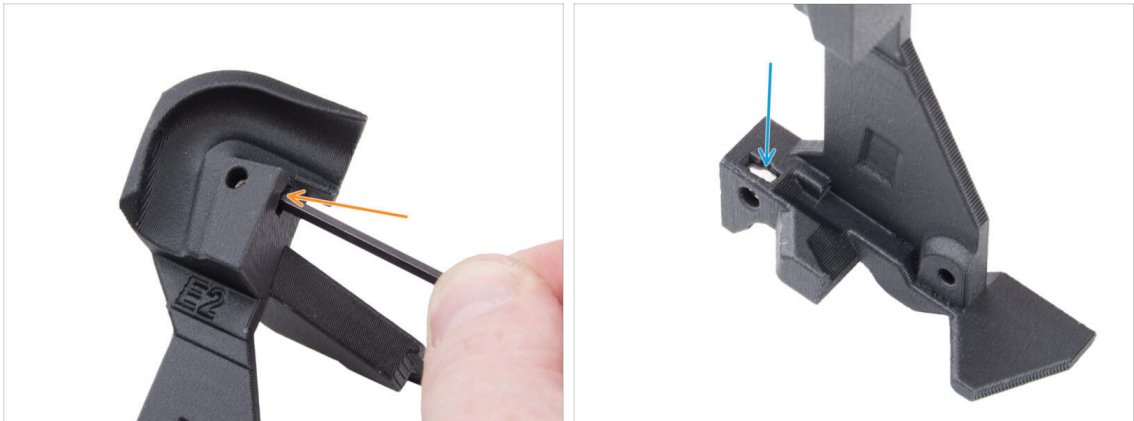


- 🟠 Locate the U-shaped cable channel on the Loveboard-mount and insert an M3nS nut into the nearby hole.
- ⬛ Use a 2.5mm Allen key to push the nut all the way in.
- 🟡 On the opposite side of the part, insert an M3nS nut and push it into place.

SCHRITT 30 Zusammenbau der Druckkopfabdeckung

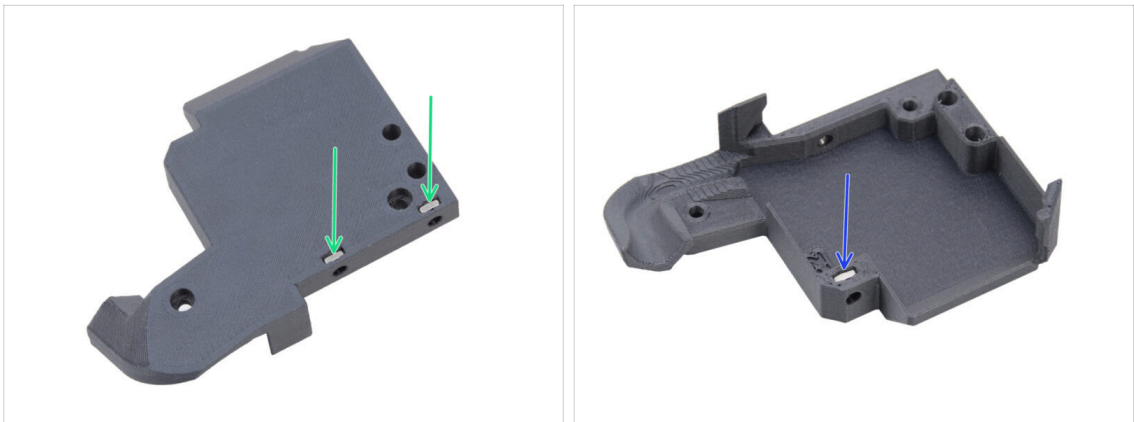

- 🟢 From the back of the printhead-cover, insert two M3nS nuts into the part.
- 🟡 From the other side of the printhead-cover, insert one M3nS nut into the part.

SCHRITT 31 Montieren des LoveBoards

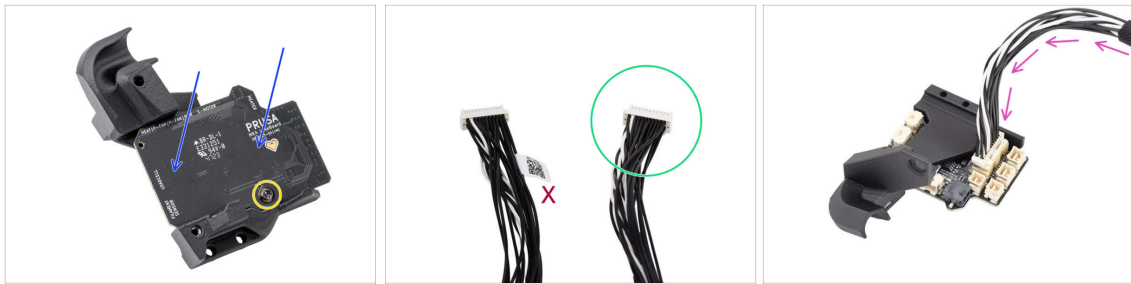


- Place the LoveBoard to the Loveboard-mount. Note the correct orientation - the connectors must be facing downwards.
- Align the holes with both parts and secure the board with the M3x8rT screw. **Do not overtighten it**, it might damage the part.
- Take the end of the extruder main cable without the white label.
- Turn the Loveboard-mount upside down and connect the Main cable to the LoveBoard.

SCHRITT 32 Guiding the main cable




- Twist the main cable half a turn.
- Fold the main cable over the LoveBoard to its opposite side.
- Turn the LoveBoard assembly upside down.
- Guide the main cable over the LoveBoard through the cable channel in the Loveboard-mount.

SCHRITT 33 Abdecken des LoveBoards

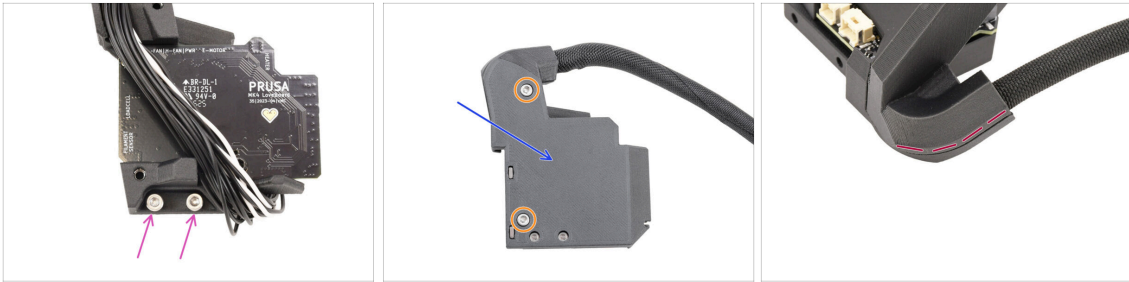

- ✦ Insert two M3x10 screws into the Loveboard-holder.
 - ⚠ Ensure you insert the screws from the correct side. Use the LoveBoard logo on the board as a reference.
- 🔵 Cover the LoveBoard with the Printhead-cover.
 - ⚠ Avoid pinching any wires in the main cable.
- 🟡 Fix both parts together using two M3x10 screws.
- 🔴 Check that there is no large gap or pinched textile sleeve between the parts.

SCHRITT 34 Swingarm: parts preparation I.

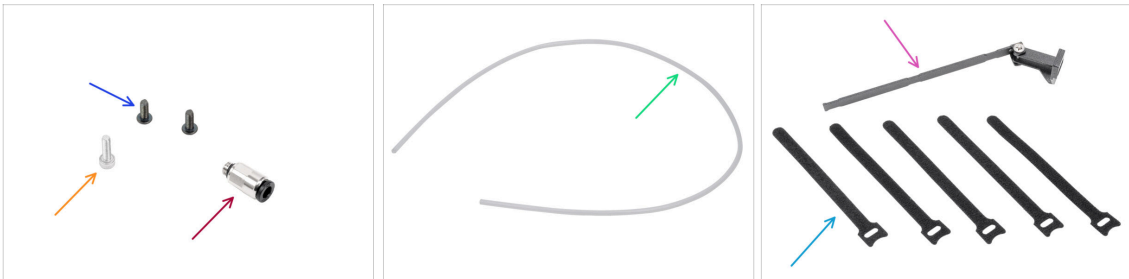

- ⬛ **For the following steps, please prepare:**
- 🔵 Schraube M3x8rT (2x)
- 🟡 Schraube M3x10 (1x)
- 🔴 Fitting M5-4 (1x) found in the Small parts & fasteners bag located inside the Electronics & Fasteners package.
- 🟢 PTFE tube 710 x 4 x 2.5 (1x) *found in the CoreXY parts + Hinges set package*
- ✦ Swingarm assembly (1x) *found in the Metal parts 3/3 package*
- 🔵 Cable tie (5x) *found in the Seals & Ties bag located inside the Electronics & Fasteners package*
- 📄 **i** Packed in a stack and must be separated.
- 📄 **i** The list continues in the next step...



SCHRITT 35 Swingarm: parts preparation II.



● For the following steps, please prepare:

- ◆ Bowden-bend (1x) *found in the Printed parts package*
- ◆ Main-cable-clip (1x) *found in the Printed parts package*

SCHRITT 36 Guiding the main cable

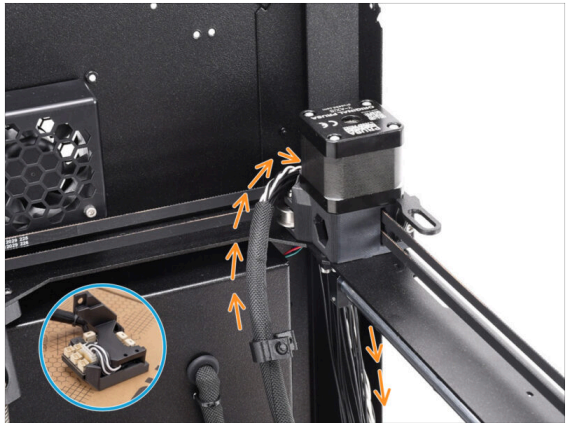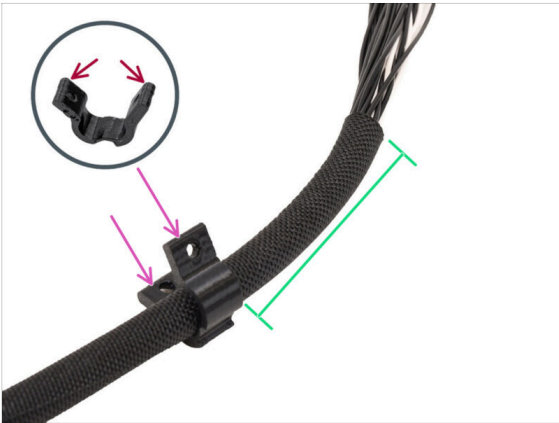


- Carefully open the Main-cable-clip. Be careful not to crack the part.
- ◆ Insert the main cable into the Main-cable-clip. **Note the clip orientation in the photo.** The clip is not symmetrical; make sure to attach it as shown.
- ◆ Place the Main-cable-clip approximately 5 - 15 cm (2 - 6 in) from the end of the textile sleeve and close the clip.
- ⓘ Do not move the cable clip to the edge of the textile sleeve as shown in the second photo. Keep it in the same position from the last step.
- ◆ Place the LoveBoard assembly on the cardboard box on the heatbed.
- ◆ Push the main cable behind the CoreXY assembly in the right rear corner.

SCHRITT 37 Mounting the main cable



- ✦ In the right corner of the printer on the Y motor assembly, locate the hole in the plastic part and align it with the main-cable-clip.
- ✦ Fix the main-cable-clip with the cable to the hole using the M3x10 screw.

SCHRITT 38 Attaching the LoveBoard assembly

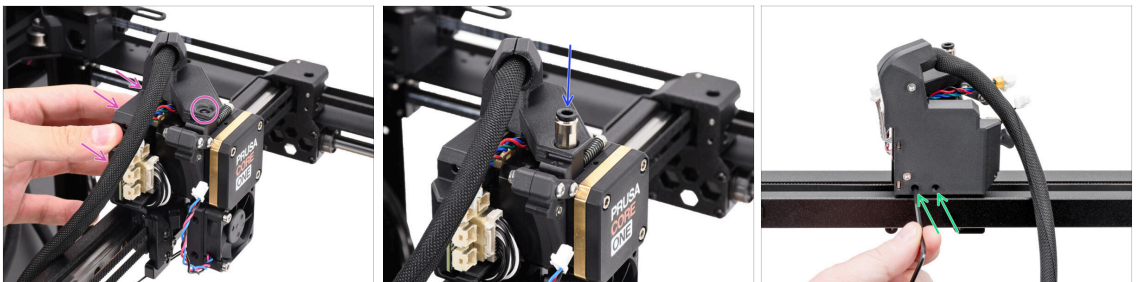


- ✦ From the back of the Nextruder, attach the LoveBoard assembly to the Nextruder.
- ✦ Align the hole in the Loveboard-mount with the threaded hole in the top of the heatsink (Nextruder).
- ✦ Insert and tighten the fitting M5-4 to the heatsink. Use the universal wrench.
- ✦ From the back of the Nextruder, tighten the two M3x10 screws to secure the LoveBoard assembly.

SCHRITT 39 Befestigung des Schwenkarms




- ✦ Attach the swingarm assembly to the pair of threaded holes on the back panel near the top right corner.
- ✦ Secure it with two M3x8rT screws.
- ⚠ Do not overtighten the screws, as this may strip the threads.

SCHRITT 40 Attaching the main cable

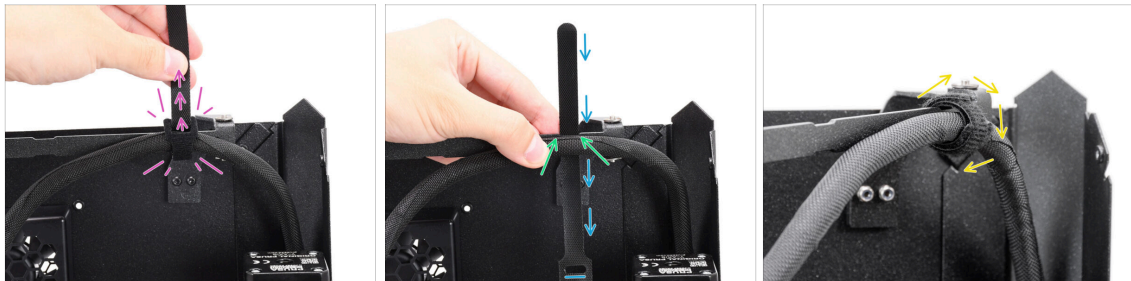


- ✦ Notice the cutouts on the swingarm.
- ✦ Position the main cable at the first cutout on the swingarm.
- ✦ Place one cable tie behind the first cutout on the swingarm, ensuring the correct orientation of the zip strip.
- ✦ Thread the cable tie through its eyelet, wrapping it around the swingarm and main cable.
- ✦ Tighten the cable tie as much as possible.
- ✦ Wrap the cable tie around.

SCHRITT 41 Inserting the PTFE tube

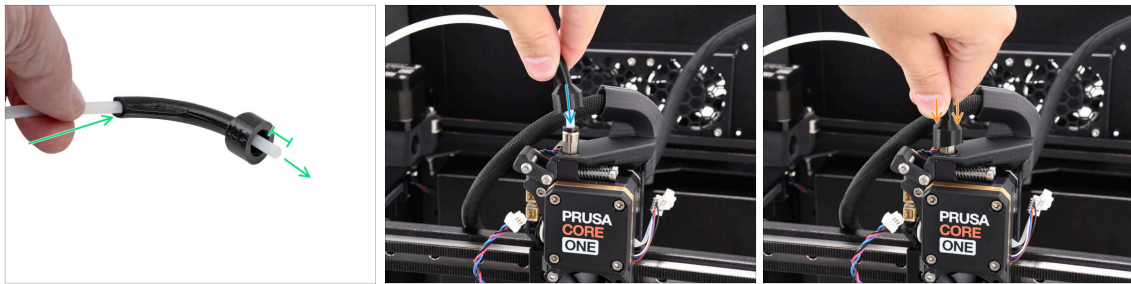


- Push one end of the PTFE tube through the bowden-bend and keep protruding at least 1 cm (0.39 in) of the tube.
- Insert the PTFE tube into the fitting M5-4 on the Nextruder. Push it all the way down.
- Slide bowden-bend down to cover the fitting M5-4.

SCHRITT 42 Securing the PTFE tube

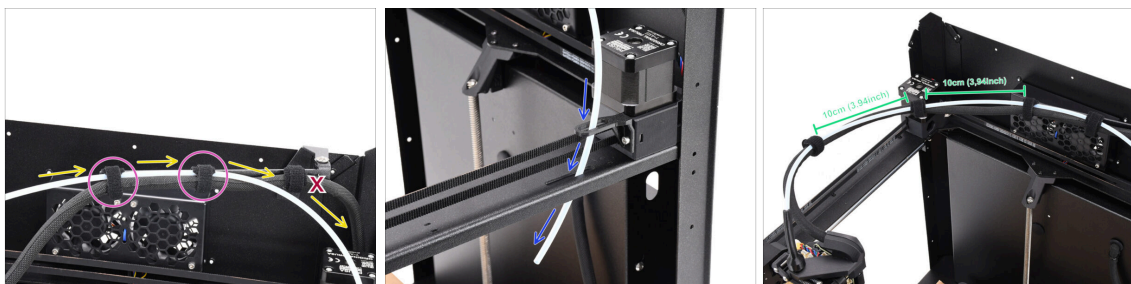


- Route the PTFE tube in parallel with the main cable, ensuring the PTFE tube stays above the main cable.
- Secure the PTFE tube and main-cable to the swingarm using two cable ties to the remaining cutouts.
- ⚠ Do not pass the PTFE tube through the first cable tie on the swingarm.
- Push the free end of the PTFE tube through the Bowden guide and CoreXY plate downward. Leave the end hanging freely.
- Merge the PTFE tube and main-cable with the remaining two cable ties, leaving a 10 cm (3.94 in) distance between them.

SCHRITT 43 Überprüfung der Bewegung

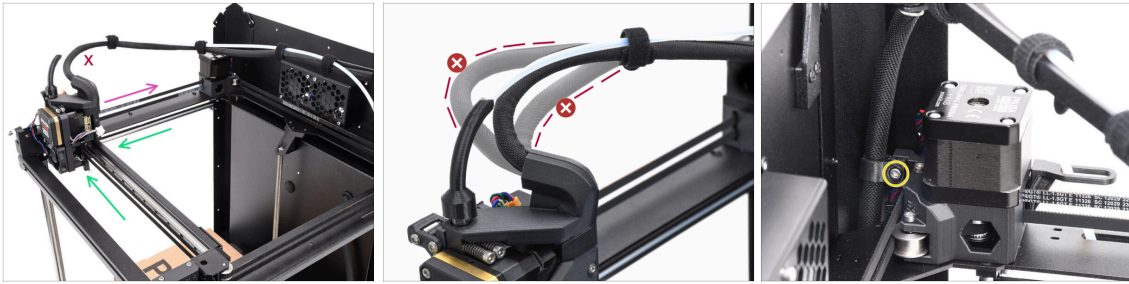

- Manually move the XY axes to their end positions several times and ensure that:
 - The main cable is not too tight and does not pull the Nextruder backward.
 - The main cable does not form an excessively large arc.
 - If the cable is too tight or forms a large arc, slightly loosen the screw on the main cable clip and pull the cable upward or downward by a few millimeters. Then, tighten the screw and test again.

SCHRITT 44 Print fan: parts preparation

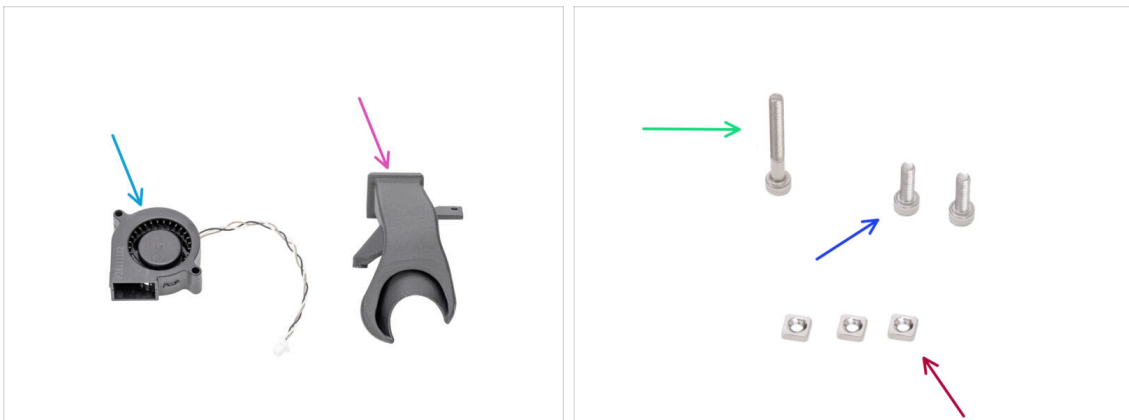

- **For the following steps, please prepare:**
 - Print fan (1x) *found in the Electronics package*
 - Fan-shroud (1x) *found in the Printed parts package*
 - Schraube M3x25 (1x)
 - Schraube M3x10 (2x)
 - M3nS Mutter (3x)


SCHRITT 45 Lüfterhaube montieren



- Insert two M3nS nuts from one side into the fan-shroud.
- From the other side, insert one M3nS nut into the fan-shroud.
- Insert the print fan into the fan-shroud as shown. See the correct orientation of the parts.
- Secure both parts together with one M3x25 screw.

⚠ Do not overtighten the screws to avoid damaging the fan housing.

SCHRITT 46 Installing the print fan assembly

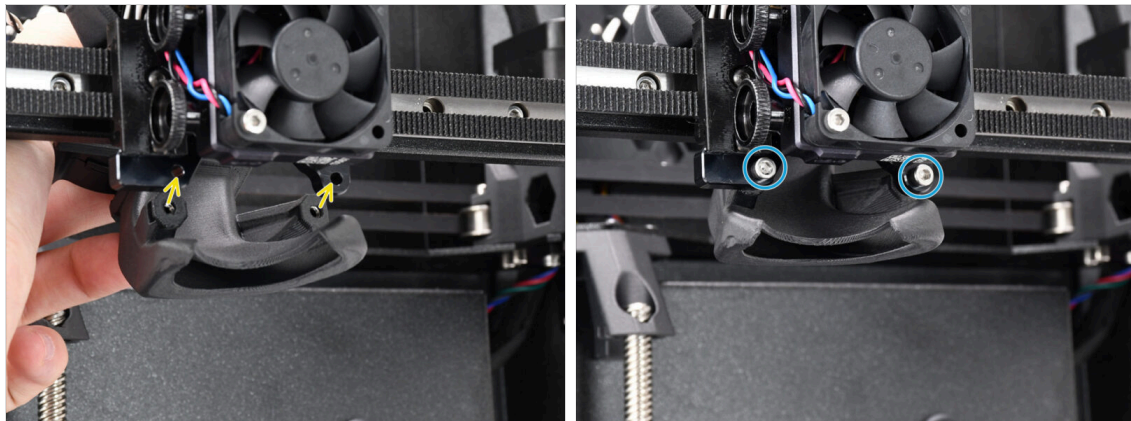


- Attach the print fan assembly to the back of the Nextruder.
- Align the holes in the Nextruder bracket with the holes in the fan-shroud.
- Secure the fan-shroud to the Nextruder holder using two M3x10 screws.

SCHRITT 47 Hotend: Vorbereitung der Teile






- For the following steps, please prepare:
- Thumb screw (2x) found in the Electronics package
- Prusa Hotend assembly (1x) found in the Electronics package

SCHRITT 48 Einsetzen des Hotends

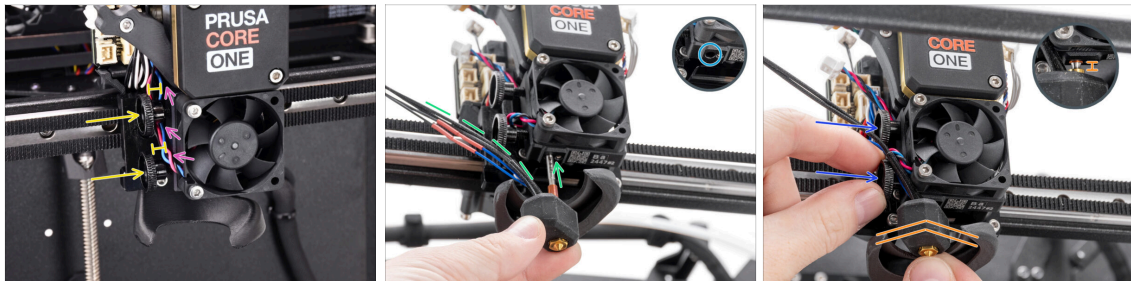




- Insert two thumb screws into the heatsink. **Do not tighten them completely.** Two turns are enough for now.
- Route the heatsink fan cable above the first threaded hole in the heatsink.
- Look closely at the underside of the heatsink and find the hole for the hotend assembly.
- Insert the hotend assembly tube in the hole and slide the whole thing into the heatsink.
- Point the cables to the left according to the photo.
- Push the hotend assembly all the way into the heatsink. There should be approximately a 2 mm (0.08 in) gap between the heatsink and the brass part of the nozzle.
- While pushing the hotend assembly in, **firmly tighten both thumb screws.**
- ⚠ **Avoid pinching any cable between the screws and the heatsink!**

SCHRITT 49 Connecting the heatsink cables

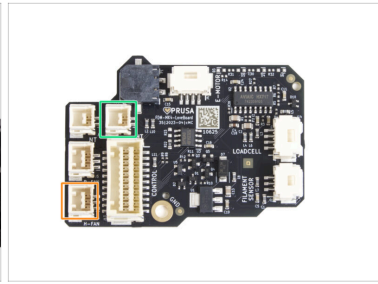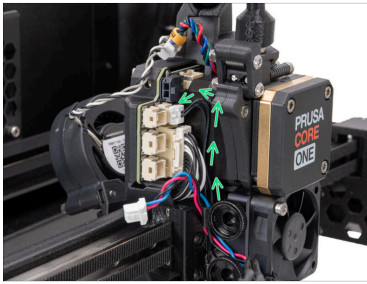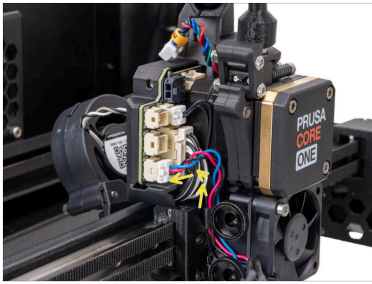




- Plug the NTC thermistor cable into the connector above the main cable on the LoveBoard.
- Plug the Hotend fan cable into the lower connector in the left row of the LoveBoard.

SCHRITT 50 Connecting the hotend cables

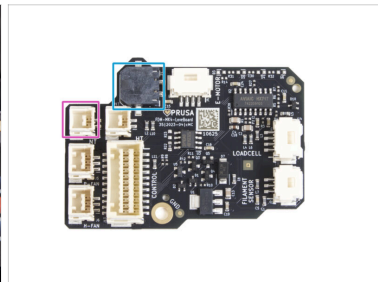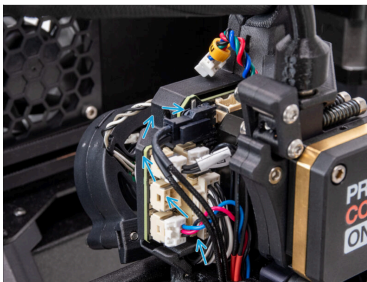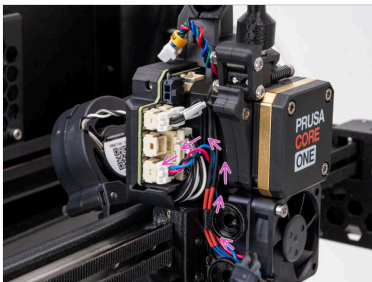


- Guide the hotend thermistor through the cable-clip on the Nextruder and connect it to the LoveBoard.
- Guide the hotend heater through the cable-clip on the Nextruder and connect it to the LoveBoard.

SCHRITT 51 Connecting the print fan cable

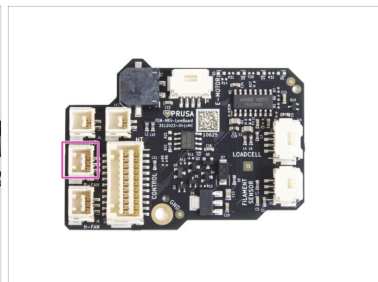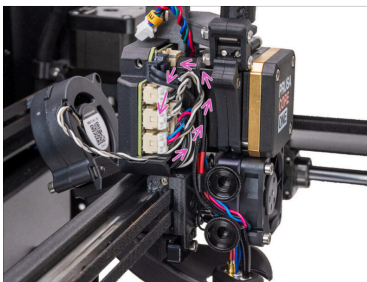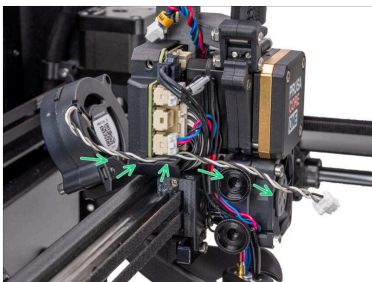


- Guide the print fan cable through the channel in the plastic cover.
- Create a loop with the print fan cable in the cable area and plug it into the middle connector in the LoveBoard.

SCHRITT 52 E-Motor-Kabel anschließen

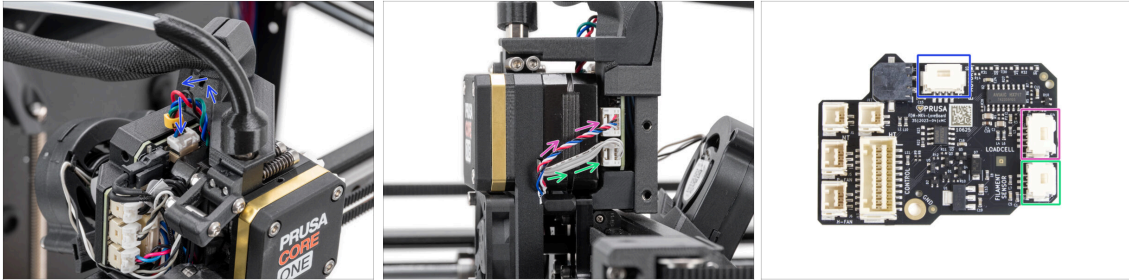


- Plug the Nextruder motor (labeled E) to the top-facing connector.
- Plug the loadcell cable (lower cable) to the upper connector on the right side of the Nextruder.
- Plug the filament sensor (upper cable) to the lower connector.

SCHRITT 53 LoveBoard covers: parts preparation

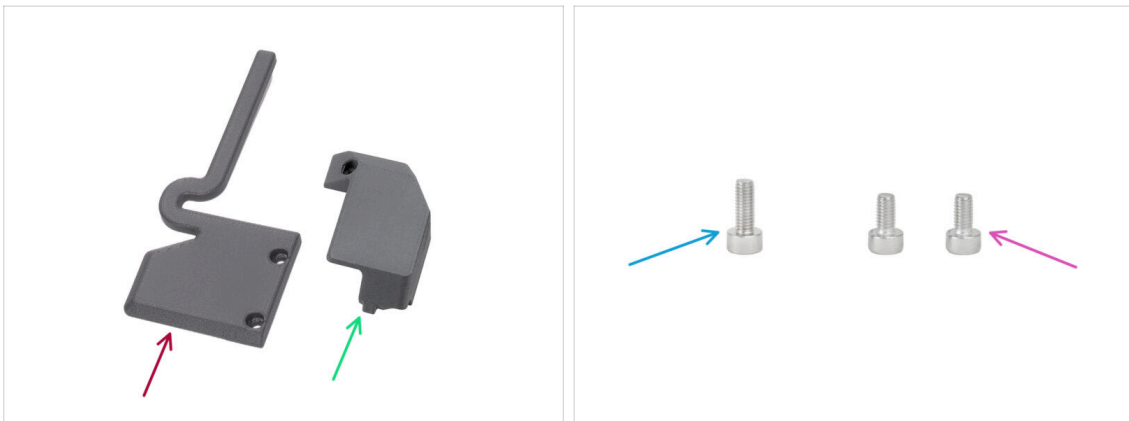

- For the following steps, please prepare:
- Print-head-cover-right-lever (1x) found in the Printed parts package
- Print-head-cover-left (1x)
- Schraube M3x10 (1x)
- Schraube M3x6 (2x)

SCHRITT 54 LoveBoard: Verdrahtung prüfen

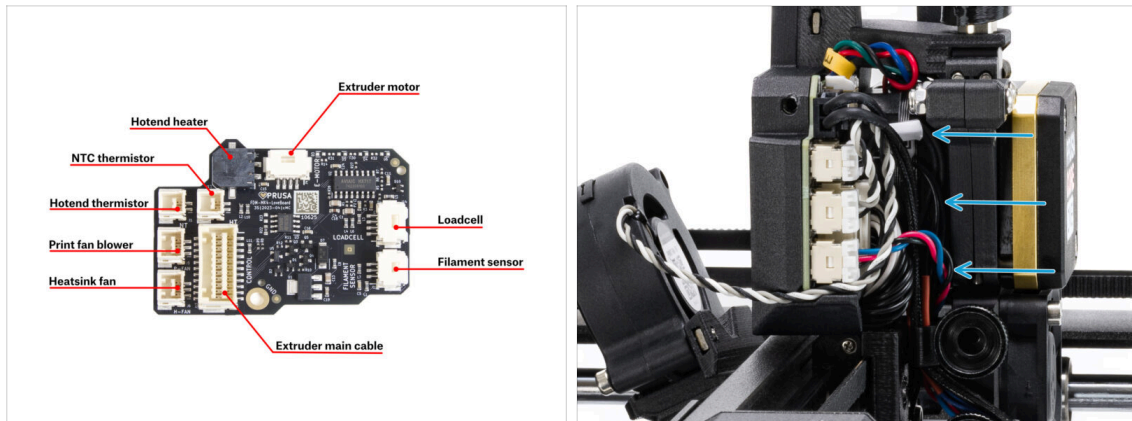

⚠ Before covering the electronics, check the connection of all cables.

i Click on the picture to open it in the high-resolution preview.

- 🔵 Squeeze the wiring harness as far inward to the LoveBoard as possible so that it does not protrude out and interfere with the fitting of the cover.

SCHRITT 55 Abdecken des LoveBoards




- 🟡 Attach the Print-head-cover-left on the left side of the Nextruder.
- 🟢 Secure the cover with one M3x10 screw.
- 🟠 Place the Printhead-cover-right-lever on the right side of the Nextruder.

⚠ Do not pinch the cables!

- 🟣 Secure the cover with two M3x6 screws.
- 🟢 Guide the main-cable through the upper hole on the right side of the back panel assembly.


Leave the end of the cable hanging freely for now.

SCHRITT 56 Connecting the main cable

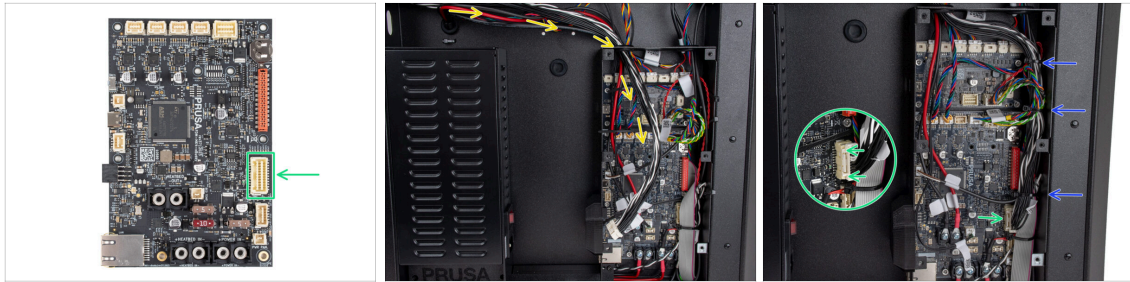

- Rotate the printer so that the backside faces you.
- Route the main cable through the left hole into the xBuddy box.
- Plug the main-cable to the slot on the right side of the xBuddy board.
- ① Sollte das Kabel nicht bis zum Stecker reichen oder zu straff sitzen, kehren Sie zu Schritt **Verlegen des Hauptkabels** zurück und ziehen Sie das Kabel vom Main-cable-clip leicht nach unten.
- Secure the cables with the pre-threaded zip ties in the xBuddy box. Carefully cut the excess, **avoiding cutting the cables**.

SCHRITT 57 Haribo Zeit!

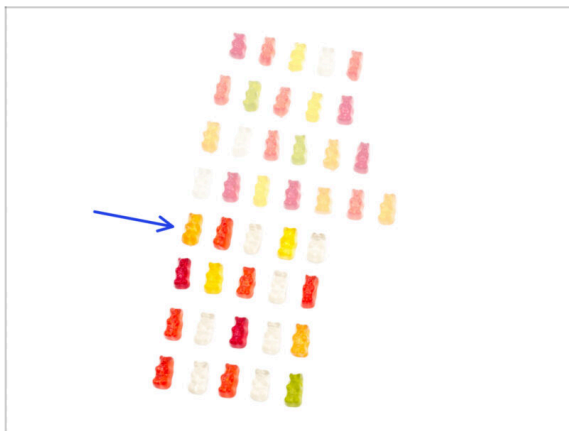

- Power up and push forward!
- Eat the fifth row.

SCHRITT 58 Abgeschlossen




- ◆ Congratulations! You just successfully assembled the Nextruder.
- ◆ Let's move to the next chapter.

7. Bodywork & Electronics




SCHRITT 1 Tools necessary for this chapter

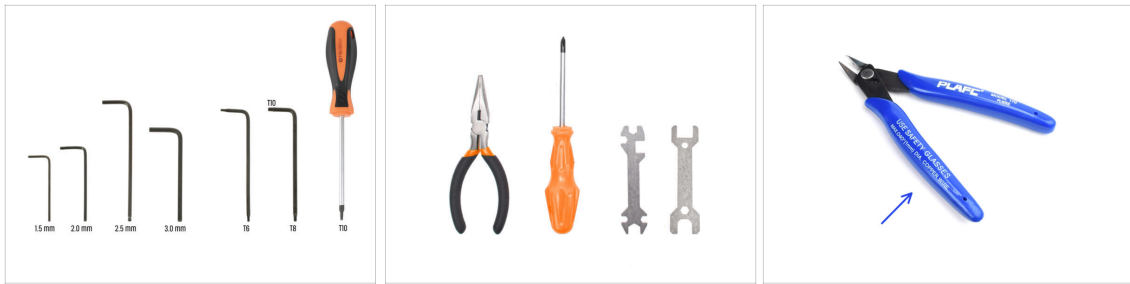

● For the following steps, please prepare:

- 2,5mm Innensechskantschlüssel
- 1,5mm Innensechskantschlüssel
- T10 Innensechsrund Schlüssel
- Spitzzange
- Seitenschneider (optional)

SCHRITT 2 Front profiles: parts preparation

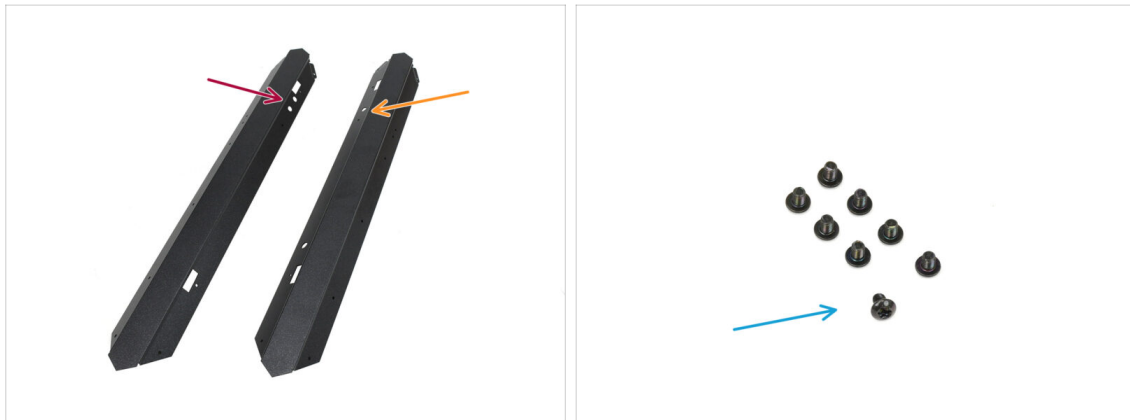

● For the following steps, please prepare:


- Front Left Profile (1x) *found in the Metal parts 1/3 package*
 - ① The one with the two circular openings on top.
- Front Right Profile (1x) *found in the Metal parts 1/3 package*
 - ① The one with one circular opening on top.
- Schraube M3x4rT (8x)

SCHRITT 3 Installing the front right profile




- Attach the Front Right Profile to the printer.
- ⓘ Ensure you are using the correct profile—it should have **one large round opening** for the belt tensioning screw.
- Align the profile so that the calibration screw opening and the smaller bolt opening line up with the thread.
- Secure the profile to the CoreXY assembly using two M3x4rT screw
- Fix the profile at the bottom using the two M3x4rT screws.
- ⓘ Sollten die Löcher nicht übereinstimmen, stellen Sie bitte sicher, dass die glatten Stangen vollständig in die Stangenhalterungen der Basisbaugruppe und der oberen XY-Baugruppe eingeschoben sind.

SCHRITT 4 Installing the front left profile

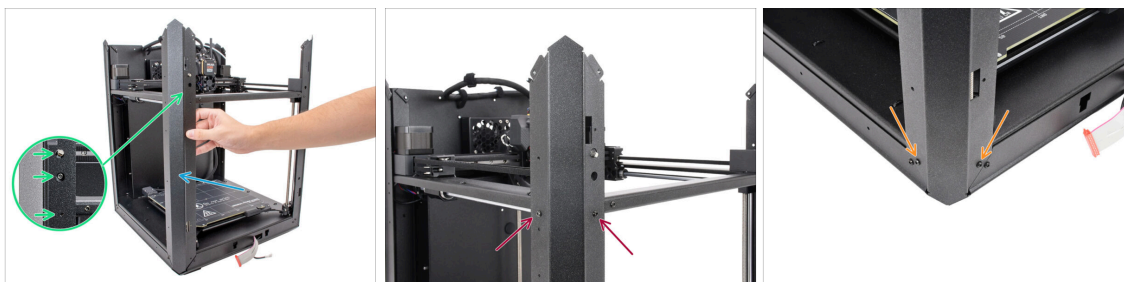


- Attach the Front Left Profile to the printer.
- ⓘ Ensure you are using the correct profile—it should have **two large round openings** for the door sensor and the belt tensioning screw.
- Align the profile so that the openings match. **Be careful not to bend the door sensor lever!**
- Secure the profile to the CoreXY assembly using two M3x4rT screw
- Fix the profile at the bottom using the two M3x4rT screws.

SCHRITT 5 Top profiles: parts preparation

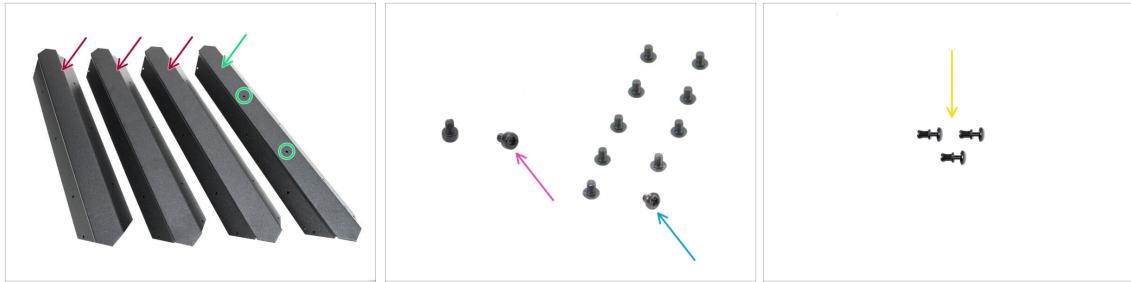


- Top Profile (3x) *found in the Metal parts 1/3 package*
- Top rear profile (1x) found in the Metal parts 1/3 package - note the two holes in the part.
- Schraube M3x4rT (10x)
- M3x4 screw (2x) *with the different head type*
- Nylon-Niete (3x)

SCHRITT 6 Assembling the top profiles I.

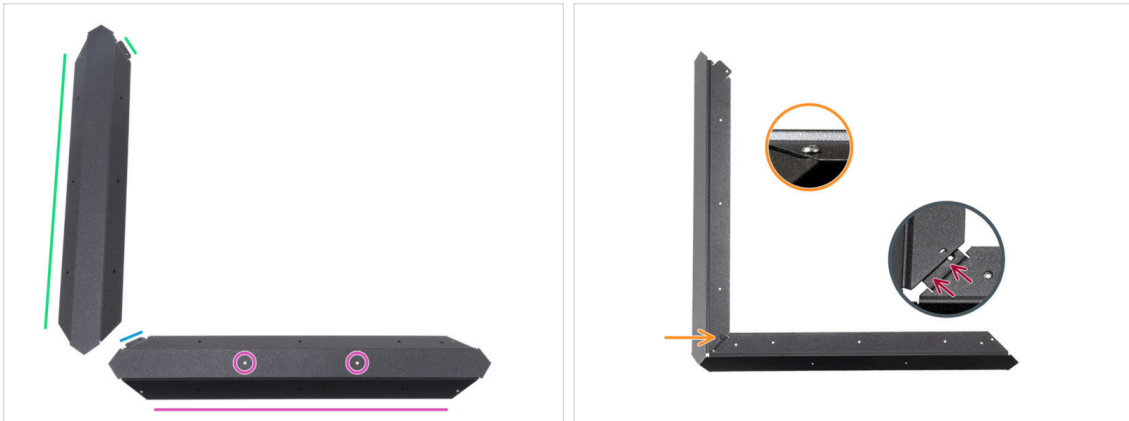


- ⚠ Be very careful when handling sharp sheet metal parts to avoid injury or damage.
- According to the picture, place the top profile with two holes on the flat side.
 - Orient the part according to the picture. **Use the flange as a guide.**
 - Place any other of the top profiles on the left side. Orient the part according to the picture. **Use the flange as a guide.**
 - Attach the two profiles together.
 - ⚠ The flange of the front plate (blue arrow) must be inserted **under** the left universal profile (green arrow), not on top of it.
 - Align the holes in both parts and join both parts together with the **M3x4rT** screw.
 - ⚠ **Double check the type of the screw! Make sure you are using the correct one for each hole.**
 - Using the same procedure, join the other two profiles to form a corner, securing them with an M3x4 screw.

SCHRITT 7 Assembling the top profiles II.

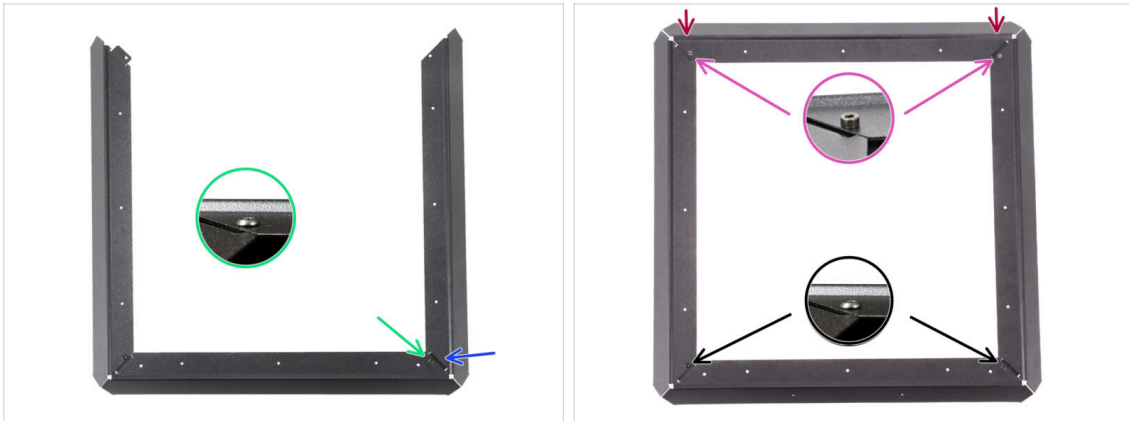

- ◆ Verbinden Sie nach dem gleichen Verfahren ein weiteres Profil mit dem oberen Profil, wobei beide Profile auf der flachen Seite zwei Löcher aufweisen.
- ⚠ **Ensure the flanges are positioned underneath the profiles.**
- ◆ Verbinden Sie die Profile mit M3x4T-Schrauben.
- ⚠ **Double check the type of the screw! Make sure you are using the correct one for each hole.**
- ◆ Join the last profile using the same procedure. **Ensure you are using the correct type of the screw.**
- ◆ Join the profiles using a M3x4 screw. **Ensure you are using the correct type of screw.**

SCHRITT 8 Aligning the top profiles

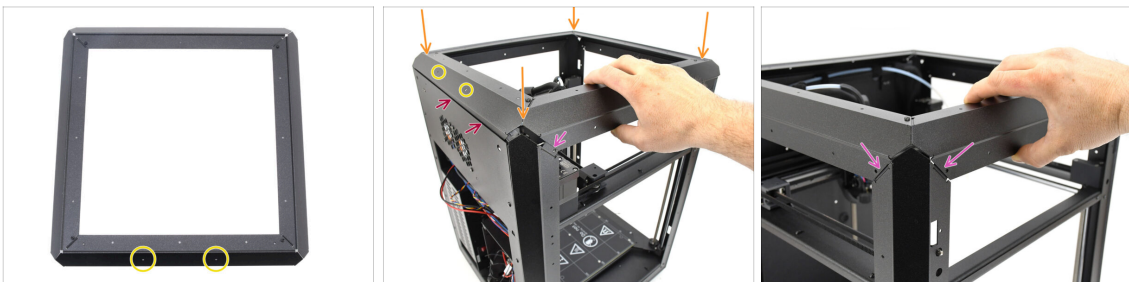

- ◆ Find the profile with **two openings in the middle**—this part should be positioned at the **rear of the printer**.
- ◆ Add the top profile assembly onto the printer, making sure the two openings are facing the back.
- ◆ The protruding part of the rear profile must be positioned behind the back sheet metal plate.
- ◆ On the sides and front, the profiles must sit on top of the tabs with threaded openings.

SCHRITT 9 Installing the top profiles




- Once all the top profiles are properly aligned, fix them in place using the remaining 8 M3x4rT screws in the corners.
- Attach the back panel to the top profile with three nylon rivets.

SCHRITT 10 CoreXY fixing screws: parts preparation



- For the following steps, please prepare:
- Schraube M3x4rT (4x)

SCHRITT 11 Fixing the CoreXY assembly

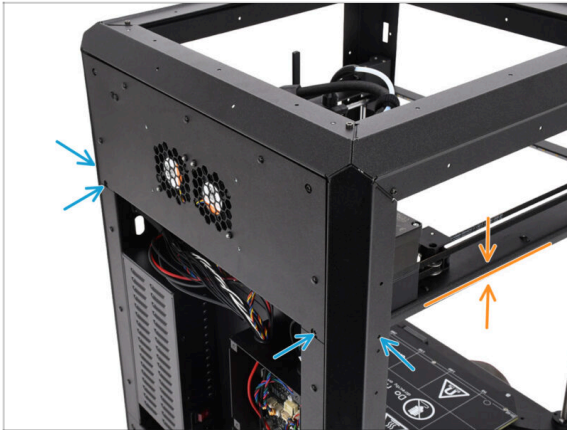

- Align the CoreXY assembly so the threaded holes match the screw openings in the rear profiles. You may need to push the assembly upward to align the holes.
- Fix the CoreXY assembly using the four M3x4rT screws in the marked openings.

SCHRITT 12 Side sensor base: parts preparation



- **For the following steps, please prepare:**
- Filament-sensor-body (1x) *found in the Printed parts package.*
- Filament-sensor-lever (1x) *found in the Printed parts package.*
- Filament-sensor-switch (1x) *found in the Printed parts package.*
- Schraube M3x10 (1x)
- 10x6x2mm magnet (2x) *found in the Electronics & Fasteners package*
- 7mm Ferromagnetic Ball (1x) *found in the Electronics & Fasteners package*
- M3w Unterlegscheibe (1x)

SCHRITT 13 Assembling the side sensor base



- Insert one of the magnets into the dedicated opening in the Lever.
- Insert the ball into the corresponding opening on the inside of the sensor base.
- Insert the lever with the magnet into the Base.

i The part with the magnet should be positioned next to the ball.

Note that the ball will be attracted to the magnet—ensure it stays securely in place.

- Fix the lever in place using the M3w washer and M3x10 screw. Tighten it just a few turns for now—enough to hold it in place.

! **Do not fully tighten the screw. Otherwise, the lever will not move and the sensor will not work!**

SCHRITT 14 Testen des Hebels



- Verify the lever is able to move freely.
- If the lever does not move freely or cannot move at all, loosen the screw by a quarter turn and test the movement again.

! The screw **must not be fully tightened**; otherwise, the lever will not be able to move freely.


SCHRITT 15 Zusammenbauen des Schalters



Lesen Sie alle Abschnitte dieses Schritts durch, bevor Sie beginnen.

- Insert the second 10x6x2 magnet into the filament-sensor-switch.
- Install the filament-sensor-switch into the filament-sensor-body.
- Move the filament-sensor-switch to the left end position so the magnets face each other.
- Make sure **the magnets repel** - they should push away from one another.
- **If they attract** - pull toward each other: remove the magnet from the filament-sensor switch and flip its polarity. Then check it again.
- i *Pro tip: Use one of the thin hex keys or Torx keys to remove the magnet from the filament-sensor-switch.*

SCHRITT 16 IR Sensor: parts preparation

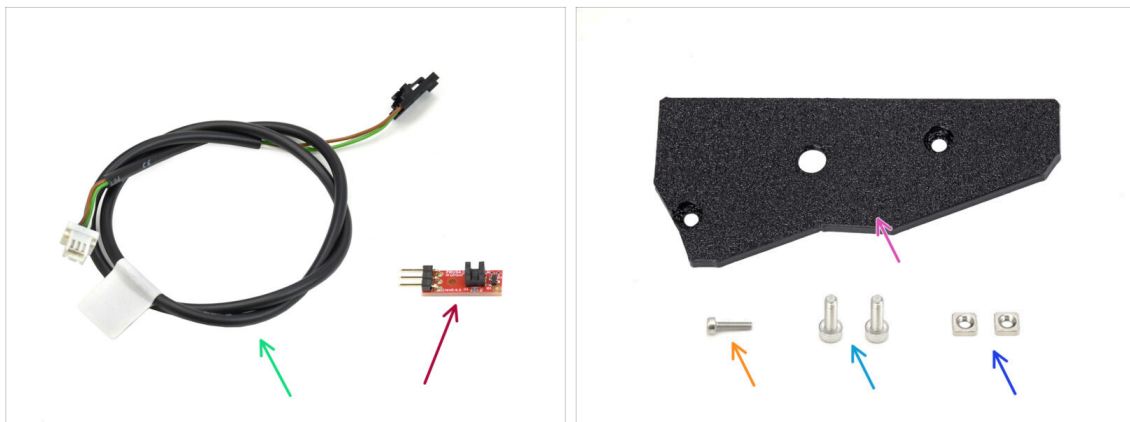


- **For the following steps, please prepare:**
- Side Filament Sensor Cable (1x) *found in the Electronics & Fasteners package*
 - IR Filament Sensor (1x) *found in the Electronics & Chamber parts package*
 - Side Filament Sensor Cover (1x) *found in the Printed package*
 - Schraube M2x8 (1x)
 - Schraube M3x10 (2x)
 - M3nS Mutter (2x)

SCHRITT 17 Connecting the IR sensor




- Plug the cable into the IR filament sensor.
- ⚠ Ensure the connector is oriented correctly before plugging it in!
- On CORE One, the brown cable must connect to the +5V pin.
- The white cable connects to the GND pin.

SCHRITT 18 Installing the IR sensor

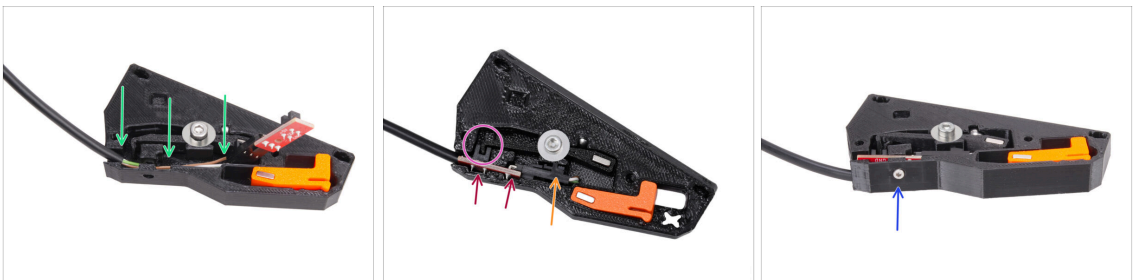

- First, insert the cable into the groove. The black connector should be approximately in the middle of the sensor base.
- Insert the IR sensor itself into the dedicated groove.
- The lever must fit into the optical gate part of the sensor.
- Make sure neither the connector nor the cables touch the lever, as this could prevent the sensor from functioning correctly.
- Using the 1.5mm Allen key, fix the sensor in place with the M2x8 screw.

SCHRITT 19 Installing the side sensor cover

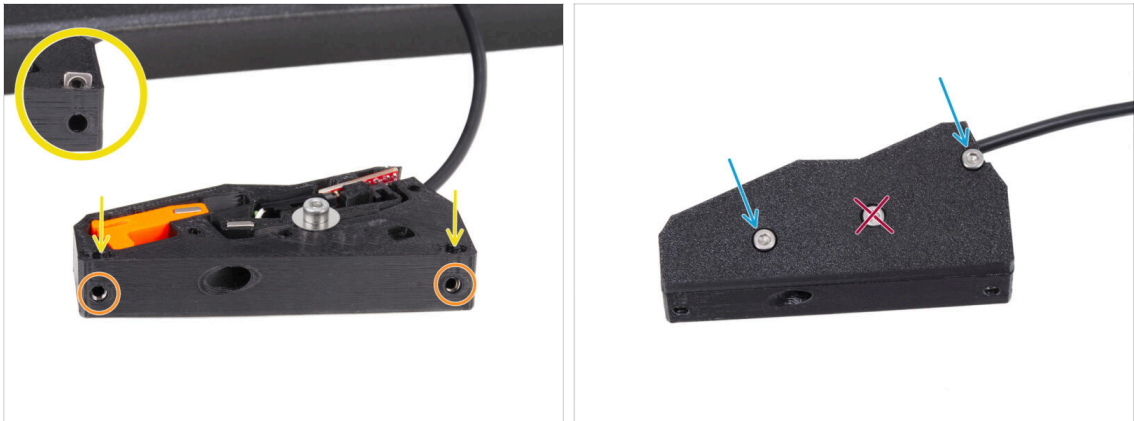

- ✚ Insert the two M3nS nuts into the designated openings. Use a 1.5mm Allen key to **push them all the way in.**
 - ✚ Look from the side to ensure the threads in the nuts align with the openings.
 - ✚ Add the cover part onto the assembly.
 - ✚ Fix the cover in place using two M3x10 screws on the sides.
- ⚠ **Do not tighten the screw in the middle!** Otherwise, the sensor would stop working.

SCHRITT 20 Side filament sensor: parts preparation



- ✚ **For the following steps, please prepare:**
- ✚ Side Filament Sensor Assembly (1x) *you assembled earlier*
- ✚ Collet (1x) *found in the Electronics & Fasteners package*
- ✚ Kabelbinder (3x)

SCHRITT 21 Installing the side filament sensor




- 🟠 Install one zip-tie into the marked openings. We will use it to attach a cable underneath the metal profile.
 - 🔵 Insert the collet into the marked opening on the sensor assembly.
 - 🟢 Attach the sensor assembly onto the PTFE tube in the printer.
- ⚠️ **Make sure to push the tube all the way in!**

SCHRITT 22 Guide the filament sensor cable




- 🟠 Move the sensor assembly up, roughly to the middle of the printer's frame, to align the cable properly.
- 🟢 Once in position, secure the cable underneath the metal profile using a zip-tie. Tighten the zip-tie lightly, allowing for cable adjustments if needed later. Cut off the excess zip-tie.
- 🟡 Guide the sensor cable through the dedicated opening to the back of the printer.
- 🟠 On the back of the printer, guide the cable into the xBuddy box. Leave it hanging loosely for now.

SCHRITT 23 Connecting the side filament sensor

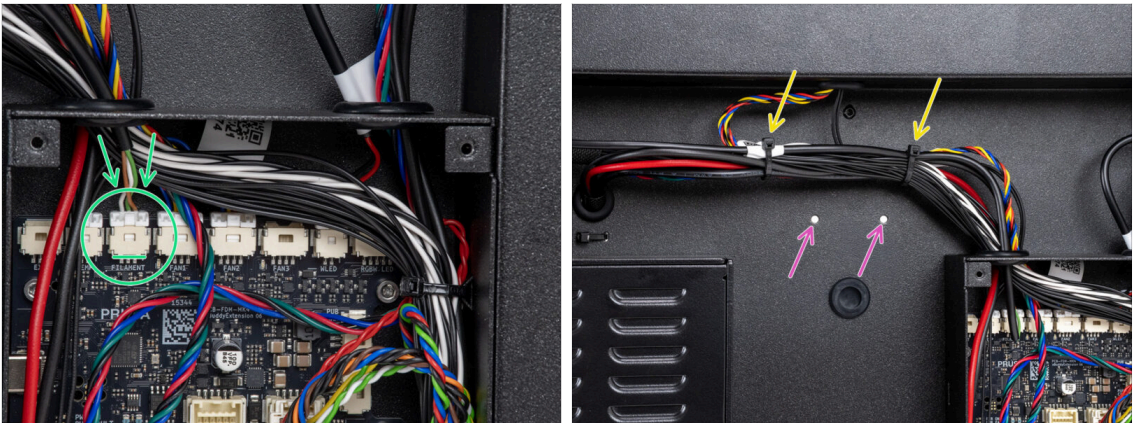

- Connect the Side Filament Sensor cable into the connector labeled FILAMENT on top of the xBuddy extension board.
- i You can use needle-nose pliers to assist you, but be careful not to damage the cables.
- Use two zip-ties to clamp the cable bundle together in the marked area.
 - Secure the cables in the **highest possible position** to ensure they clear the two openings on the sheet metal below.
- ⚠ Do not over-tighten the zip ties or strain the cables too much!

SCHRITT 24 NFC Antenna: parts preparation

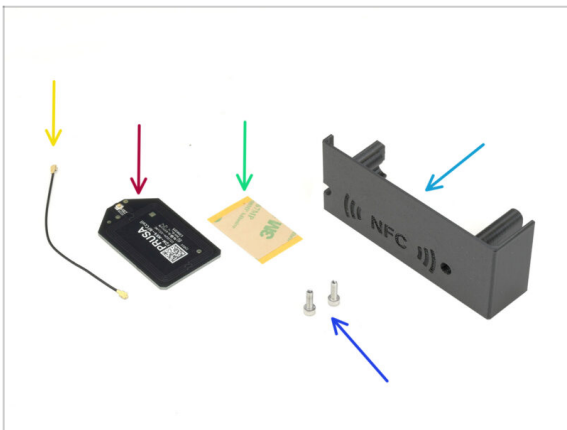

- For the following steps, please prepare:
- El-box-cover (1x) found in the Printed parts package
- Schraube M3x10 (2x)
- NFCcoil (1x) found in the Electronics & Chamber parts package
- Adhesive film 32 x 25 mm (1x) found in the Electronics & Chamber parts package
- NFC coil cable (1x) found in the Electronics & Chamber parts package

SCHRITT 25 Applying the adhesive film




- ✦ Peel off the yellow protective film from the adhesive tape.
- ✦ Apply the film to the flat side of the NFC coil, ensuring it adheres properly.
- ✦ Peel of the remaining protective layer from the NFC coil.

SCHRITT 26 Installing the NFC Coil




- ✦ Stick the NFC coil onto the inner side of the EI-box cover, approximately as shown in the picture.
- ⓘ The small round connector should be positioned closer to the edge of the cover.
- ✦ Connect the cable to the board by aligning the connectors and pressing lightly until you feel a click, ensuring a secure connection.
- ⚠ **Be careful when connecting the NFC coil cable. Misalignment or excessive pressure can cause irreversible damage.**
- ⓘ Make sure to apply equal pressure and do not use flat metal tools to push the NF cable connector in.

SCHRITT 27 Connecting the NFC Coil

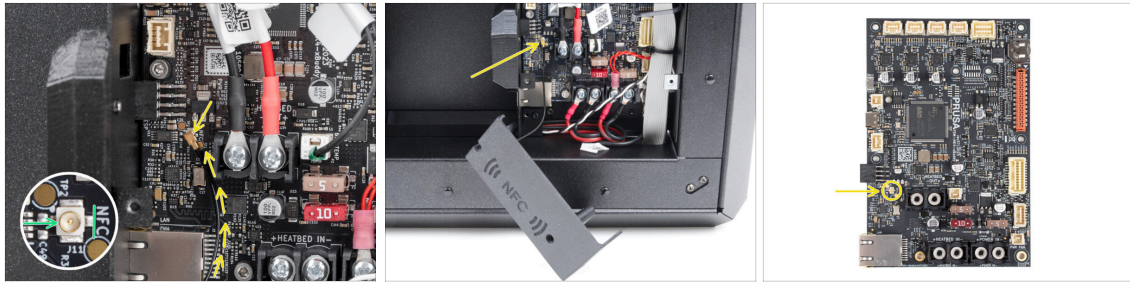

- 🟢 Locate the small round connector labeled NFC on the bottom left side of the xBuddy board.
- 🟡 Connect the NFC coil cable to the board by aligning the connectors and pressing lightly until you feel a click.

SCHRITT 28 Verdrahtung prüfen

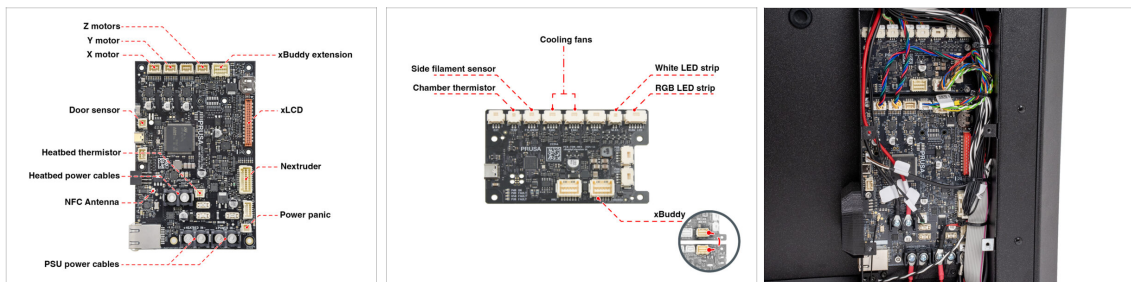


- 🟡 Use the pictures as a reference to verify your electronics connections.
- ⚠️ Make sure that all connectors are fully inserted and PSU cables properly tightened. Otherwise, there is a risk of damage to the printer!

SCHRITT 29 Preparing the electronics cover




- Push two M3x10 screws through the EI-box-cover.

SCHRITT 30 Installing the electronics cover

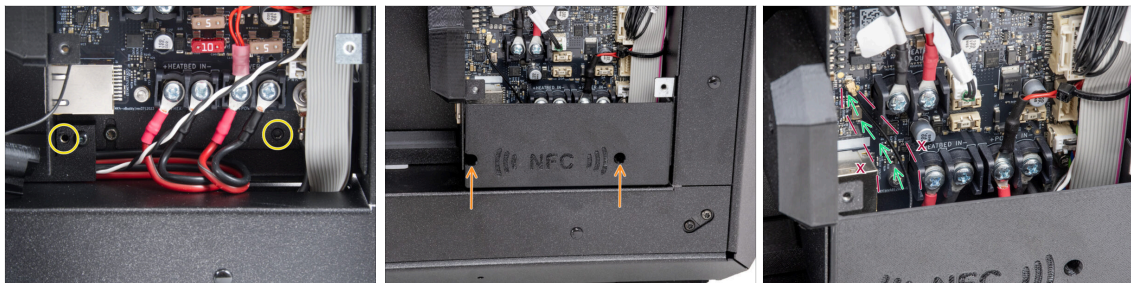

- Ensure the threaded holes on the bottom of the xBuddy box are not obstructed by cables.
 - If so, rearrange the cables to allow clear access.
 - Align the cover with the opening in the xBuddy box and fix it in place by tightening the screws.
 - Route the NFC cable through the space between the Ethernet connector and the PSU power cables.
- ⚠️ Avoid running it through the Ethernet connector or the power cables. The cable may be damaged when covering the xBuddy box.**

SCHRITT 31 Buddy3D Kamera Hinweis

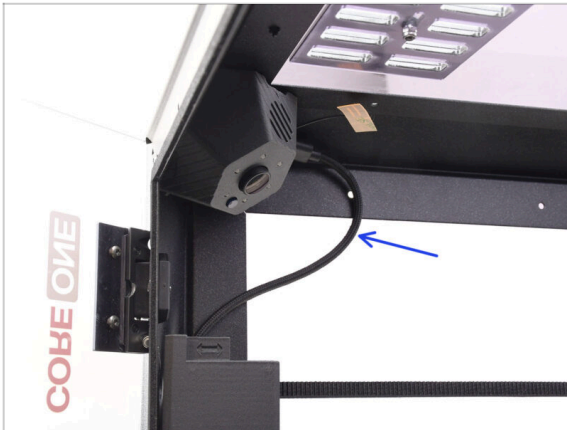



i For future Buddy3D Camera users:

- If you plan to use the Buddy3D Camera, you have the USB cable installed already.



For detailed information on how to mount and connect the Buddy3D camera, return to this guide: **Buddy3D Camera for CORE One Installation**

SCHRITT 32 xBuddy cover: parts preparation

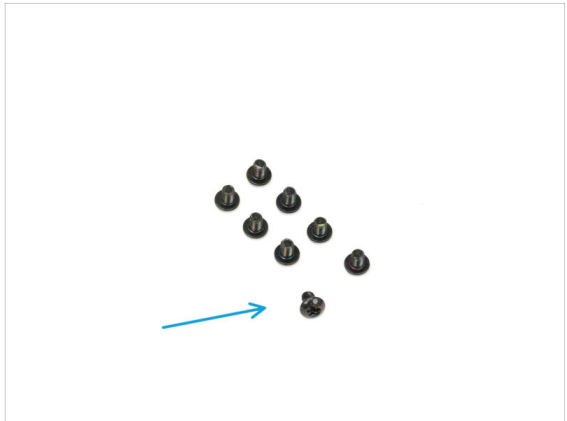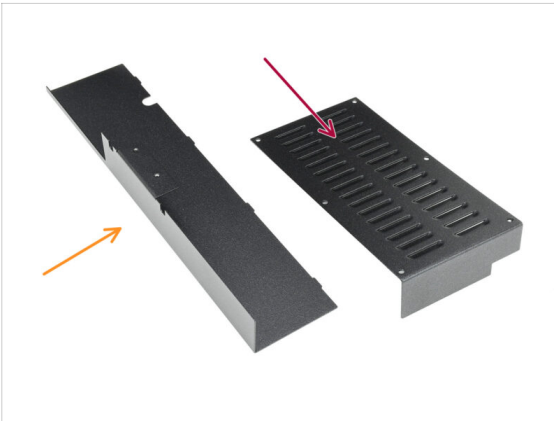

■ For the following steps, please prepare:

- Sheet metal back cover (1x) *found in the Metal parts 2/3 package*
- xBuddy cover (1x) *found in the Metal parts 3/3 package*
- Schraube M3x4rT (8x)

SCHRITT 33 Installing the xBuddy cover



- 🟢 Arrange the cables inside the xBuddy box as shown in the picture.
- 🟡 Carefully cover the xBuddy box by first sliding the bent part of the cover into the box.
- ⚠️ **Avoid pinching the cables and make sure to insert the cover perpendicular to the xBuddyboard.**
Double-check the NFC coil cable position.
- 🔵 Secure the xBuddy box cover using the six M3x4rT screws.

SCHRITT 34 Installing the rear cover



- 🔵 Align the rear sheet metal cover so that the cables can run through the "tray".
- 🔴 Place the rear sheet metal cover into the recess. Push it toward the printer, then move it upward to engage it.
- 🟡 There are four tabs that should engage into the printer's chassis.
- 🟢 Secure the rear cover in place using two M3x4rT screws from inside the printer.

SCHRITT 35 Right side: parts preparation



For the following steps, please prepare:

Right side sheet metal (1x) found in the Metal parts 2/3 package

 The correct **right-side** piece can be easily identified by the screw openings in the middle.


M3x8rT screw (4x) found in the Electronics & fasteners package

Puck-universal (1x)

Any cardboard box (1x)

 Tip: A Prusament box works well.

SCHRITT 36 Installieren des Puck-universal

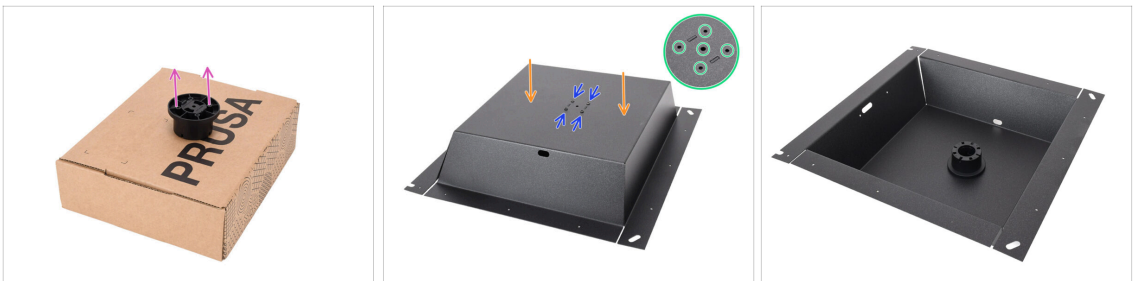

Legen Sie den Puck-universal so auf den Karton, dass die Schraublöcher nach oben zeigen.


Legen Sie die rechte Platte vorsichtig auf den Puck-universal und positionieren Sie sie dabei in der Mitte der Box.

Richten Sie die Löcher im Puck-universal mit den Löchern in der rechten Platte aus.

Befestigen Sie den Puck-universal mit vier Schrauben M3x8rT.

 Screws may feel resistant when tightening, as they cut their own thread inside the part.


SCHRITT 37 Right handle: parts preparation

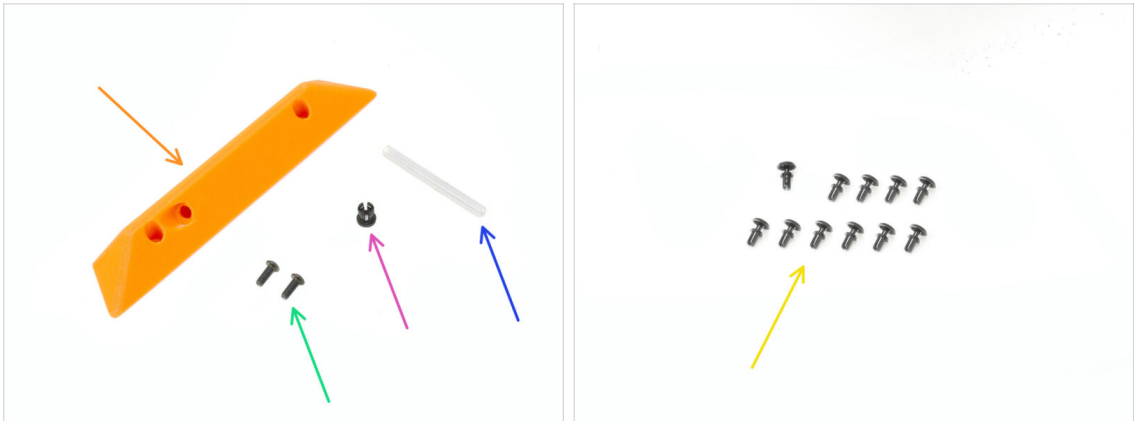

For the following steps, prepare:


- Side Handle (1x) *found in the Printed parts package*
- Schraube M3x8rT (2x)
- Collet (1x) *found in the Electronics & Fasteners package*
- PTFE Tube 4 x 2.5 x 45 mm (1x) *found in the CoreXY parts + Hinges set package (together with hinges parts)*
- Nylon-Niete (11x)

SCHRITT 38 Einbau der Spannzange

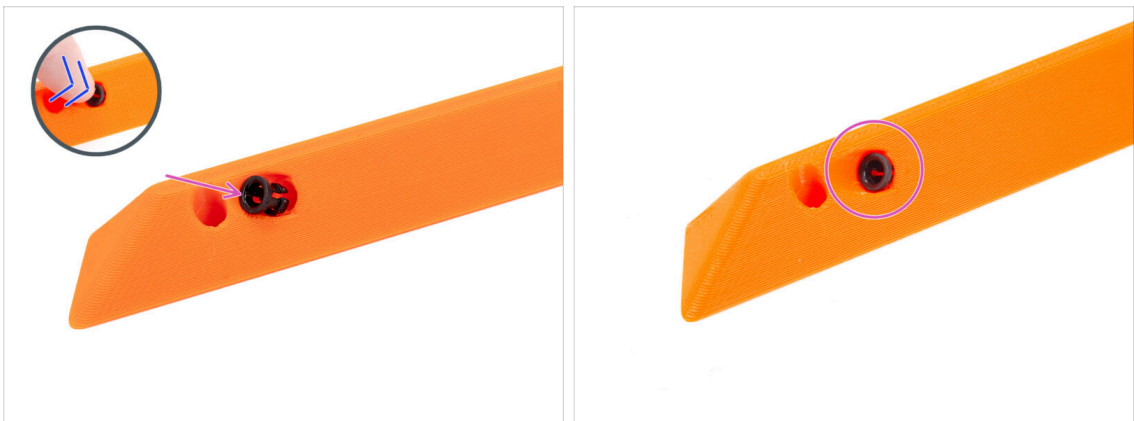


- Insert the collet into the handle.
- Push it all the way in.

SCHRITT 39 Montieren des Griffs

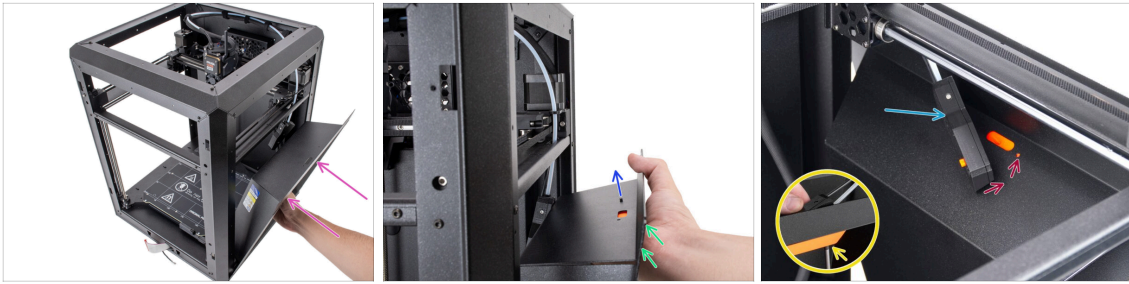


- ✦ Place the right-side metal sheet assembly on the right side of the printer. Ensure the U-shaped cutouts are facing upwards.
- ✦ Attach the right handle to the right metal sheet.
- ✦ Push one M3x8rT screw through the rear hole in the handle and the metal sheet.
- ✦ Attach the side filament sensor assembly on the screw.
- ⚠ **Do not pull the side sensor assembly too far; bring the right side metal sheet as close as possible.**
- ✦ Tighten the screw just slightly—the nut must remain free to move.
- ✦ Align the side filament sensor with the front screw hole in the metal sheet and the handle.

SCHRITT 40 Fixing the right side

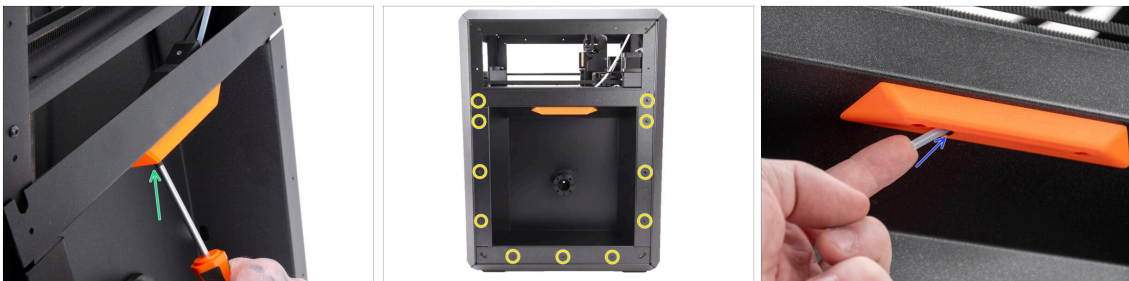

- ✦ Using the second M3x8rT screw, secure the right handle and the side filament sensor to the right metal sheet.
- ✦ Secure the side sheet metal to the printer using the 11 Nylon rivets.
- ✦ Insert the short PTFE tube 4 x 2.5 x 45 into the collet. Push it all the way in.
- ⓘ Part of the PTFE tube will remain protruding from the handle.


SCHRITT 41 Left side: parts preparation

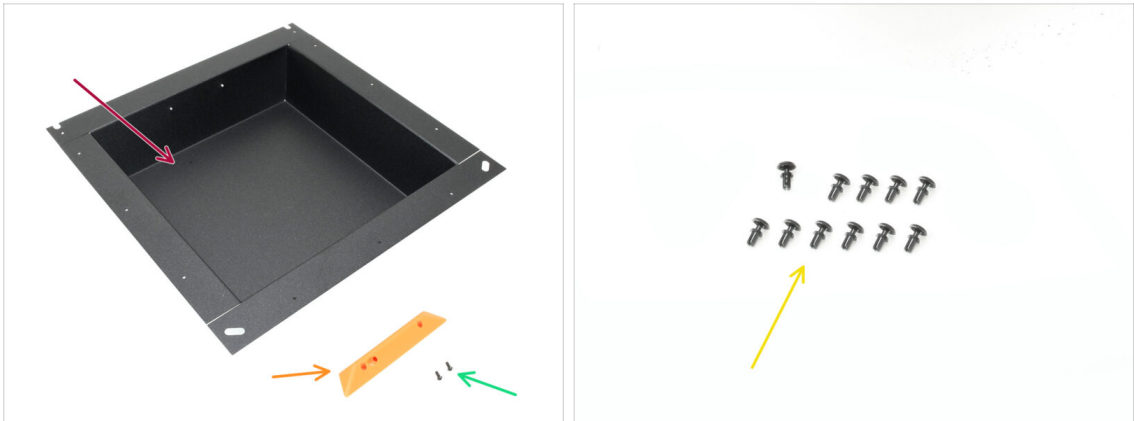

For the following steps, prepare:


- Left side sheet metal (1x) found in the Metal parts 2/3 package
- Side Handle (1x) found in the Printed parts package
- Schraube M3x5rT (2x)
- Nylon-Niete (11x)

SCHRITT 42 Installing the left side

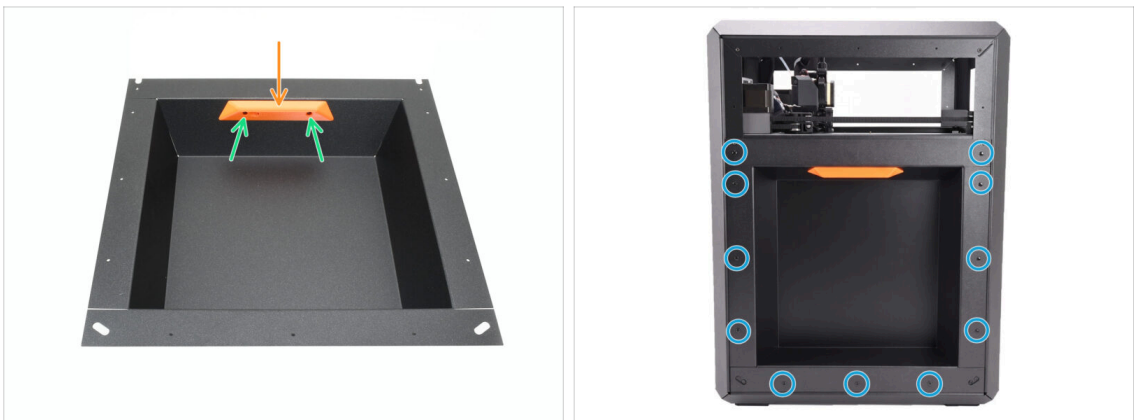

- Align the handle with the threaded openings in the sheet metal.
- Attach the handle using the two M3x5rT screws.
- Secure the side sheet metal to the printer using 11 nylon rivets.

SCHRITT 43 Haribo Zeit!

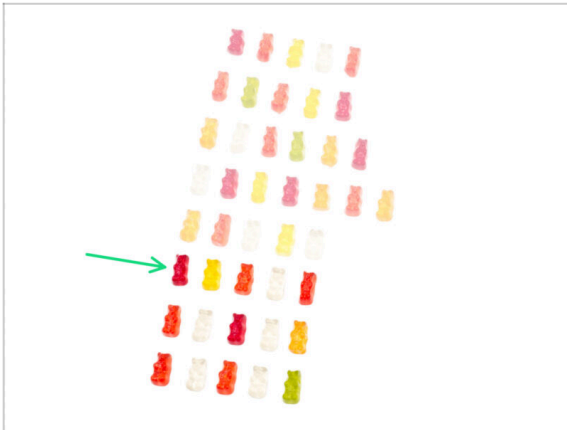

- Well done—fuel up for the next challenge!
- Eat the sixth row of gummy bears.
- We are getting close to the finish line! But **hands off those last gummies!**

SCHRITT 44 Abgeschlossen





- Congratulations! You've successfully assembled the entire body.
- Let's move to the next chapter.

8. Trim, Door & xLCD




SCHRITT 1 Tools necessary for this chapter

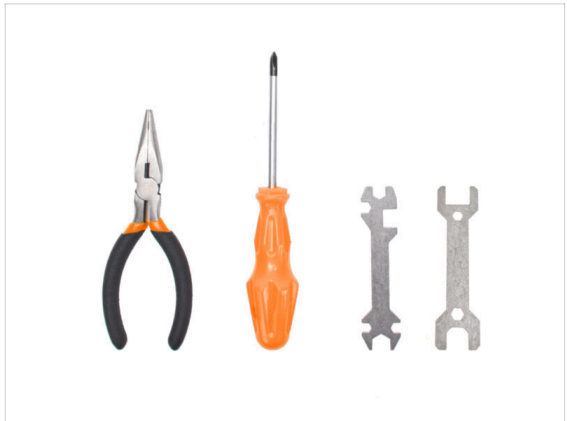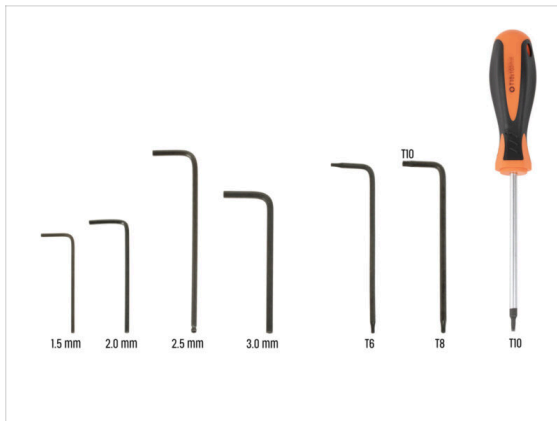

● **For the following steps, prepare:**

- 2,5mm Innensechskantschlüssel
- T10 Innensechsrund Schlüssel
- Spitzzange


SCHRITT 2 Top cover: parts preparation I.

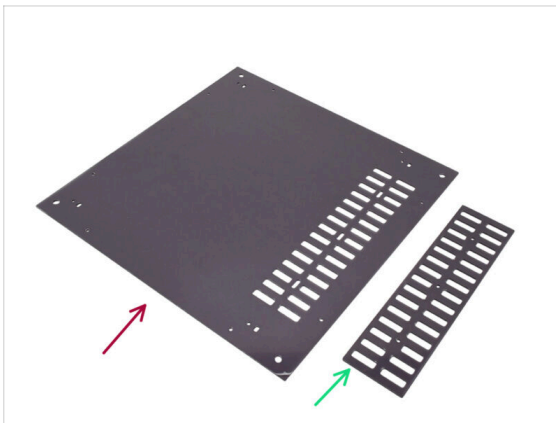

● **For the following steps, prepare:**

- Top cover (1x) *found in the Plexi set package*
- Vent cover (1x) *found in the Plexi set package*
- M3nN Mutter (3x)
- Insulating insert (3x) *found in the Electronics & Fasteners package*
- **i** This part may come in either gray or black. However, the shape is identical, and it does not affect the procedure.
- Schraube M3x12rT (3x)


SCHRITT 3 Top cover: parts preparation II.

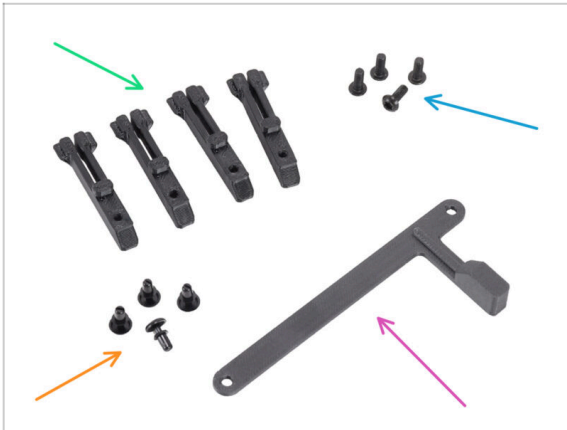

For the following steps, prepare:


- Top-cover-latch (4x)
- Vent-block (1x)
- Nylon-Niete (4x)
- Schraube M3x8rT (4x)

SCHRITT 4 Entfernen der Folie

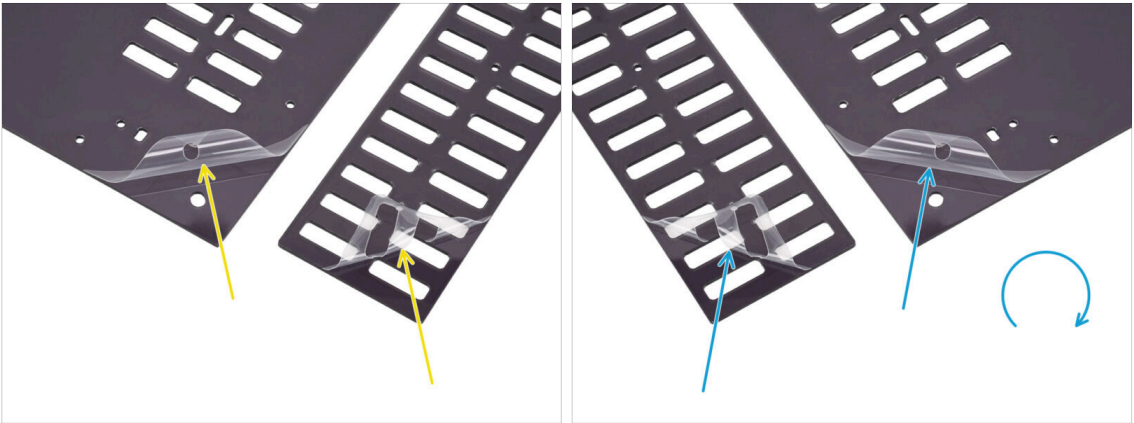

- First, remove the protection foil from both the plastic sheets.
- Flip the parts around and remove the protective foil from the other sides.


SCHRITT 5 Test-fitting the top cover

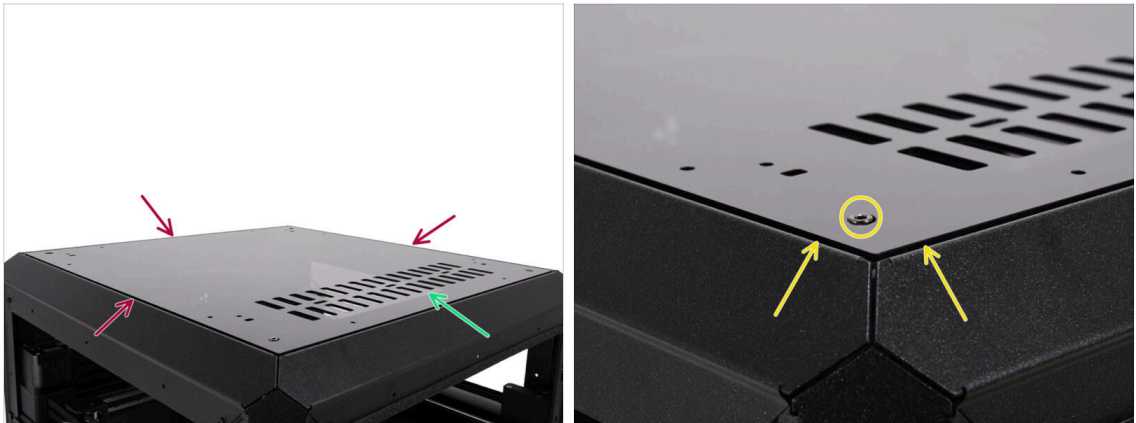

- 🔴 Lay down the top cover onto the printer.
- 🟢 The part with the vent openings should be oriented towards the front of the printer.
- 🟡 If oriented correctly, the cover will align with the recess, and the bolt heads in the corners will fit into the cutouts.
- 📘 If the bolt openings don't align, flip the cover.


Spoiler alert: The cover isn't symmetrical!

SCHRITT 6 Assembling the top cover I.

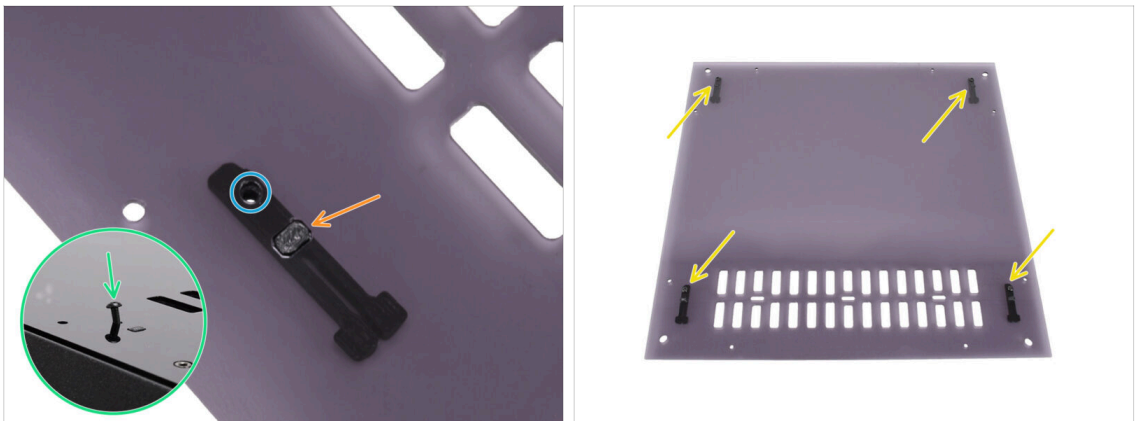


- 🟠 Push the Top cover latch notch through the designated hole.
- 🔵 Stellen Sie sicher, dass es richtig ausgerichtet ist, damit die Löcher übereinstimmen.
- 🟢 Ziehen Sie die Schraube M3x8rT fest.
- 🟡 Wiederholen Sie diese Schritte für alle vier Ecken.

SCHRITT 7 Assembling the top cover II.

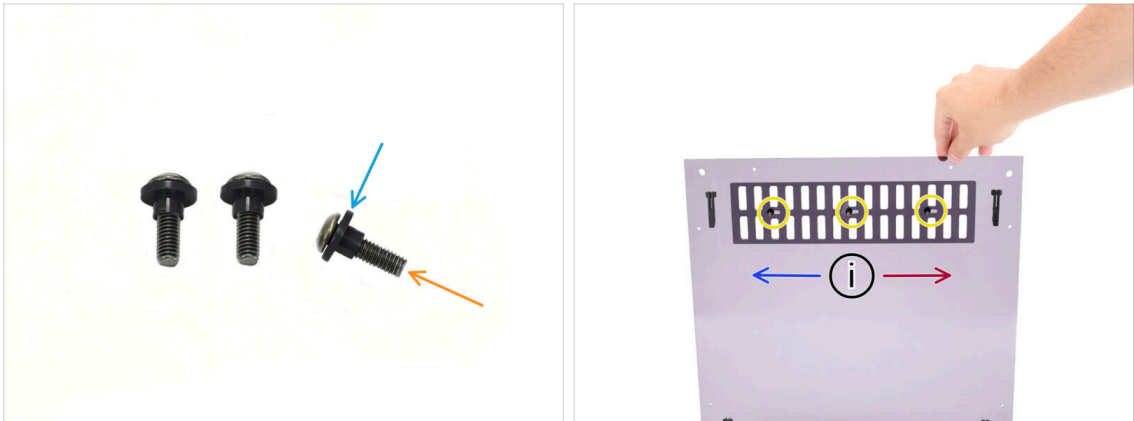

- 🔸 Run all three M3x12rT screws through the insulating inserts.
- 🔹 Make sure the flanged part of the insert is oriented toward the screw head.
- 🔸 Insert the screws with the inserts through the three slot openings in the vent and align the vent cover.
- 📘 Note that the vent cover is not symmetrical; **ensure that it is positioned as shown in the photos.**
 - 🔹 Sliding the vent cover to the left will open it.
 - 🔸 Sliding the vent cover to the right will close it.

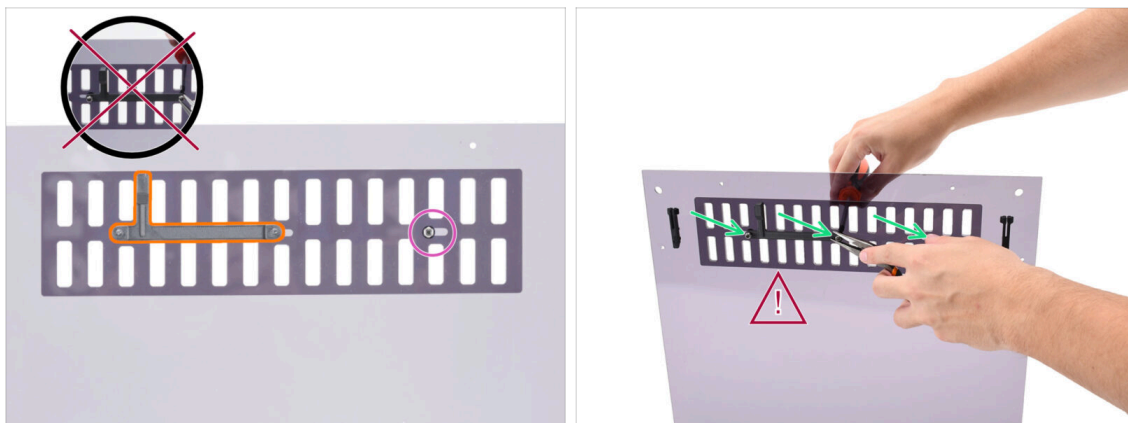SCHRITT 8 Montage der oberen Abdeckung III.


- ✳ Hand-tighten the rightmost M3nN nut onto the M3x12rT screw to fix the cover in place. Do not tighten it fully.
- ✳ Bringen Sie den Upg-Vent-Block an der Lüftungsabdeckung an. Achten Sie darauf, dass er richtig positioniert ist. Stellen Sie sicher, dass der Entlüftungsblock niemals mit den Lüftungslöchern überlappt.
- ⓘ Der Upg-vent-block-lever zeigt nach innen im Drucker, damit der Druckkopf die Entlüftungsabdeckung öffnen und schließen kann.
- ✳ Secure the Upg-vent-block on the ventilation cover with M3nN nuts. Use the needle-nose pliers or universal wrench to hold the nuts while tightening the screws.
- ⚠ The screw must be just tight enough to remove the slack. It must remain loose, or the ventilation cover can not open and close properly.

SCHRITT 9 Installing the top cover



- Try moving one of the three screws with your hand.
- ⓘ The vent openings must open and close smoothly without effort.
- ⚠ If movement is difficult, loosen the screw that is restricting it.
- Align the cover with the recess on the printer, ensuring the vent points forward.
- ⓘ Es ist etwas Kraft erforderlich, damit die Verriegelungen der oberen Abdeckung am Rahmen einrasten.

SCHRITT 10 Side covers: parts preparation

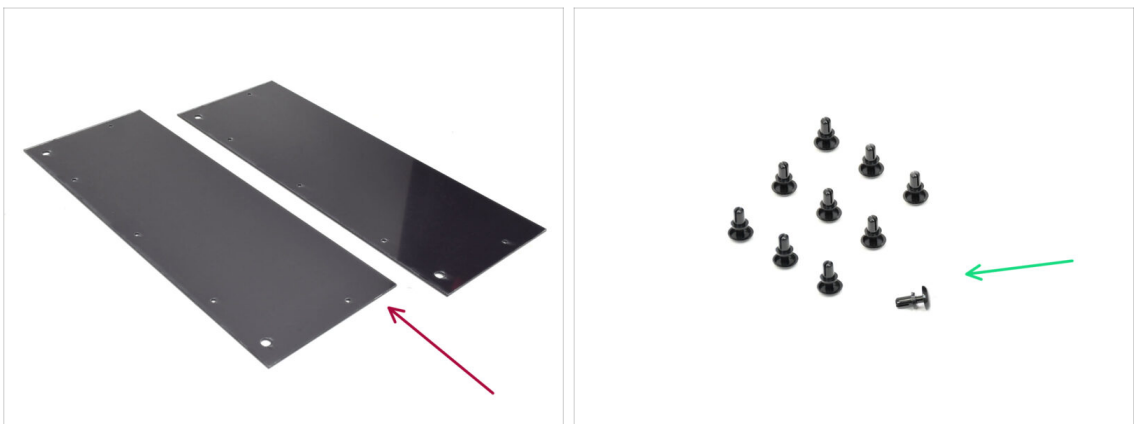

- For the following steps, prepare:
- Side Cover (2x) *found in the Plexi set package*
- Nylon-Niete (10x)

SCHRITT 11 Entfernen der Folie



- Remove the protective foil from both the side covers.
- Remove the protective foil from the other sides of both the side covers.

SCHRITT 12 Covering the left side



- Align the cover with the recess on the left side of the printer.
- The protruding screws on the printer must align with the larger openings in the cover.
- Secure the cover to the frame using five nylon rivets in the marked openings.

SCHRITT 13 Covering the right side



-  Align the other cover with the recess on the right side of the printer.
-  Secure the cover to the frame using five nylon rivets in the marked openings.

SCHRITT 14 xLCD: Teile Vorbereitung



-  **For the following steps, prepare:**
-  xLCD (1x) found in the Electronics package
-  xLCD Front Cover (1x) found in the Printed parts package
-  xLCD Display-mount (1x) found in the Printed parts package
-  Knob (1x) found in the Printed parts package
-  Schraube 3x8sT (4x)
-  Faston connector (1x) found in the Electronics package

SCHRITT 15 Assembling the xLCD I.




-  We recommend placing the front cover face down on a cardboard box edge or desk to create space for the encoder knob.
-  Remove the protective foil from the xLCD.
-  Insert the xLCD into the front cover.

SCHRITT 16 Assembling the xLCD II.




- Cover the assembly with the rear part.
 - If you have an older version of the printed rear cover, it must hook by the xLCD itself in the corner. With the up-to-date version, the rear part can be simply laid down.
- Fix the parts together using **JUST THREE** 3x8sT screws in the marked openings.
 - ⚠ Do not insert the screw into the fourth opening next to the long slot for the xLCD connector, visible through the cutout. Leave it empty for now.

SCHRITT 17 Installing the FE Faston connector

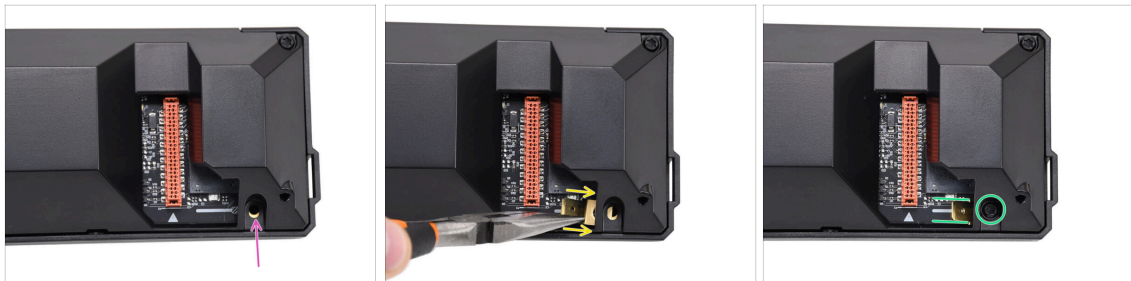


- Let's move on to the fourth screw opening—this is where we will attach the grounding faston connector.
 - Using needle-nose pliers, carefully maneuver the grounding faston connector over the screw opening, ensuring the holes line up.
 - Secure the connector in place using one 3x8sT screw, making sure it stays lined up as indicated.
 - ⚠ To prevent damaging some of the surrounding electronic components, be careful and make sure the connector doesn't spin, while tightening it.

SCHRITT 18 Installing the LCD knob

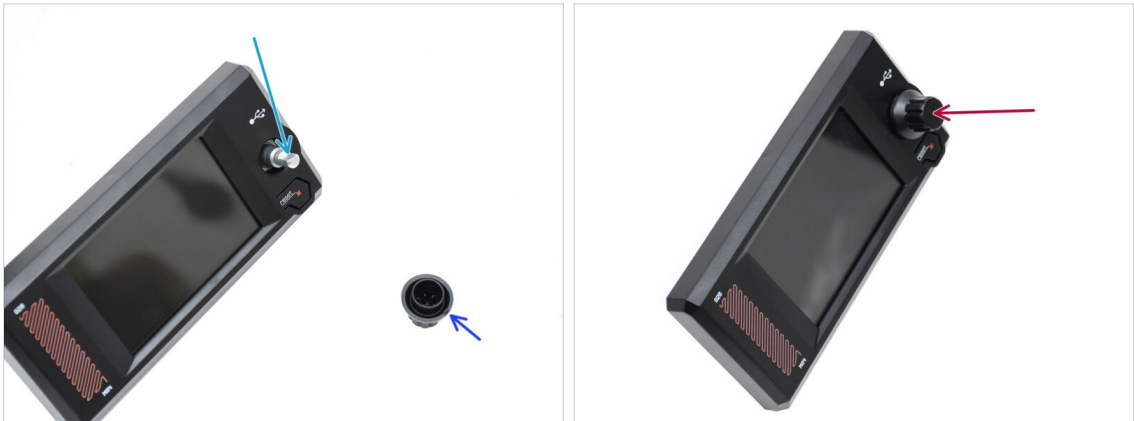

- There is a flat part on the encoder shaft. Rotate the encoder so that the flat part is facing up.
- There is a small gate scar on the injection-molded knob, which can serve as an orientation mark.
- Attach the knob onto the shaft, making sure the mark on the knob is facing up.

SCHRITT 19 xLCD bezel: parts preparation

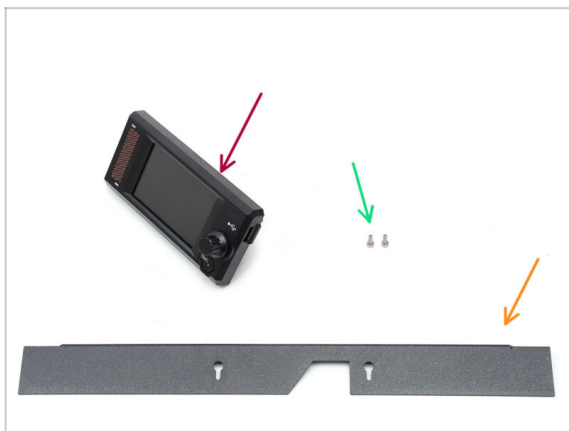


- For the following steps, prepare:**
- xLCD (1x) *found in the Electronics package*
- Schraube M3x6 (2x)
- Bezel (1x) *found in the Metal parts 2/3 package*

SCHRITT 20 Mounting the xLCD I.




- Attach two M3x6 screws into the openings. Do not screw them all the way in.
 - ❗ Die Schrauben werden direkt in den Kunststoff eingeschraubt, daher **ist ein leichter Widerstand normal**.
- Leave a gap of at least 3 mm under the screw heads.

SCHRITT 21 Mounting the xLCD II.

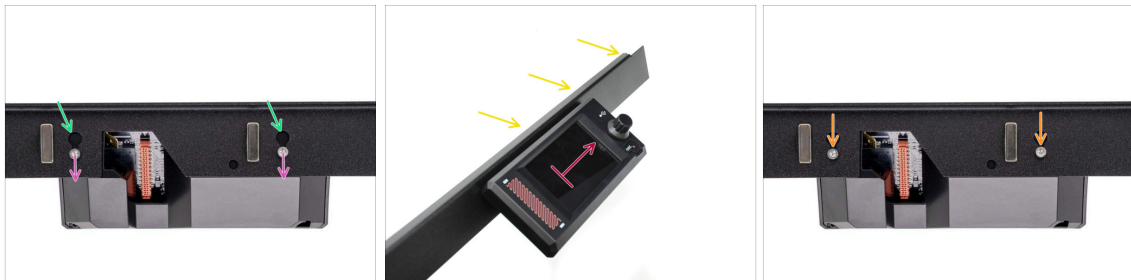

- Hook up the xLCD assembly onto the Bezel.
 - Insert the screw heads into the keyhole openings.
 - Slide the xLCD assembly so that the screw heads engage into the narrower parts of the keyholes.
- If assembled correctly, the LCD should be pointing up...
 - ...While the bent lip on the Bezel is on top.
- Push the screws all the way into the narrow part of the keyhole on both sides. Then, tighten the screws.

SCHRITT 22 Installing the xLCD assembly

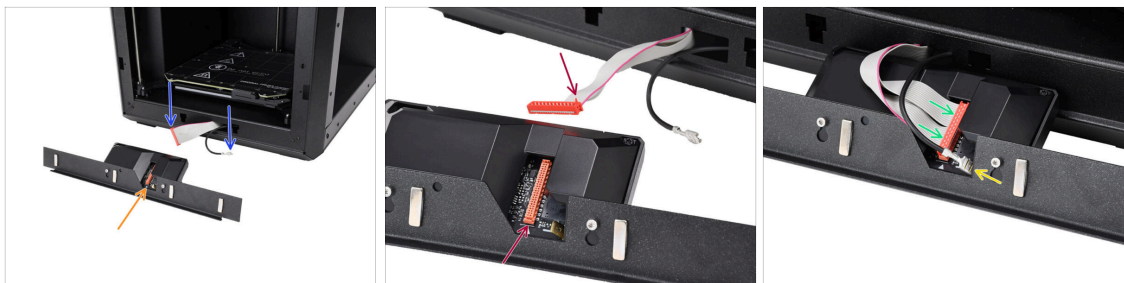


- Put the xLCD assembly in front of the printer, as pictured.
- Pull the appropriate cables out from the front of the printer to make connecting them easier.
- There is a small red tab on the main connector. This tab must be oriented towards the triangle symbol on the PCB.
- Connect the main connector into the xLCD.
- Connect the grounding faston connector.

SCHRITT 23 Securing the xLCD assembly



- Gently lift the xLCD assembly into the upward position.
 ⚠️ **Proceed carefully to ensure none of the cables get pinched or disconnected.**
- Hook the tiny tab on the left side of the bezel behind the left vertical profile of the printer.
- Gently lift the bottom part of the xLCD assembly to allow for smoother tab engagement and extra wiggle room.
- Hook the tab on the right side into the printer's right profile.

SCHRITT 24 Door seal: parts preparation

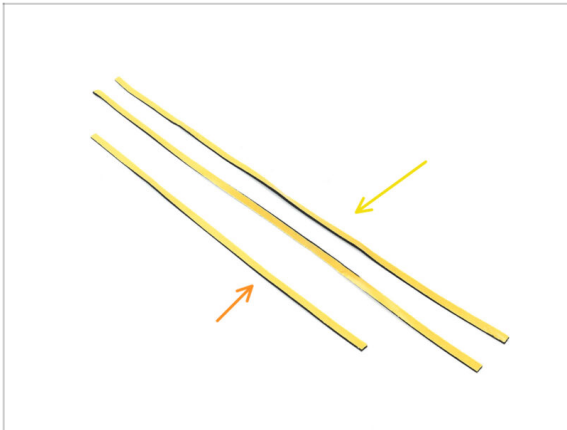

For the following steps, prepare:

- Side door seal (2x), longer ones found in the *Electronics & Fasteners* package
- Top door seal (1x), a shorter one found in the *Electronics & Fasteners* package
- i** The color of the protective layer may vary.

SCHRITT 25 Attaching the top seal




- Take the **SHORTER** seal.
- Peel off the start of the protective foil. No need to remove it entirely yet.
- i** No need to remove it entirely yet. For easier installation, you can peel it off gradually as you go.
- Start applying the seal along the top edge of the printer's frame.
- Begin offset from the corner by a distance equal to the seal thickness.
- Apply the seal along the top edge, leaving the end offset from the corner, just like on the other side.

SCHRITT 26 Attaching the side seals




- ✦ Apply the longer door seal, starting from the end of the seal on top.
- ✦ Work your way from the top down.
- ✎ Use the needle-nose pliers to trim any excess seal that overlaps with the LCD panel at the bottom.
- ✦ Using the same technique, apply the remaining long seal along the left edge of the printer's frame.

SCHRITT 27 Magnet holders: parts preparation

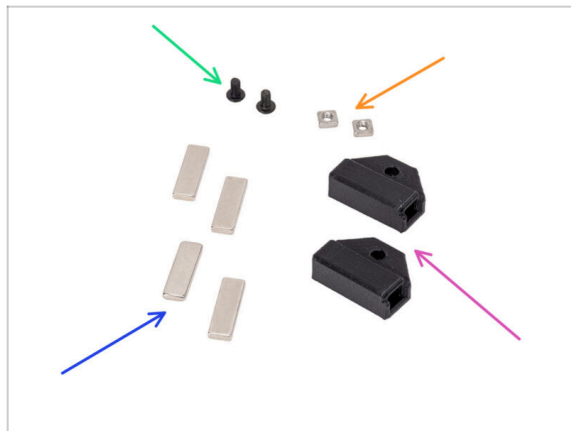

- ✦ **For the following steps, prepare:**
- ✦ Schraube M3x5rT (2x)
- ✦ M3nS Mutter (2x)
- ✦ 20x6x2 Magnet (4x) *aus dem Paket Electronics & Fasteners*
- ⚠ **Keep the magnets apart at a sufficient distance. They can break each other!**
- ✦ Magnet Holder (2x) *found in the Printed parts package*

SCHRITT 28 Assembling the magnet holders

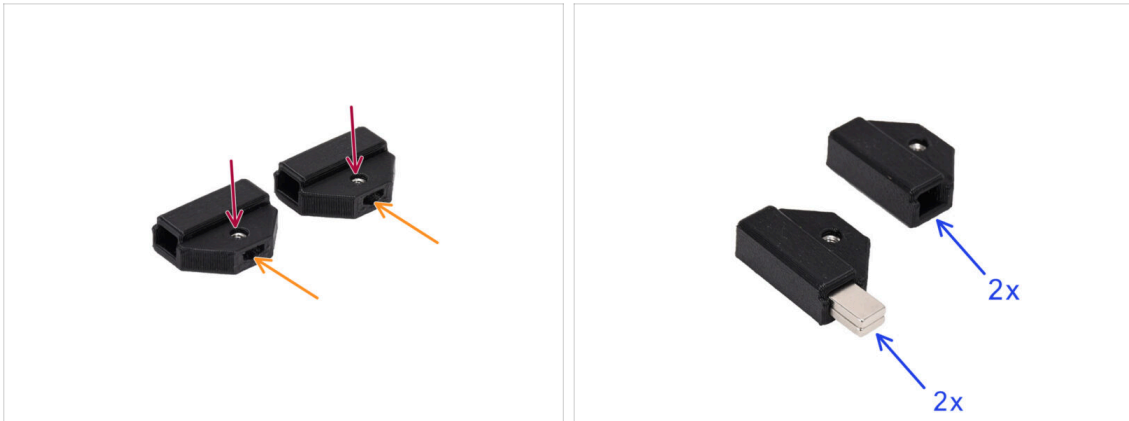

- 🟡 Insert the M3nS nuts into the corresponding openings in the magnet holders.
- 🔴 Push the nuts all the way in, until the thread aligns with the screw opening.
- 🟢 Setzen Sie **zwei übereinander gestapelte Magnete** in die entsprechenden Aussparungen der Halterungen ein. Schieben Sie diese vollständig hinein.
- 📄 ⓘ The orientation of the magnets does not matter.

SCHRITT 29 Installing the magnet holders



- 🟡 From the inside of the printer, insert the magnet holder assembly into the corresponding bottom opening in the right-side metal profile.
- ⚠️ Ensure the protruding rectangular pocket fits into the cutout.
- 🟢 Secure the assembly in place using the M3x5rT screw.
- 🟢 Using the same technique, install the other magnet holder into the top opening on the right side.


SCHRITT 30 Scharniere: Vorbereitung der Teile



For the following steps, prepare:


- Door-hinge-in (2x) found in the CoreXY + Hinges set package
- Door-hinge-out (2x) found in the CoreXY + Hinges set package
- Hinge Pin 2 x 40 mm (2x) found in the Electronics & Fasteners package
- Schraube M3x5rT (2x)

SCHRITT 31 Installing the door-hinge-in parts

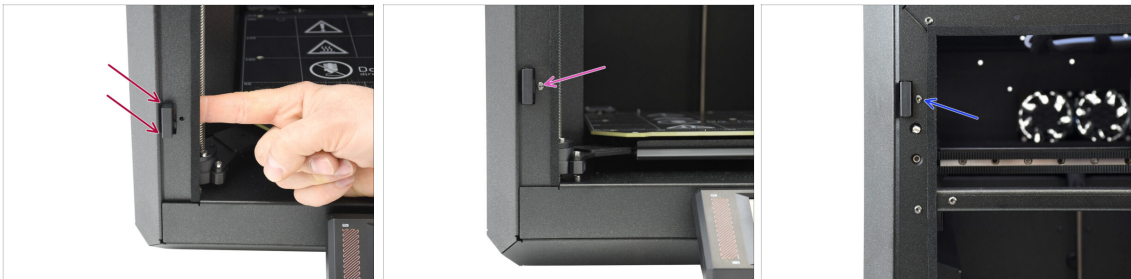


- From the inside of the printer, insert the door-hinge-in into the bottom rectangular opening in the left-side profile. The protruding part should pass through to the front.
- Fix the door-hinge-in in place using the M3x5rT screw.
- Using the same technique, install the other door-hinge-in into the opening on top.

SCHRITT 32 Installing the door-hinge-out I.

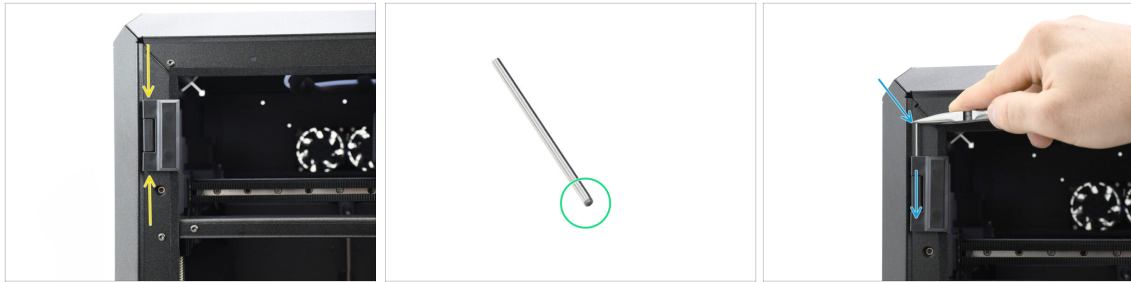

- ✦ Align the door-hinge-out with the door-hinge-in.
- ✦ The chamfered end of the hinge pin should be inserted first to make assembly easier.
- ✦ Insert the pin from the top of the door-hinge-out, guiding it through the door-hinge-in until it is fully inserted.
- ❗ Use the tip of needle-nose pliers to press the pin in securely.

SCHRITT 33 Installing the door-hinge-out II.

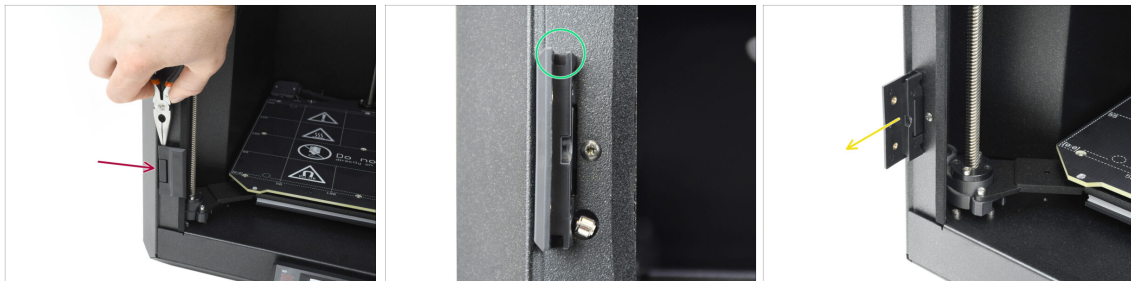

- ✦ Using the same technique, install the bottom door-hinge-out to complete the hinge assembly.
- ✦ Look into the grooves on the door-hinge-out parts and verify that the pins are fully inserted.

No part of the pin should be visible above the bottom surface in the groove.

- ✦ Open up both the hinges.


SCHRITT 34 Door panel: parts preparation



For the following steps, prepare:


- Door (1x) found in the Plexi set package
- ❗ Das Türblatt ist mit **CORE ONE+** vorbeschriftet. Keine Sorge, **das ist so gewollt!** Im letzten Schritt werden Sie den Gen 2 Upgrade + Aufkleber anbringen.
- Door handle (1x) found in the Metal parts 2/3 package
- Schraube M3x5rT (4x)
- Türgriffplatte (1x) aus dem Paket „Metallteile 2/3“
- Schraube M3x8rT (2x)

SCHRITT 35 Installing the door handle

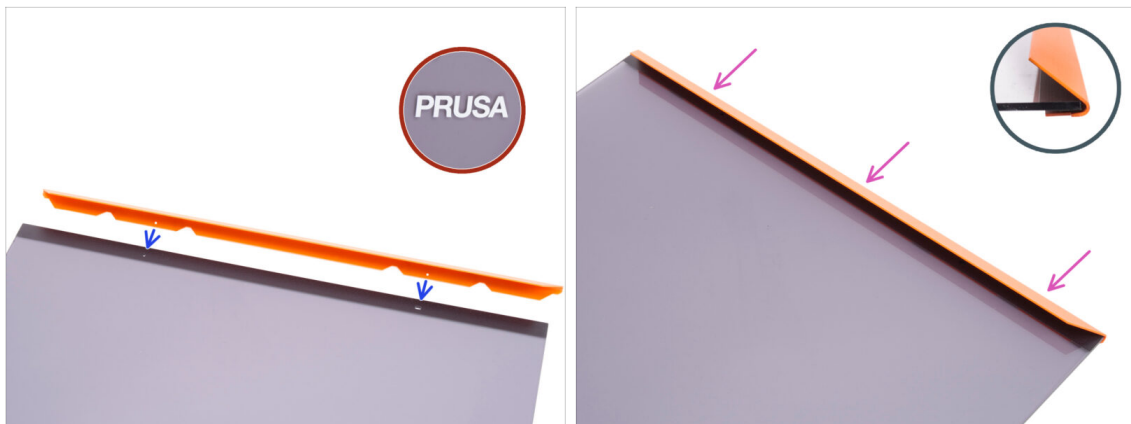

- Place the door handle next to the door panel, as shown in the picture.
- ⚠ Make sure the Prusa logo is now on the **top side**.
- Align the holes in the door handle with the holes in the door panel.
- Slide the door handle onto the panel.

SCHRITT 36 Befestigen des Griffs

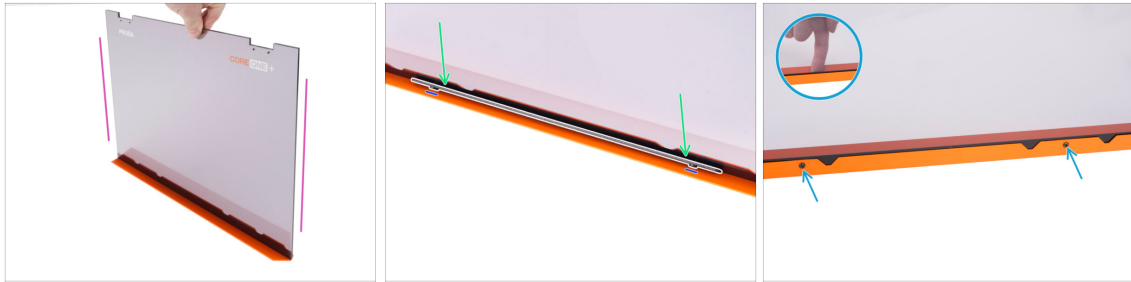

- ✿ Lift the door panel into a vertical position and hold it steady.
- ✿ Insert the door handle plate into the grip side of the handle (the outward-tilting side).
- ✿ Make sure the threaded columns on the plate face **away from the panel**.
- ✿ Align these columns with the screw holes in the door panel and the door handle. Secure the handle with two M3x8rT screws. Tighten firmly, but gently.

SCHRITT 37 Installing the door panel



- ✿ Align the door with the hinges. The cutouts on the door should fit into the grooves on top and bottom of the leaves.
- ✿ Make sure the door is oriented so that the signs on the door are pointing outward.
- ✿ Slide the door all the way into both the hinges.
- ✿ Fix the door to the hinges using four M3x5rT screws. Start with the top one. Then, do the bottom.

SCHRITT 38 Attaching the sticker: Parts preparation



■ For the following step, prepare:


- CORE One+ plexi sticker

SCHRITT 39 Anbringen des Aufklebers



- Remove the sticker from the blue base.
- Align the sticker with the **ONE** and gently but firmly apply pressure on the sticker.
- Carefully peel off the transparent layer and make sure that + is not peeling off.

SCHRITT 40 Haribo Zeit!

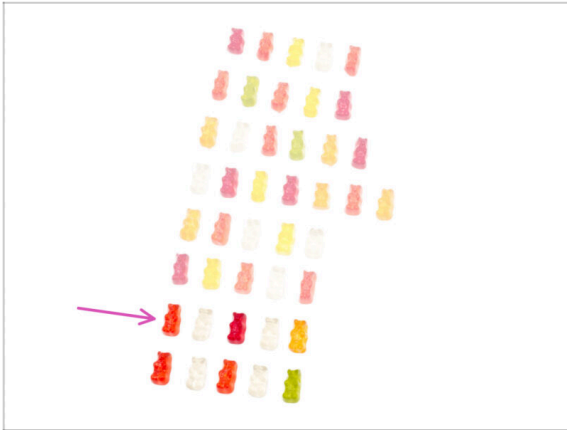


- Hard work deserves sweet results!
- Eat the seventh row.
- ⚠ But do not eat the rest yet.

SCHRITT 41 Abgeschlossen




- Herzlichen Glückwunsch! Sie haben Ihren Prusa CORE One+ (Gen 2) erfolgreich zusammengebaut.
- Let's move to the final chapter.

9. Calibration & First run

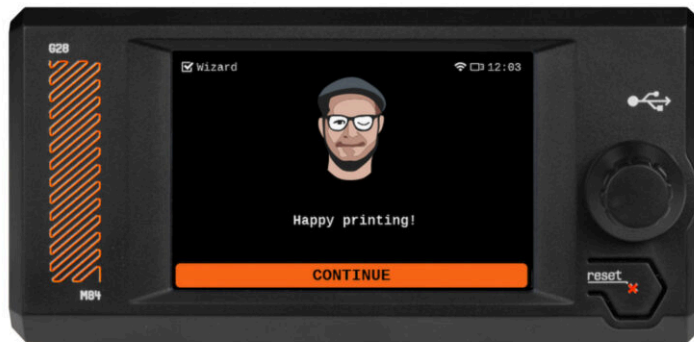

SCHRITT 1 Riemen Spannen

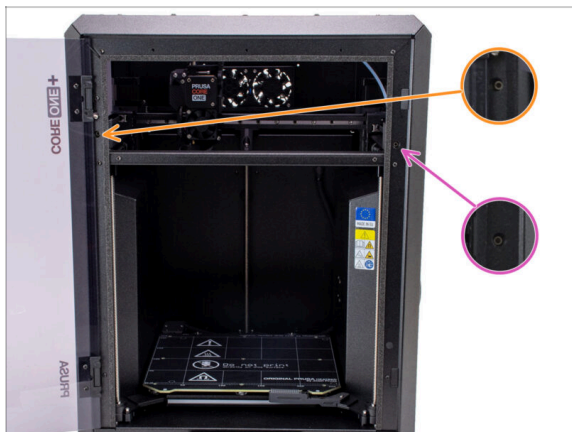

i This chapter will guide you through calibrating and preparing the printer for its first run. Starting with tensioning the belts:

🟡 The left screw adjusts the upper belt.

🟣 The right screw adjusts the lower belt.

⬛ Double-check that the **M3x30 screws in the belt tensioners were lubricated** during assembly.

⚠️ WARNING: Incorrect procedure may result in damage to plastic parts or seizing of screws. Before adjusting the belt tension, read the dedicated article:

⬛ **Einstellen der Riemenspannung (CORE One-Serie)**

📌 Do not forget to come back here after adjusting the belts.

SCHRITT 2 Installing the spoolholder: Parts preparation



⬛ For the next step, prepare:

🟡 O-Ring

🟢 Spoolholder-handle

i The spool holder and the O-ring are in the same bag.

SCHRITT 3 Attaching the print sheet and spoolholder



⚠ Make sure there is nothing on the heatbed. The heatbed must be clean. Any dirt can damage the surface of both the heatbed and the print sheet.


➡ **Attach the sheet by first aligning the rear cutout with the locking pins on the back of the heated bed.** Hold the sheet by the front two corners and slowly lay it down onto the heated bed - **watch your fingers!**

- Halten Sie das Druckblech sauber, um eine optimale Leistung zu gewährleisten.
- Ursache Nr. 1 für das Ablösen von der Druckoberfläche ist ein fettiges Druckblech. Benutzen Sie IPA (Isopropylalkohol) zum Entfetten, wenn Sie die Oberfläche zuvor berührt haben.

➡ Setzen Sie den O-Ring auf den Spoolholder-handle.

➡ Schieben Sie den Spoolholder-handle in den Puck-universal und rasten Sie ihn durch Drehen im Uhrzeigersinn ein.

SCHRITT 4 Firmware Update

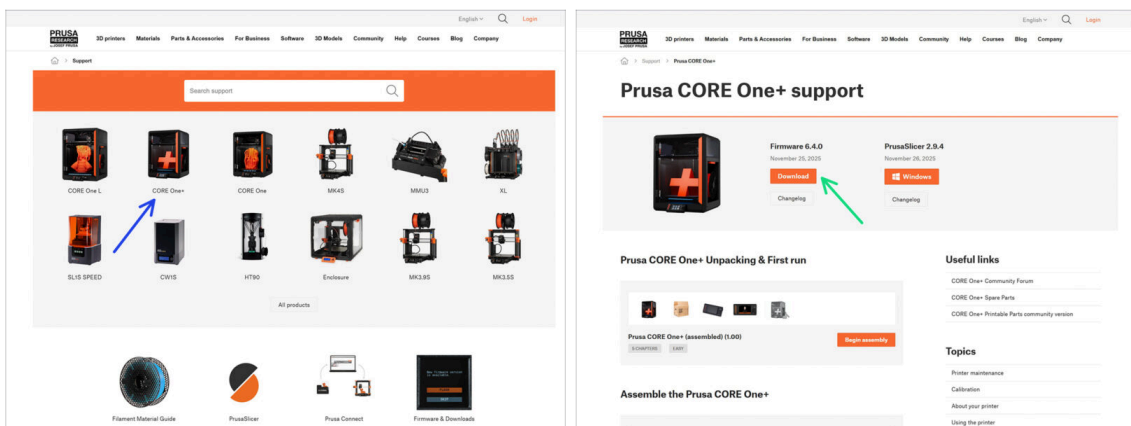

i All printers come with a USB drive containing the latest firmware. However, it is recommended to check and possibly upgrade the firmware version every few weeks.


- Besuchen Sie die help.prusa3d.com Seite.
- ➡ Navigare to the Prusa CORE One+ page.
- ➡ Download the latest firmware version.
- Save the firmware file (*.bbf*) onto the *bundled USB drive*.

SCHRITT 5 Turning on the printer



- ✿ Insert the USB drive included in your kit into your printer.
 - ❗ The included USB drive contains the latest firmware file.
- ✿ Connect the power cable and plug the printer into a wall outlet.
- ✿ Turn the printer on using the switch on the back.
- ❗ The printer will now detect if a new firmware file is available on the USB drive.
- ✿ If the "New firmware available" screen appears, hit **FLASH** by pressing the rotary knob to upgrade to the latest firmware.
 - ✿ If no such message appears, the printer is running the latest firmware already. Proceed to the next step.

SCHRITT 6 Setting up the printer: Intro

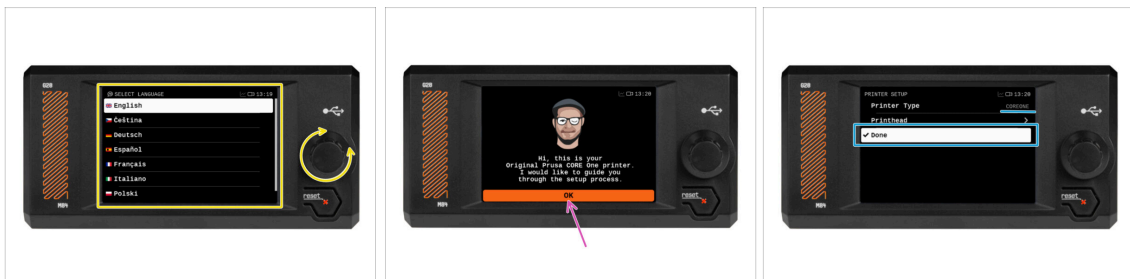

- ✿ The printer displays on the screen a prompt to select your language. Use the control knob or touchscreen to set your preference.
- ✿ After selecting your language, the printer will display the welcome screen. Hit **OK** to continue through the setup process.
- ✿ The next screen will prompt you to select your printer model COREONE. Hit **Done** to continue.

SCHRITT 7 Setting up the printer: Network setup




- The Network Setup screen will ask you to connect to a Wi-Fi network using our official Prusa mobile app.
- ① Lesen Sie mehr auf prusa.io/app.
- If you select **No**, the printer will show alternative ways to connect to Wi-Fi. This step is optional and can be done later.
- ① You can skip this screen and set up the network connection later.

SCHRITT 8 Assistant: Intro



- ① The printer will prompt you to run self-tests and calibrations for all important components. The entire process takes a few minutes, with some parts requiring direct user interaction.
- Hit **YES** to begin the self-test and follow the instructions on screen.
- ⚠ During the self-test, **keep the door closed** until you are prompted. Opening the door will interrupt the process.
- There are **HOT** and moving parts inside during the self-test.
- The printer will begin by testing all the fans. **Be aware—it can get quite noisy for a while!**

SCHRITT 9 Wizard: Door Sensor Calibration

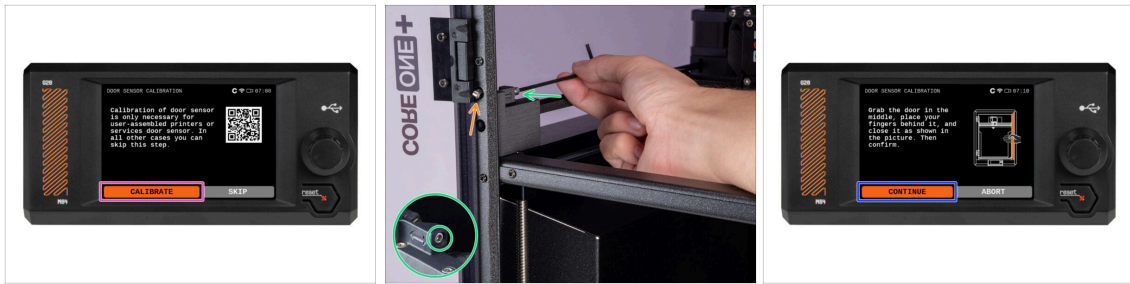


- ✿ The first part that requires your interaction is the door sensor calibration. To begin, hit **Calibrate** and follow the on-screen instructions.
- ✿ You'll be prompted to gradually tighten the sensor tension screw from its default loose position - usually in half-turn steps, possibly several times during calibration.
 - ✿ After each adjustment, observe the door sensor switch emerging from the front profile hole.
 - ✿ Repeat the procedure until the door sensor is correctly adjusted - meaning it switches at a hand-gap distance. Then hit **Continue**.
- ❗ Once the sensor is properly calibrated, you should hear an audible click from the door sensor area when opening and closing the door.

SCHRITT 10 Assistant: Wägezellentest



- ✿ The next step of the wizard will prompt you to touch the nozzle to test and calibrate the Loadcell. During this procedure, the **parts of the printer are not heated up** so that you can touch them. Hit **Continue**.
- ❗ Loadcell calibration requires the door to be open, as you must interact directly inside the printer.
 - ✿ Do not touch the nozzle yet, wait until prompted by the **Tap nozzle NOW** message.
 - ✿ Tap the nozzle from below. In case the Loadcell does not detect the touch, you will be prompted to repeat the step. Otherwise, you will see **Loadcell test passed OK** when it succeeds.
 - ✿ To allow the printer to continue with the Wizard, **close the door**.

SCHRITT 11 Assistent: Getriebeausrichtung

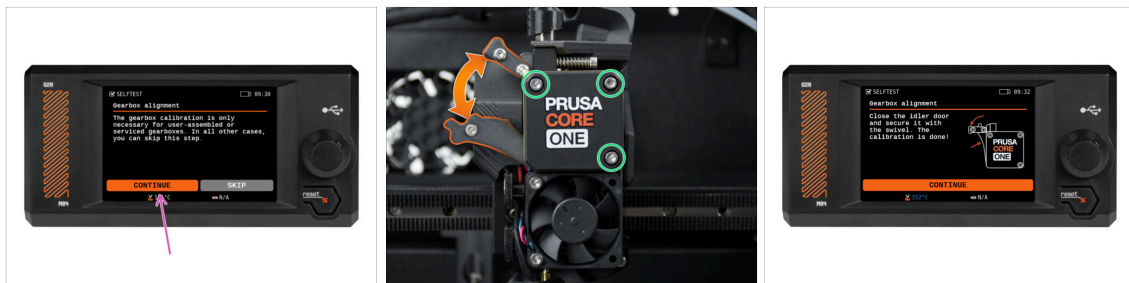


- ✦ Once you get to the Gearbox Alignment part, select **Continue** and follow the on-screen instructions.
- ✦ Make sure the idler lock (swivel) is unlocked from the idler door.
- ✦ Loosen the three screws on the front of the gearbox by 1.5 turns.
- ❗ The printer will go through the automatic gearbox alignment. This process can't be seen from the outside.
- ⬛ Once prompted, tighten the three screws in the pattern indicated on the screen.

SCHRITT 12 Wizard: Filament Sensor Calibration




- ✦ Check the manual switch on the filament sensor. **Make sure that it is ON.**
- ✦ During the filament sensor calibration, you will need to use a short piece of filament. Prepare the filament and select **Continue**.
- ❗ There should be no filament inside the extruder before the calibration process starts.
- ✦ Place a spool of filament onto the spool holder on the right side of the printer.
- ✦ When prompted, begin inserting the filament into the PTFE tube located beneath the right handle.
- ⬛ Remove the filament after the calibration finishes.

SCHRITT 13 Assistent abgeschlossen

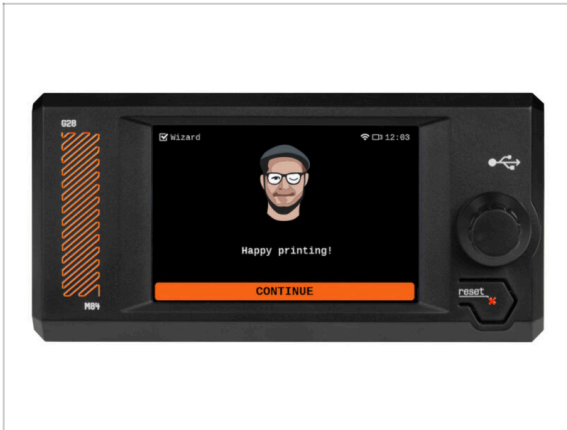

- Congratulations! The Wizard is complete. Now it's time to test some prints.

SCHRITT 14 Haribo Zeit!

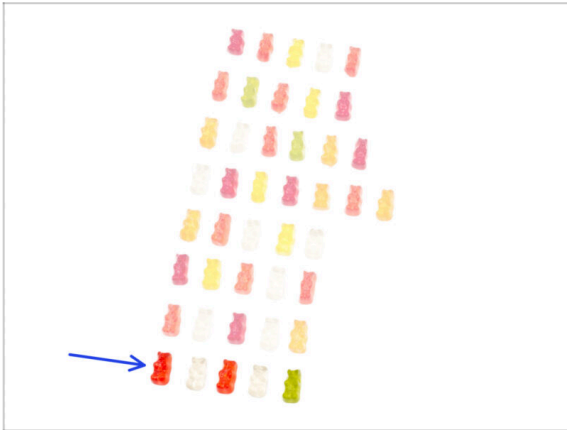

- Victory tastes like gummy bears!
- Enjoy the rest. You've earned this.

SCHRITT 15 Handbuch



- ◆ Read the **3D Printing Handbook** dedicated to your printer and follow the instructions to set up the printer and prepare it for your first print.



The latest version is always available at help.prusa3d.com.




Read the Disclaimer and Safety instructions chapters.

SCHRITT 16 Geben Sie uns Feedback



- ◆ We know you're eager to start printing, but we'd really appreciate it if you could take 3–4 minutes to **share your thoughts** on this manual: how clear it was, how easy it was to follow, and any ideas to improve it.
 - ① This feedback is a little different from the usual comments you might leave on individual steps.
- ◆ **Share your feedback here.**
- ◆ Thank you for helping us make our manuals even better!

SCHRITT 17 Prusa-Wissensbasis


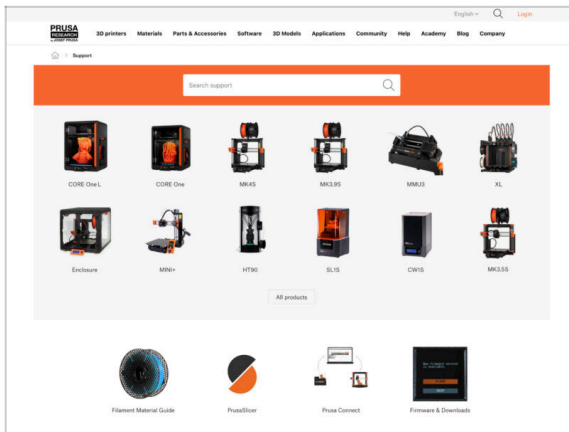


If you encounter any problems at all, don't forget you can always check out our knowledge base at help.prusa3d.com



We're adding new topics every day!

SCHRITT 18 Kommen Sie zu Printables!

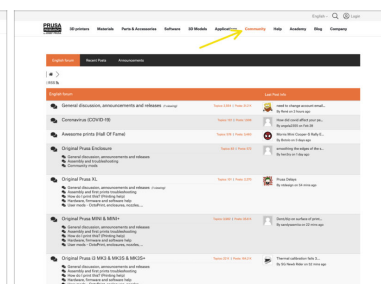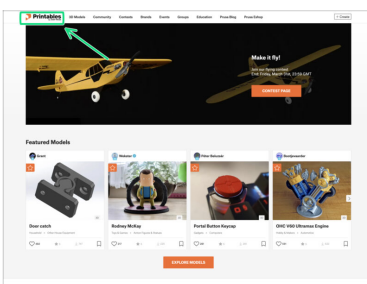

- 🟢 Don't forget to join the biggest Prusa community! Download the latest models in STL or G-code tailored for your printer. Register at [Printables.com](https://printables.com)
- 🟣 Looking for inspiration on new projects? Check our blog for weekly updates.
- 🟡 If you need help with the build, check out our forum with a great community :-)
- 📍 All Prusa services share one user account.

Änderungsprotokoll der Anleitung



SCHRITT 1 Versionsgeschichte



- **Versionen der Prusa CORE One+ (Gen 2) Umrüstsatz Montageanleitung:**
- 08/2026 - Erste Version 1.00

[illegible]

This image shows a full page of blank, lined paper. It features approximately 20 evenly spaced horizontal grey lines across the entire width of the page, providing a guide for writing. The background is a clean, solid white color. There are no margins, text, or other markings present.

[illegible]

[illegible]

